COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	680 and 682	With Wiper Switch Off: Push Washer Switch In Release Washer Switch	Closed Circuit 103.3K ohm
Wiper Switch Circuit	684 and 682	Off Int Low High	47.6K ohm ± 5% 11.33K ohm ± 5% 4.08K ohm ± 5% Closed Circuit
Interval Time Adjust	680 and 682	Int and Off Low and High	Rotate Control toward OFF: Ohmmeter will show smoothly increasing resistance from 3.3K ohm min. to 103.3K ohm max. ± 10% 3.3K ohm ± 10%

SCHEMATIC – WIPER/WASHER PORTION

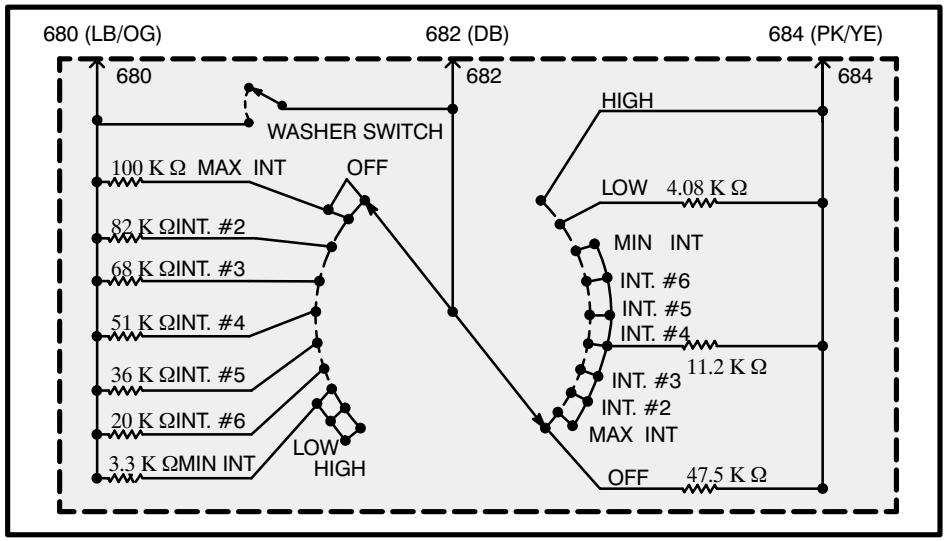
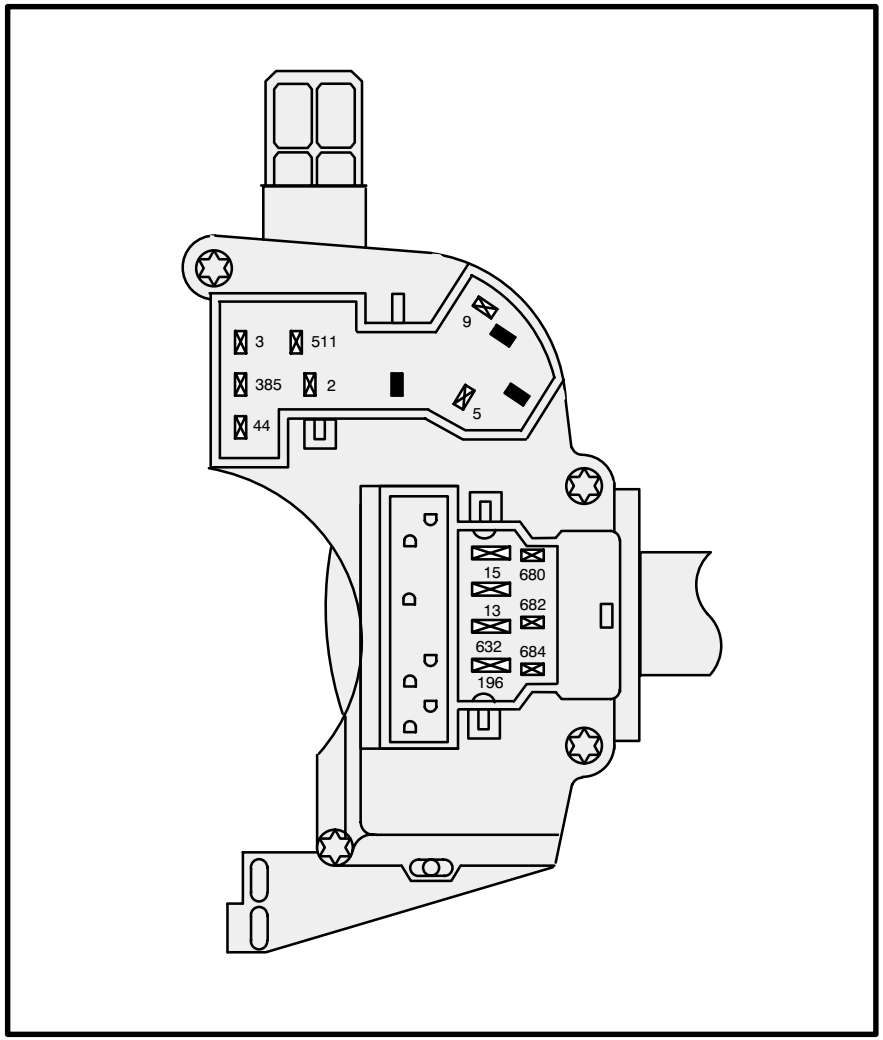
TERMINALS