COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	590 and 993	With Wiper Switch OFF: Push washer switch in Release washer switch	Closed Circuit 103.3k ohm (± 10%)
Wiper Switch Circuit	685 and 993	OFF INT LOW HIGH	47.6k ohm 11.33k ohm 4.08k ohm Closed Circuit } (± 5%)
Interval Time Adjust	590 and 993	INT and OFF LOW and HIGH	Rotate Control toward OFF; Ohmmeter will show smoothly increasing resistance from 3.3k ohm min. to 103.3k ohm max. (± 10%) 3.3k ohm (± 10%)

SCHEMATIC – WIPER/WASHER PORTION

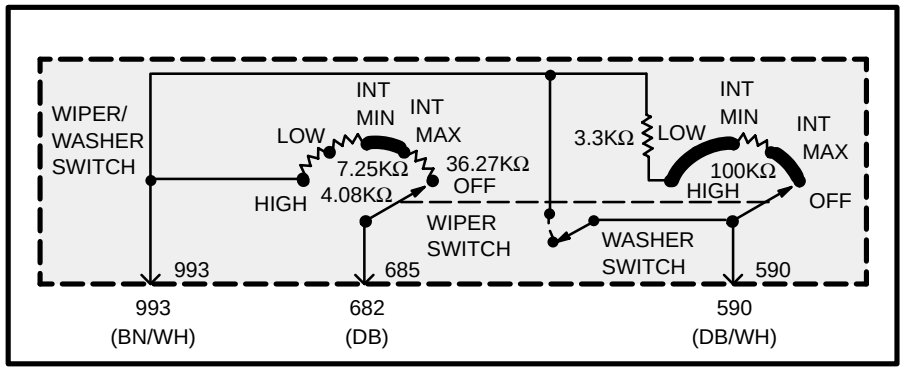
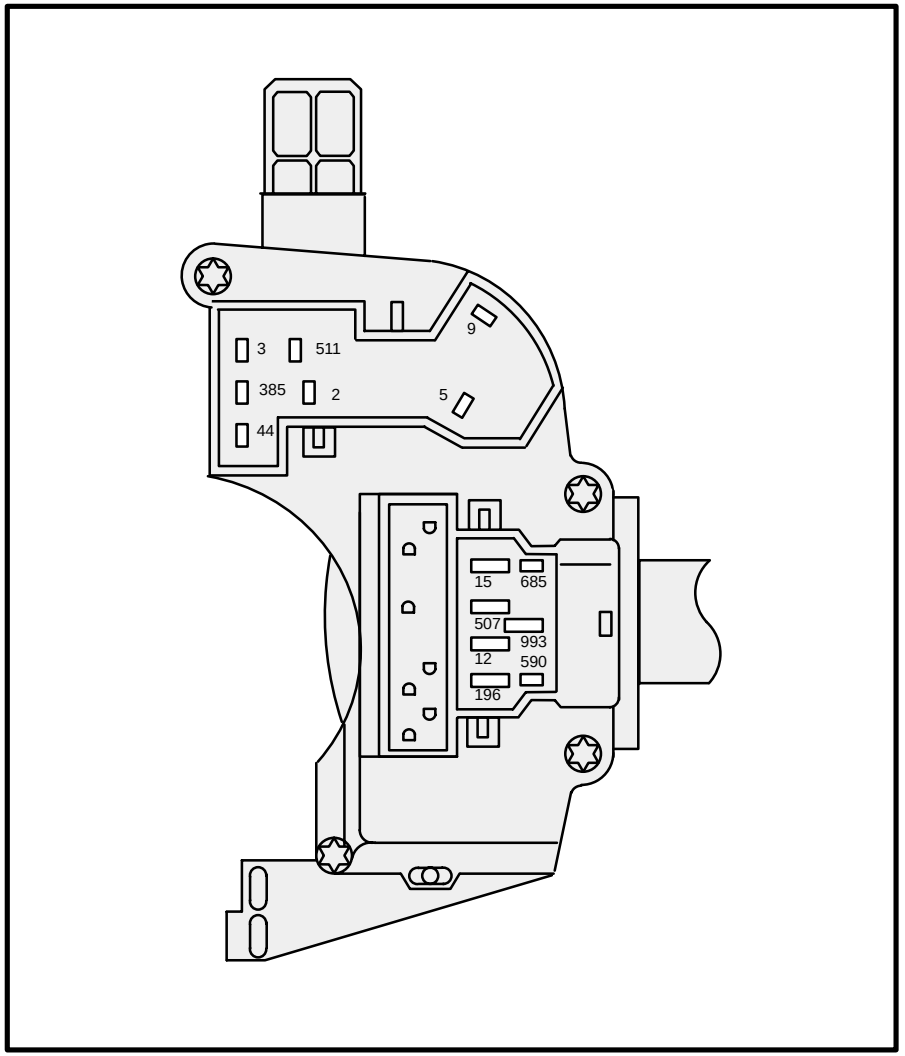
TERMINALS