4R100

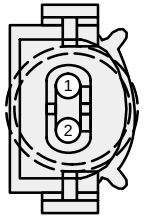

C187

OUTPUT SHAFT SPEED (OSS) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	136 (DB/YE)	Output Shaft Speed (OSS) Sensor Signal to PCM
2	1202 (BN/LG)	Signal Return

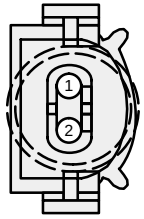

C192

TURBINE SHAFT SPEED (TSS) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	970 (DG/WH)	Turbine Shaft Speed (TSS) Sensor Signal (TSSV)
2	971 (PK/BK)	Signal Return

CONNECTOR REFERENCE LIST

CONNECTOR	SECTION-PAGE
C141	22-18, 25-11, 26-14, 27-13
C174	22-16, 25-9, 26-10, 27-11
C189	34-6