Component Testing – Multifunction Switch, Wiper/Washer Portion

SCHEMATIC

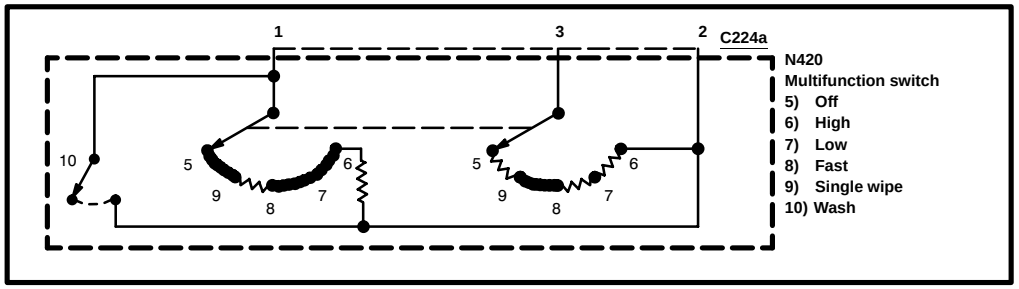

TERMINAL LOCATIONS

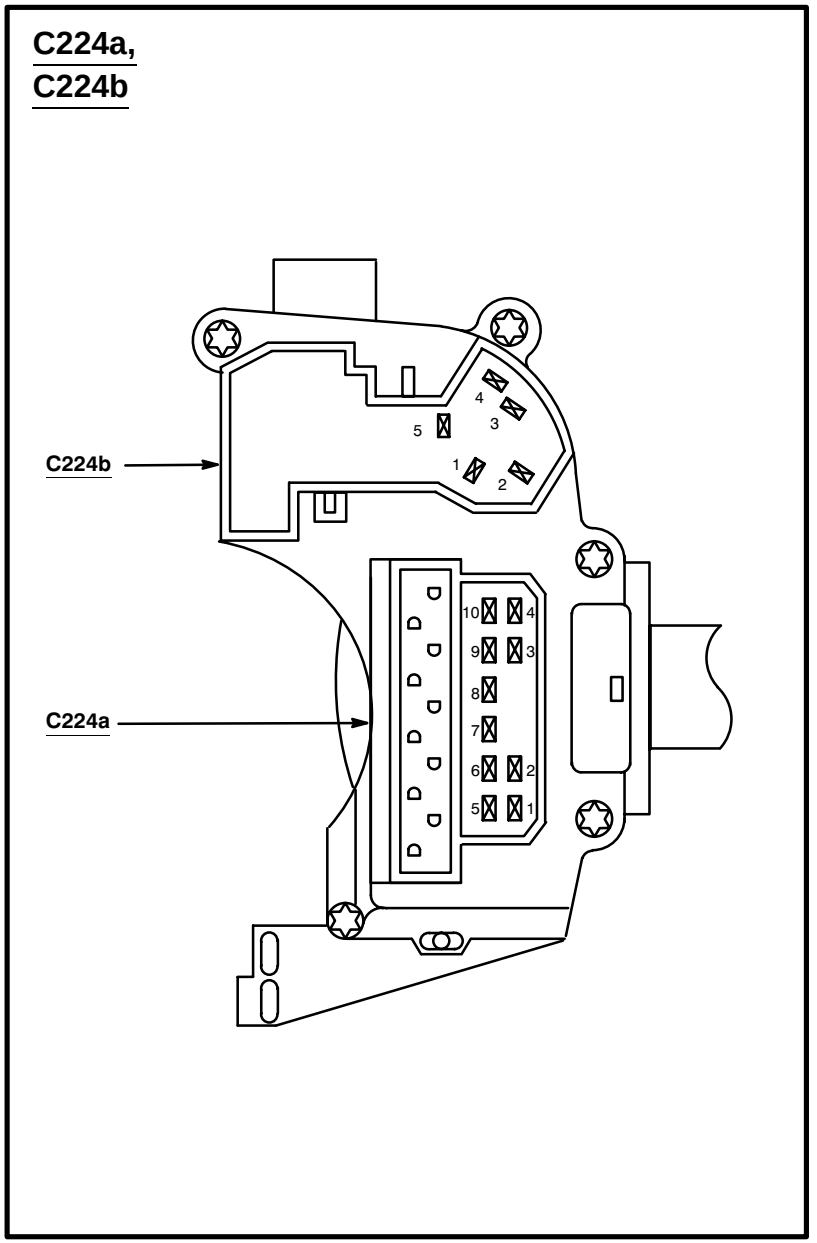

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	1, C224a and 2, C224a	Off, Switch Depressed	Closed Circuit
		Off, Switch Normal	103.3K ohm
Wiper Switch Circuit	3, C224a and 2, C224a	Off	47.6K ohm
		Fast	11.33K ohm
		Low	4.08K ohm
		High	Closed Circuit
Interval Time Adjust	1, C224a and 2, C224a	Fast and Off	Resistance will smoothly increase from 3.3K ohm min. to 103.3K ohm max.
		Low and High	3.3K ohm