149-3 COMPONENT TESTING: MULTIFUNCTION SWITCH

TERMINALS

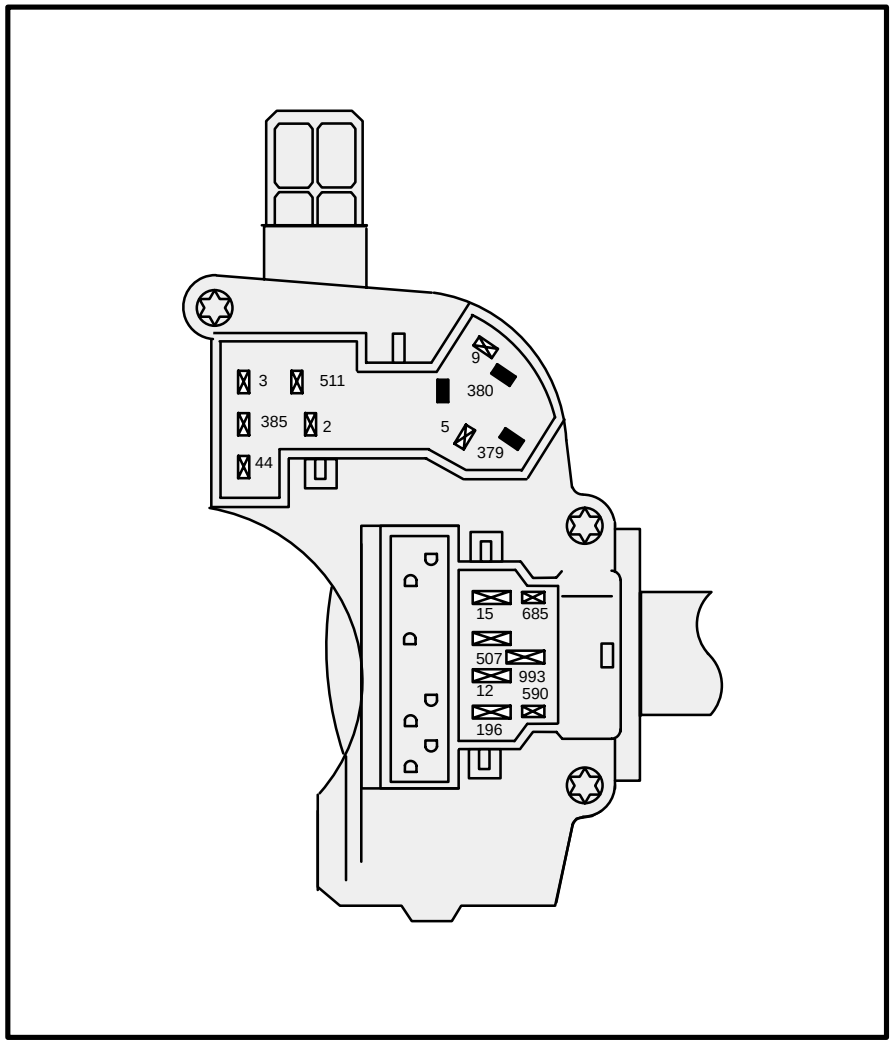

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	993 and 590	With Wiper Switch OFF: Push Washer Switch in Release Washer Switch	Closed Circuit 2670 ohm
Wiper Switch Circuit	685 and 993	OFF INT LOW HIGH	955 ohm 1910 ohm 401 ohm Closed Circuit (+/– 5%)
Interval Time Adjust	993 and 590	OFF Through INTERVAL Steps	Rotate control from OFF; Ohmmeter will show decreasing resistance from 2670 ohm max. to 249 ohm min. (+/– 10%)
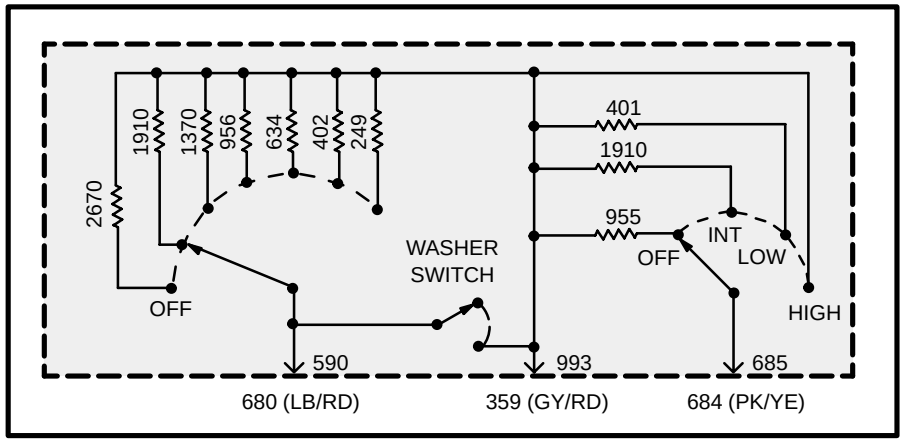
SCHEMATIC