TERMINALS

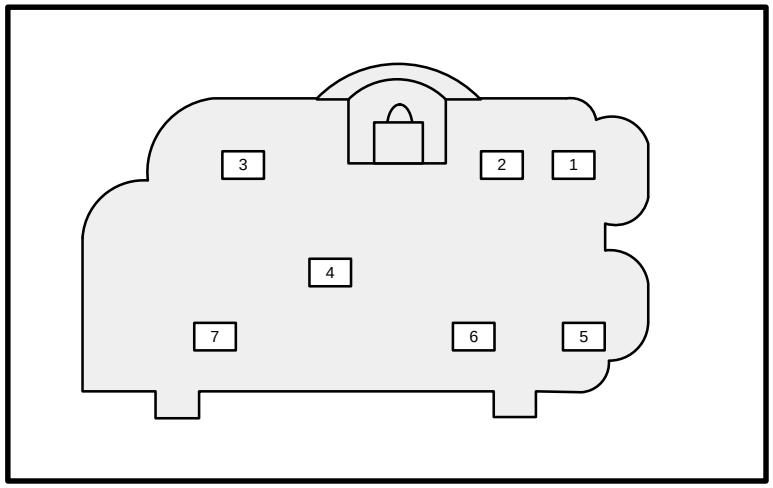

SCHEMATIC

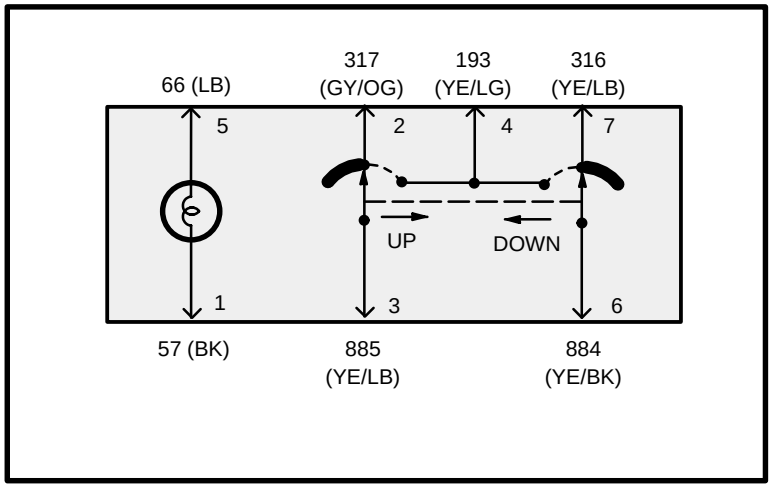

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Up Switch Circuit	4 and 3	Up	Closed Circuit
	2 and 3	At Rest	Closed Circuit
Down Switch Circuit	4 and 6	Down	Closed Circuit
	7 and 6	At Rest	Closed Circuit