W/O CENTRAL SECURITY MODULE

TERMINALS

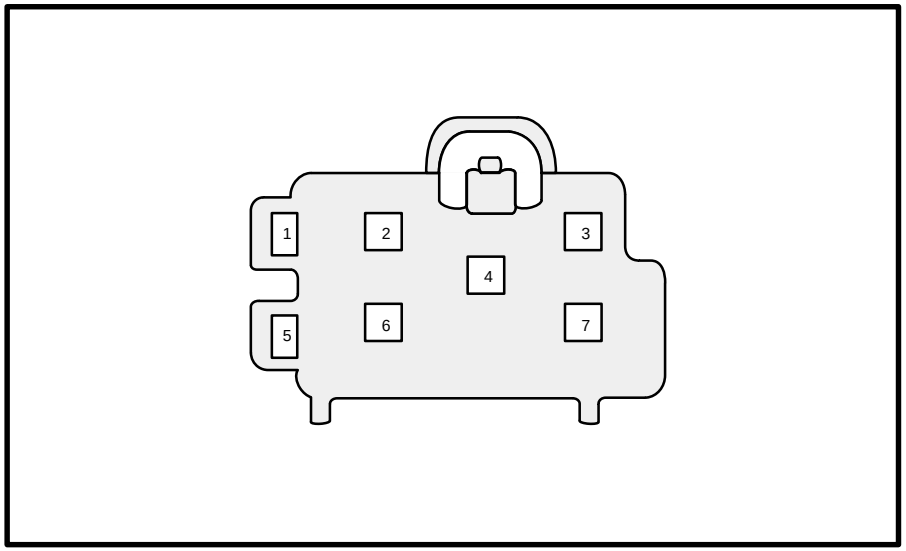

SCHEMATIC

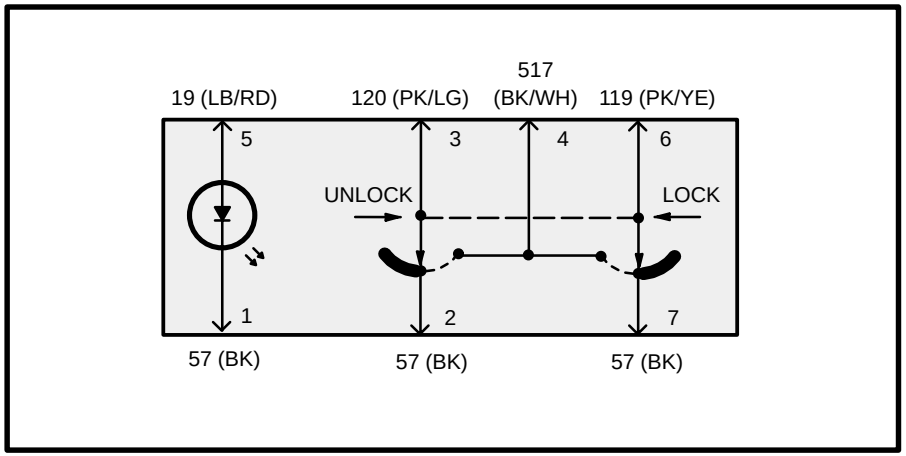

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Lock Switch Circuit	4 and 3	Unlock	Closed Circuit
	3 and 2	At Rest	Closed Circuit
Unlock Switch Circuit	4 and 6	Lock	Closed Circuit
	6 and 7	At Rest	Closed Circuit