COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	590 and 993	With Wiper Switch OFF: Push washer switch in Release washer switch	Open Circuit Closed Circuit 103.3K ohm
Wiper Switch Circuit	589 and 993	OFF INT LOW HIGH	47.6K ohm ± 5% 11.33K ohm ± 5% 4.08K ohm ± 5% Closed Circuit
Interval Time Adjust	590 and 993	INT and OFF LOW and HIGH	Rotate Control toward OFF: Ohmmeter will show smoothly increasing resistance from 3.3K ohm min. to 103.3K ohm max. ± 10% 3.3K ohm ± 10%

SCHEMATIC

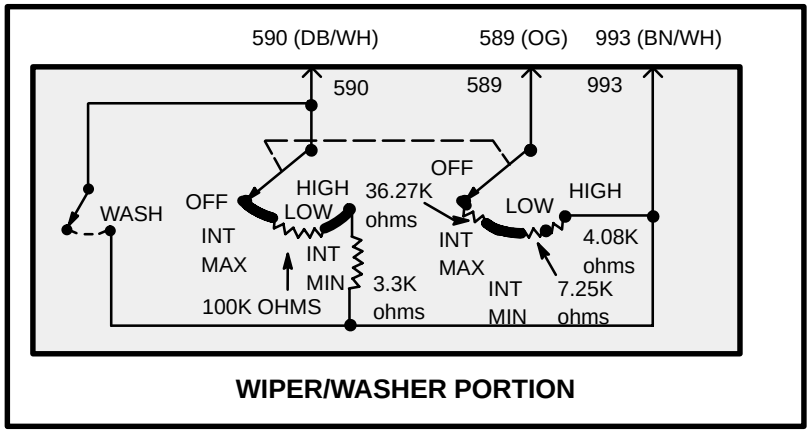

WIPER/WASHER PORTION

TERMINALS

C250

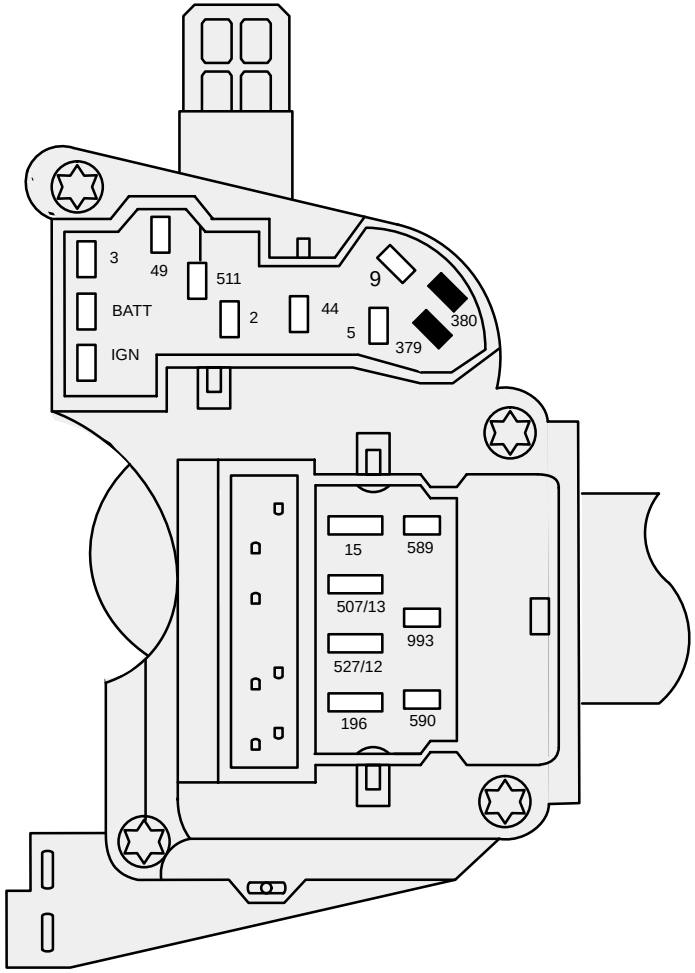

C251