Schematic

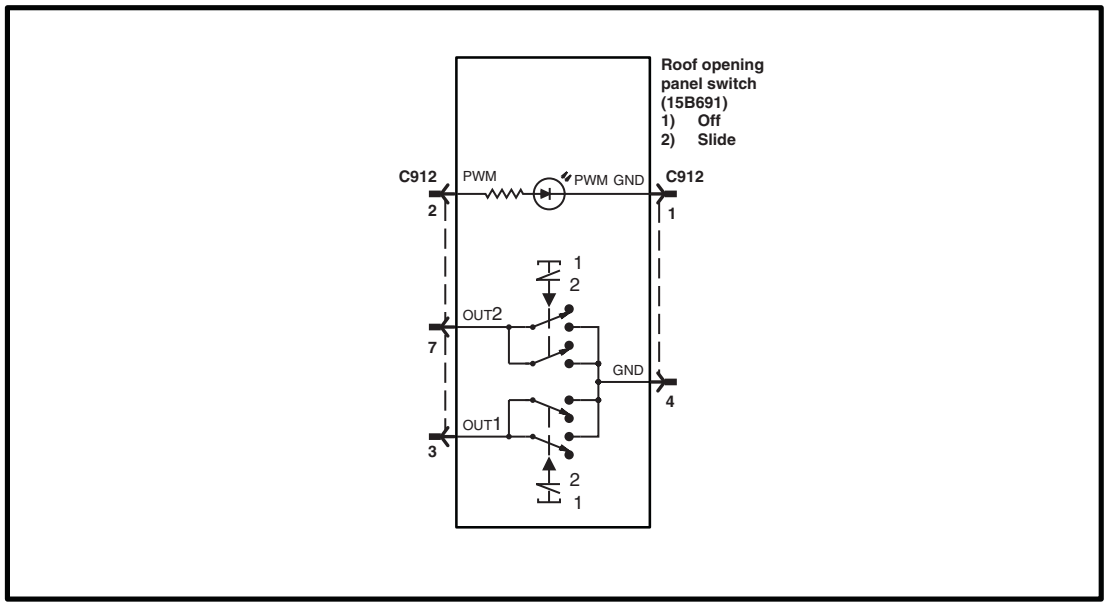

Terminals

C912

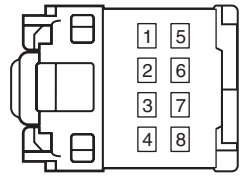

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Tilt	5 and 3	Tilt Up	Closed circuit
	2 and 3	Tilt Down	Closed circuit
Slide	2 and 3	Open	Closed circuit
	5 and 3	Close	Closed circuit