## W/O CENTRAL SECURITY MODULE

### TERMINALS

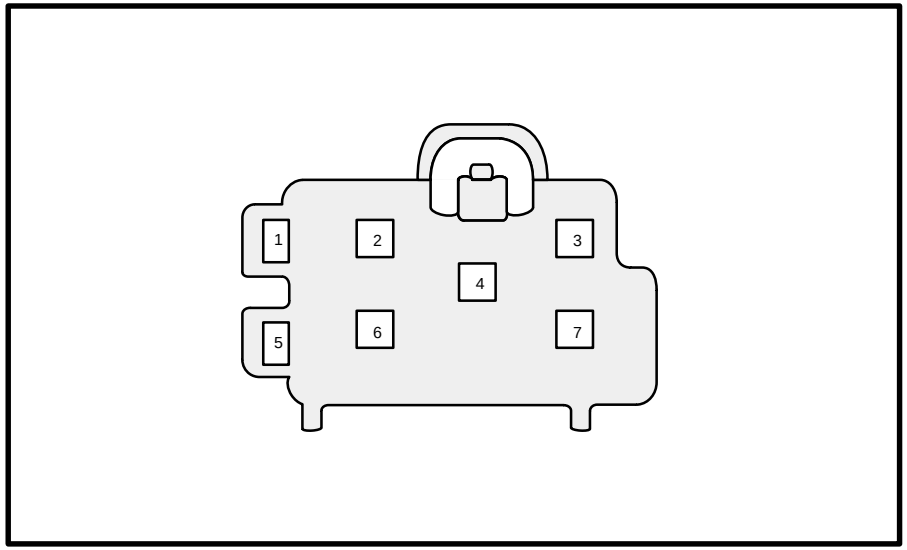


### SCHEMATIC

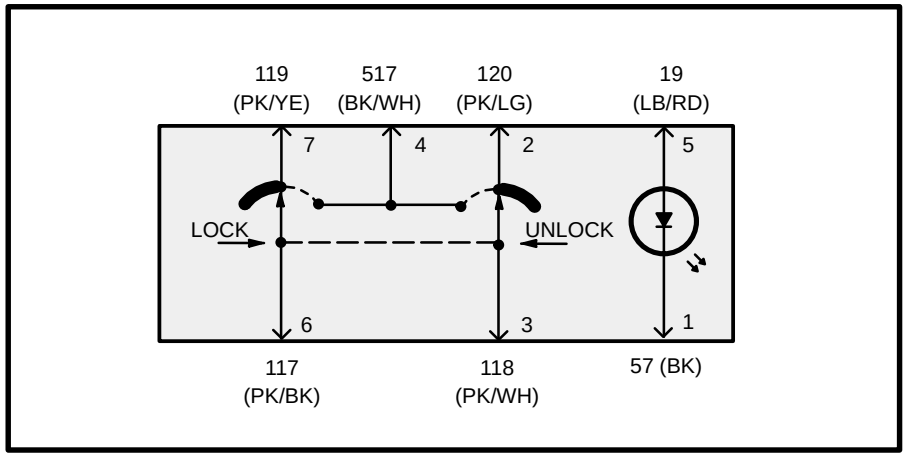


### COMPONENT TESTING PROCEDURE

| TO TEST | Connect Self-Powered Test Light or Ohmmeter to Terminals | Move Switch to These Positions | A Good Switch Will Indicate |
|---|---|---|---|
| **Lock Switch Circuit** | 4 and 3 | Unlock | Closed Circuit |
| | 2 and 3 | At Rest | Closed Circuit |
| **Unlock Switch Circuit** | 4 and 6 | Lock | Closed Circuit |
| | 7 and 6 | At Rest | Closed Circuit |