C141 (BU)

7C078/7E443

B87
Heated Oxygen
Sensor (HO2S) #22

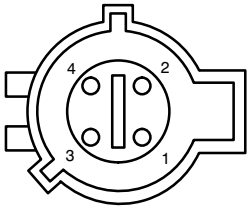

F04082

Pin	Circuit	Circuit Function
1	15S-RJ26 (GN/BK)	Voltage, ignition switch in Start or Run (not overload protected), Switched
2	91S-RJ26 (BN/GN)	Ground, Switched
3	9-RJ26 (BN/GN)	Sensor signal return (reference/ ground)
4	8-RJ26 (WH/GN)	Sensor signal

C142 (BU)

7C078/7E443

B88
Heated Oxygen
Sensor (HO2S) #12

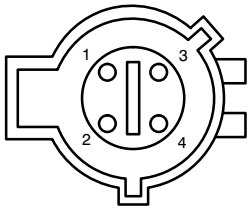

F04082

Pin	Circuit	Circuit Function
1	15S-RJ25 (GN/RD)	Voltage, ignition switch in Start or Run (not overload protected), Switched
2	91S-RJ25 (BN/BU)	Ground, Switched
3	9-RJ25 (BN/BU)	Sensor signal return (reference/ ground)
4	8-RJ25 (WH/BU)	Sensor signal

C143

7C078

B44
Turbine shaft speed
(TSS) sensor

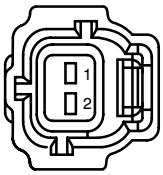

F02066

Pin	Circuit	Circuit Function
1	8-TA27 (WH/VT)	Sensor signal
2	9-TA27 (BN/WH)	Sensor signal return (reference/ ground)