Component Testing – Multifunction Switch, Telescoping Steering Column Control Section

SCHEMATIC

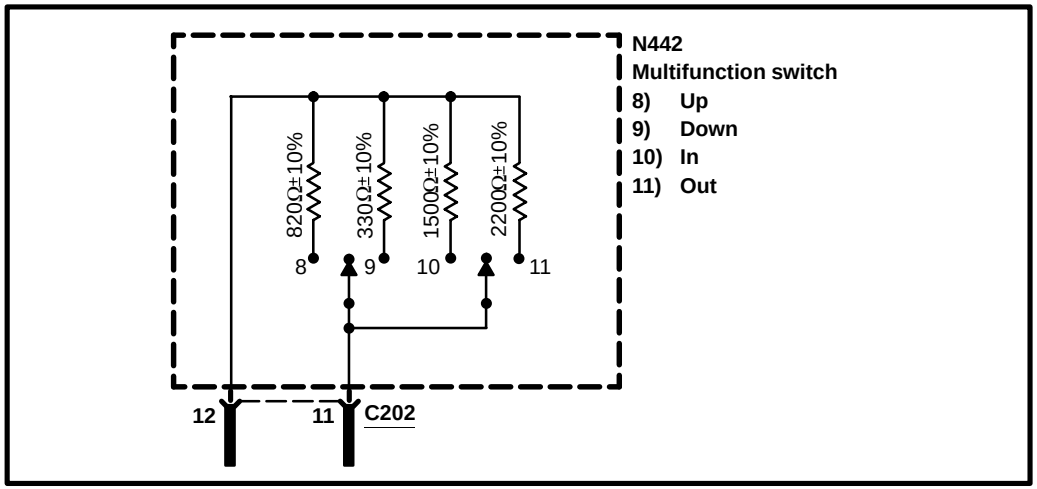

TERMINAL LOCATIONS

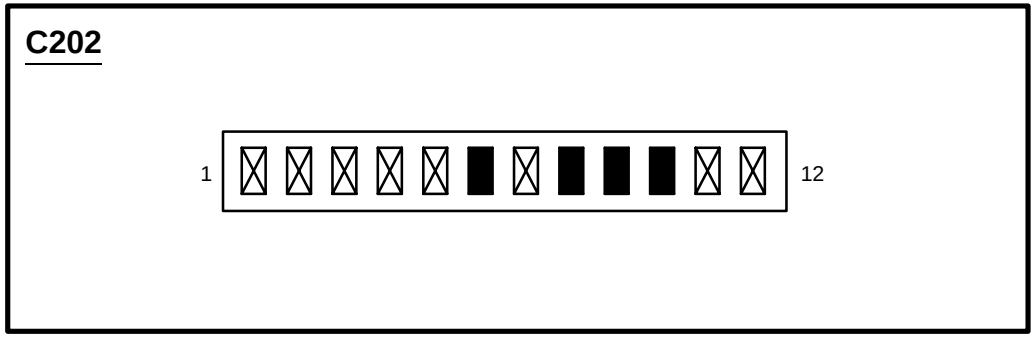

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Up/Down Circuit	11 and 12	Up	820Ω
		Down	330Ω
In/Out Circuit	11 and 12	In	1500Ω
		Out	2200Ω