COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Window Up Circuit	3 and 1	Up	Closed Circuit
	5 and 2	Up	Closed Circuit
Window Down Circuit	3 and 5	Down	Closed Circuit
	1 and 4	Down	Closed Circuit
Master Window Control Circuit	4 and 1	At rest	Closed Circuit
	2 and 5	At rest	Closed Circuit

TERMINALS

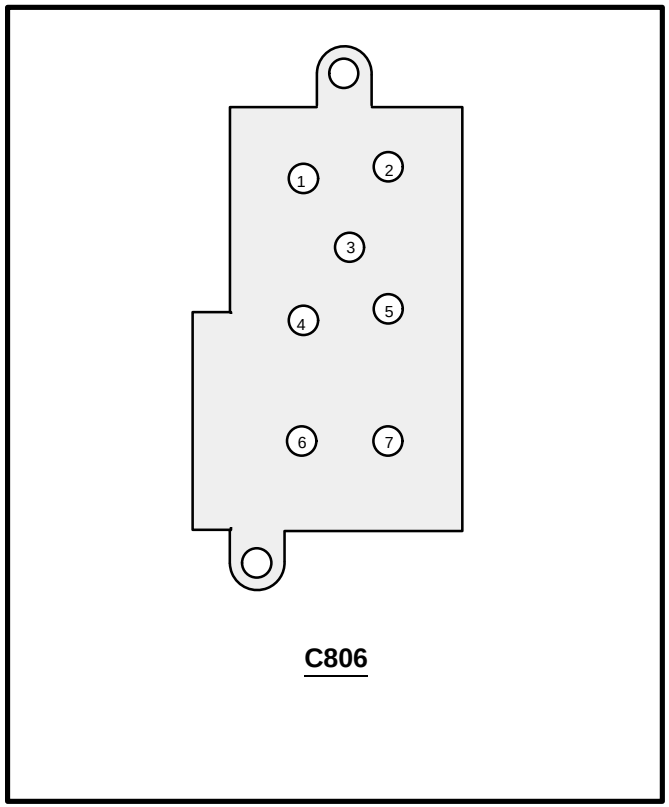
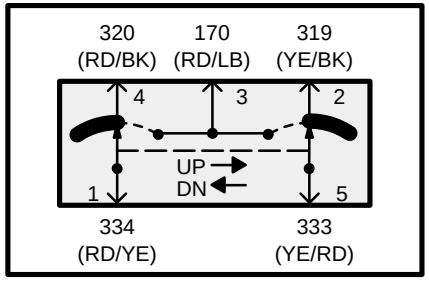
SCHEMATIC