Illumination dimmer

Schematic

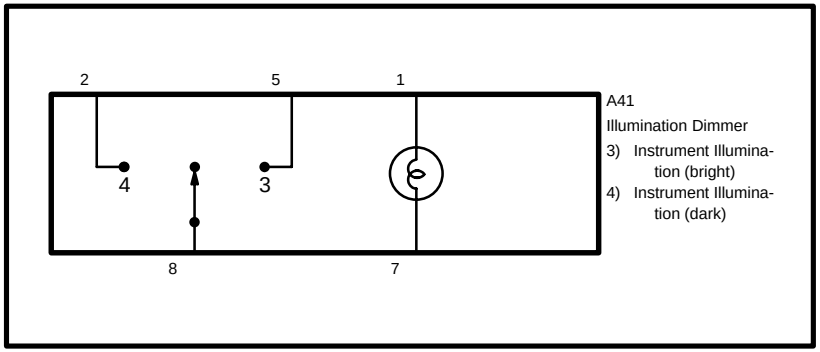

Terminal locations

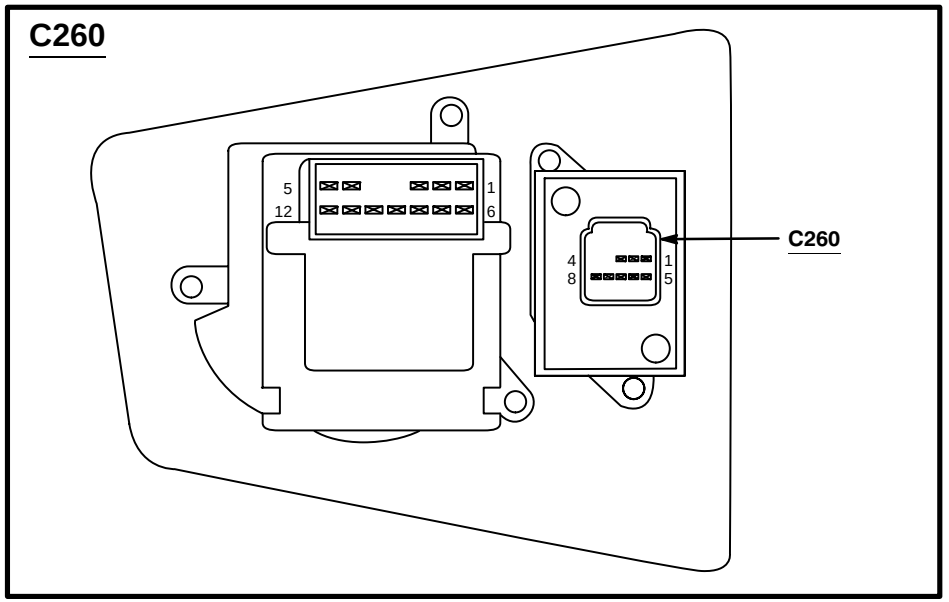

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Illumination	2 and 8	dark	Closed circuit
Reset	5 and 8	bright	Closed circuit
Switch illumination	1 and 7	all positions	Continuity