Component Testing – Multifunction Switch, Wiper/Washer Portion

SCHEMATIC

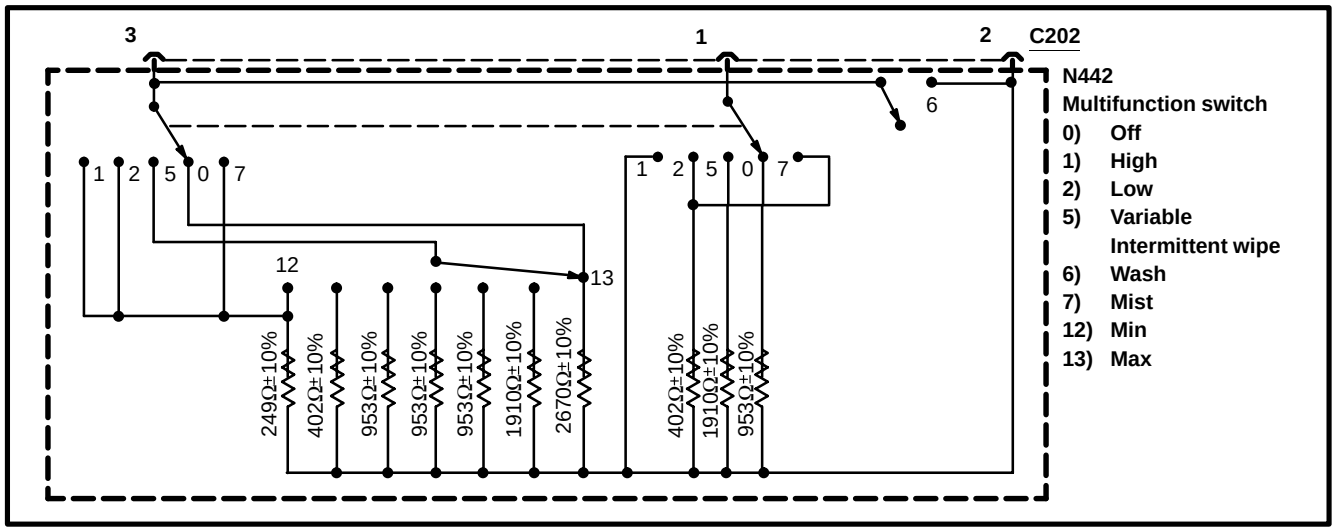

TERMINAL LOCATIONS

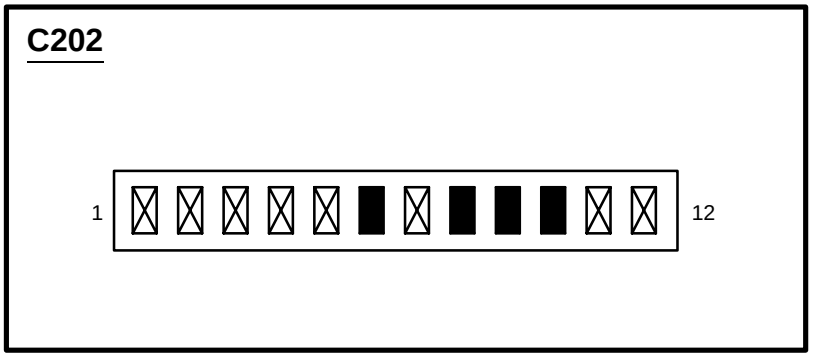

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	2 and 3	Wiper Switch Off, Washer Switch Depressed	Closed Circuit
		Wiper Switch Off, Washer Switch Normal	2670Ω
Wiper Switch Circuit	1 and 2	Off	953Ω
	2 and 3		2670Ω
	1 and 2	High	Closed Circuit
	2 and 3		249Ω
	1 and 2	Low	402Ω
	2 and 3		249Ω
	1 and 2	Mist	402Ω
	2 and 3		249Ω
Intermittent Wiper Circuit	1 and 2	Minimum to Maximum	1910Ω
	2 and 3		249Ω–2670Ω