149-15 COMPONENT TESTING: MINI ISO RELAY

COMPONENT TESTING PROCEDURE

Connect Battery Positive and Negative to Terminals:	Check Continuity From Terminals:	Continuity Will Be:
85 and 86	30 to 87 and 30 to 87A	From 30 to 87 only
–	85 to all others	To 86 only
–	30 to all others	To 87A only

TERMINALS

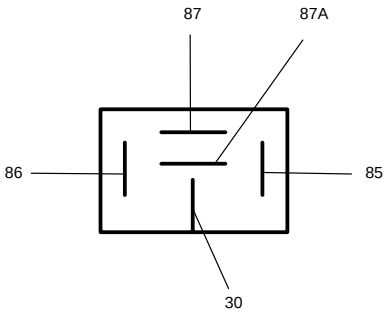

SCHEMATIC

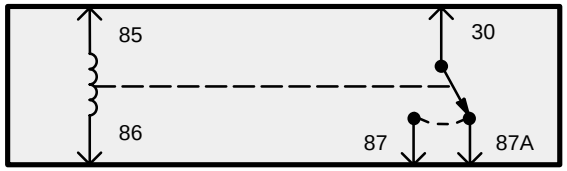

RELAY
CONTACTS CHANGE POSITION WITH CURRENT THROUGH COIL