C141

12A522

B87
Heated Oxygen
Sensor (HO2S) #22

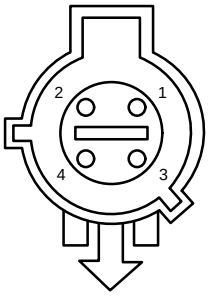

F04251

Pin	Circuit	Circuit Function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22, heater
3	89 (OG)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22, input

C142

12A522

B88
Heated Oxygen
Sensor (HO2S) #12

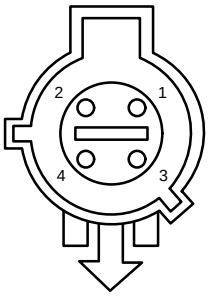

F04251

Pin	Circuit	Circuit Function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12, heater
3	89 (OG)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12, input

C143

12A522

B44
Turbine shaft speed
(TSS) sensor

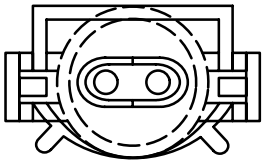

F02031

Pin	Circuit	Circuit Function
1	1202 (BN/LG)	Ground
2	20 (WH/LB)	Turbine shaft speed (TSS) sensor

C150

14290

B15
Wheel speed sen-
sor, left front

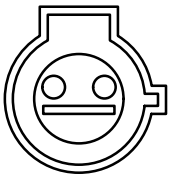

F02299

Pin	Circuit	Circuit Function
1	522 (TN/BK)	Wheel speed sensor, left front -
2	521 (TN/OG)	Wheel speed sensor, left front +

C152

14290

E43
Fog lamp, left front

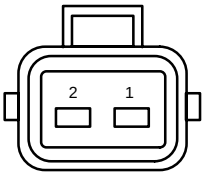

F02301

Pin	Circuit	Circuit Function
1	478 (TN/OG)	Fog lamp switch, to front fog lamp
2	57 (BK)	Ground

C140

19B573

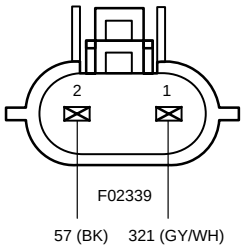

F02339

57 (BK) 321 (GY/WH)

14290

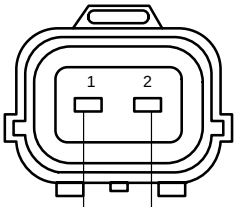

F02325

57 (BK)

321 (GY/WH)