COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	2, C509 and 1, C509	All Eight Window Switches (all positions)	Open Circuit
	C509 – 1,6,7,4,3 C510 – 7,6,5 and C510, 4	All Eight Window Switches (at rest)	Closed Circuit
Left Front Window Circuit	2, C509 and 6, C509	Down	Closed Circuit
	2, C509 and 7, C509	Up	Closed Circuit
Right Front Window Circuit	2, C509 and 3, C510	Up	Closed Circuit
	2, C509 and 4, C510	Down	Closed Circuit
Left Rear Window Circuit	2, C509 and 7, C510	Up	Closed Circuit
	2, C509 and 6, C510	Down	Closed Circuit
Right Rear Window Circuit	2, C509 and 5, C510	Up	Closed Circuit
	2, C509 and 4, C510	Down	Closed Circuit
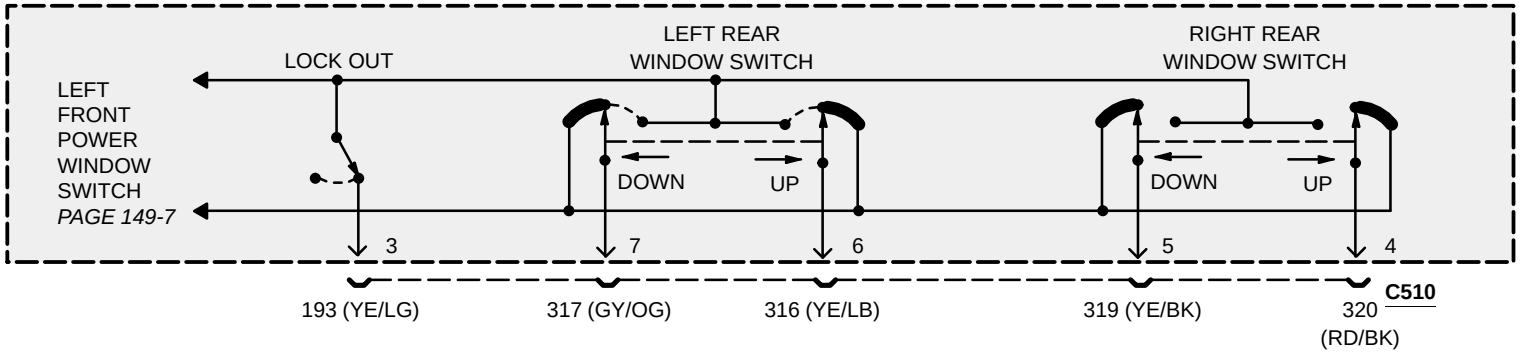
SCHEMATIC