Window adjust switches

Schematic

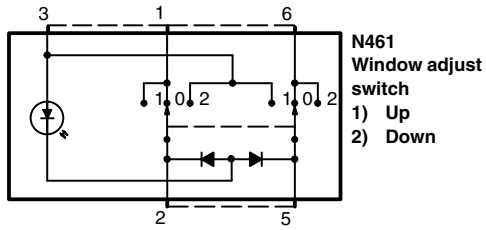

N461
Window adjust switch
1) Up
2) Down

Terminals

C604
C701
C801

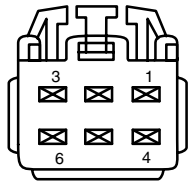

F06239

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Window adjust switches	3 and 5	Up	Closed circuit
	3 and 2	Down	Open circuit
	1 and 2	Rest	Closed circuit
	6 and 5		