COMPONENT TESTING: MULTIFUNCTION SWITCH 149-4

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	6 and 4	With Wiper Switch OFF: Push washer switch in; Release washer switch	Closed Circuit 103.3K ohm + 10%
Wiper Switch Circuit	1 and 4	OFF INT LOW HIGH	47.6K ohm + 15% 11.33K ohm + 15% 4.08K ohm + 15% Closed Circuit
Interval Time Adjust	6 and 4	INT and OFF LOW and HIGH	Rotate Control toward OFF; Ohmmeter will show smoothly increasing resistance from 3.3K ohm min. to 103.3K ohm max. + 10% 3.3K ohm + 10%

SCHEMATIC - WIPER/WASHER PORTION

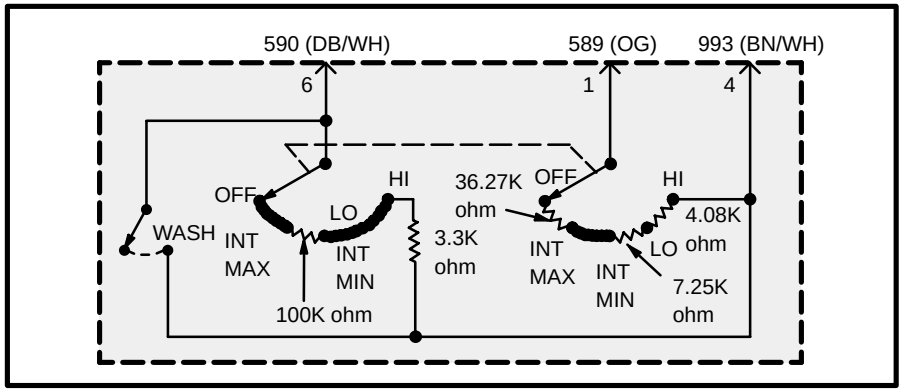
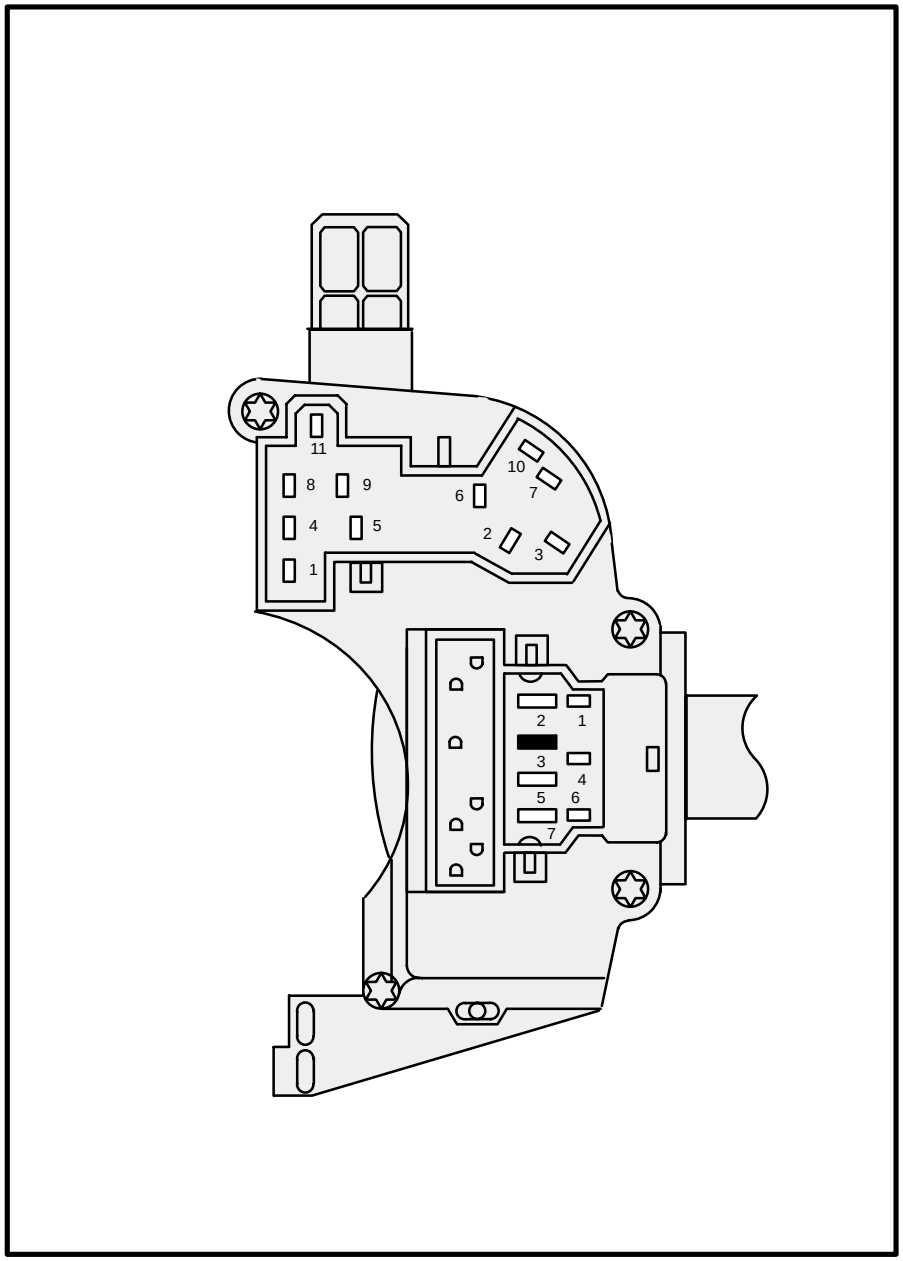
TERMINALS