WITH RKE

TERMINALS

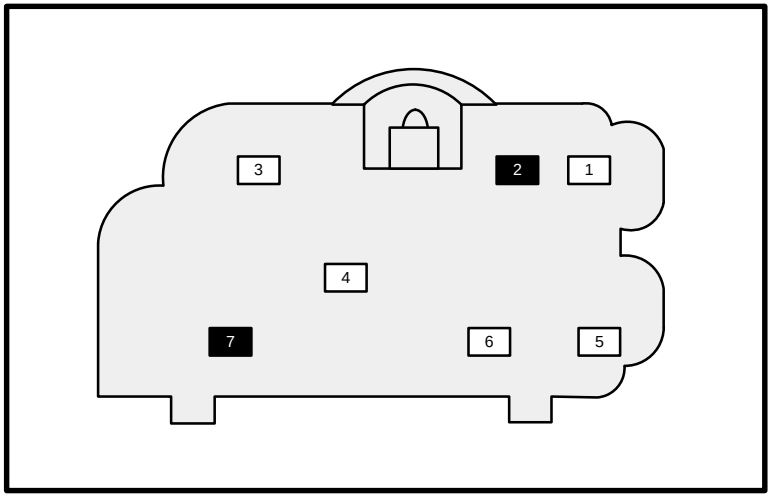

SCHEMATIC

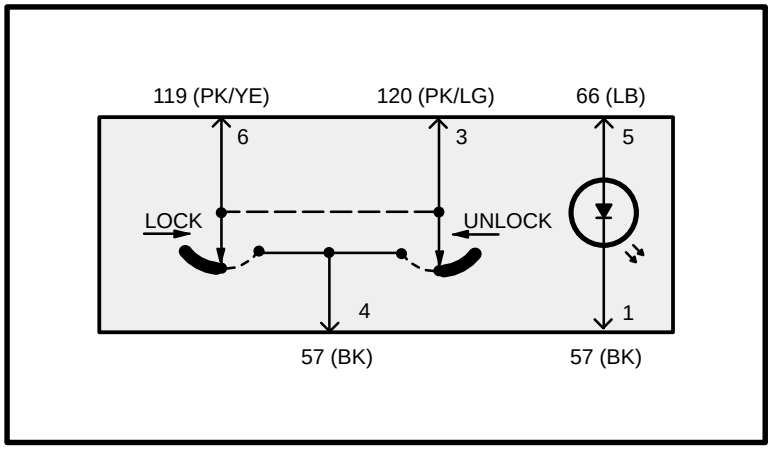

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Lock Switch Circuit	6 and 4	Lock	Closed Circuit
		At Rest	Open Circuit
Unlock Switch Circuit	3 and 4	Unlock	Closed Circuit
		At Rest	Open Circuit