COMPONENT TESTING: MULTIFUNCTION SWITCH 149-4

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	6 and 4	With Wiper Switch OFF: Push washer switch in Release washer switch	Closed Circuit 103.3K ohm (+ 10%)
Wiper Switch Circuit	1 and 4	OFF INT LOW HIGH	47.6K ohm (+ 5%) 11.33K ohm (+ 5%) 4.08K ohm (+ 5%) Closed Circuit
Interval Time Adjust	6 and 4	INT and OFF LOW and HIGH	Rotate Control toward OFF; Ohmmeter will show smoothly increasing resistance from 3.3K ohm min. to 103.3K ohm max. (+ 10%) 3.3K ohm (+ 10%)

SCHEMATIC – WIPER/WASHER PORTION

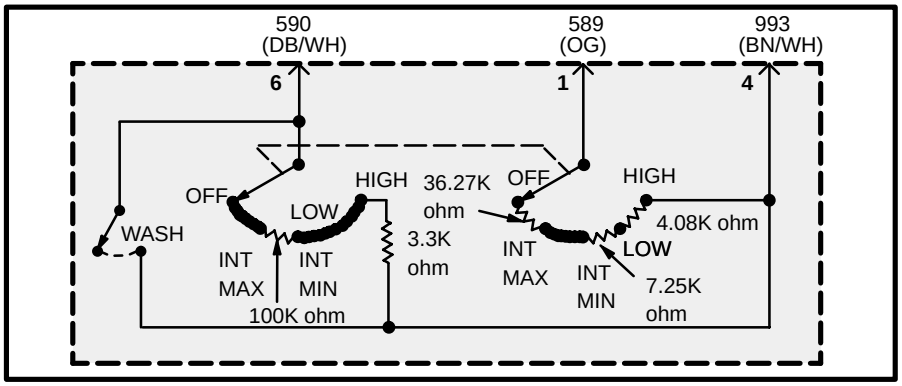
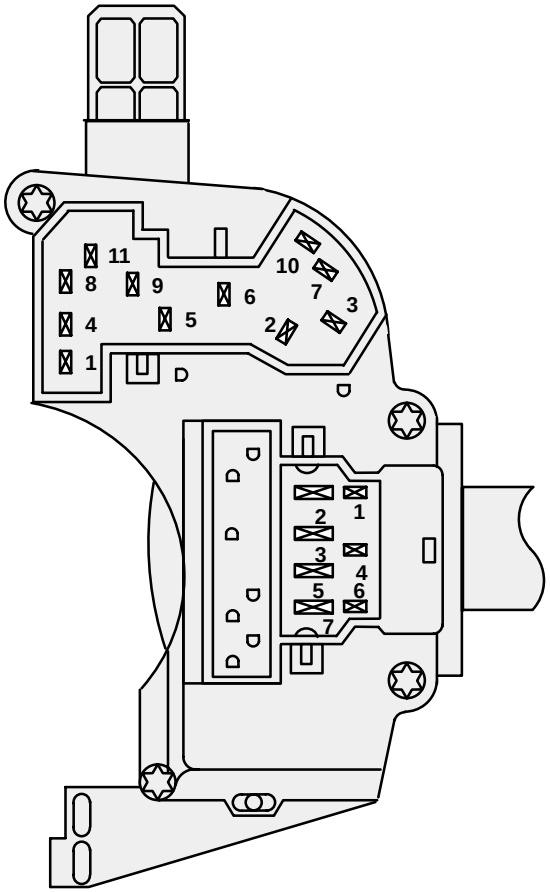
TERMINALS