COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Window Up Circuit	10 and 8	Up	Closed Circuit
	11 and 12	Up	Closed Circuit
Window Down Circuit	4 and 12	Down	Closed Circuit
	9 and 8	Down	Closed Circuit
Master Window Control Circuit	9 and 8	At rest	Closed Circuit
	11 and 12	At rest	Closed Circuit

SCHEMATIC

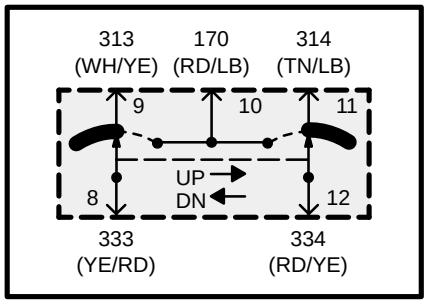
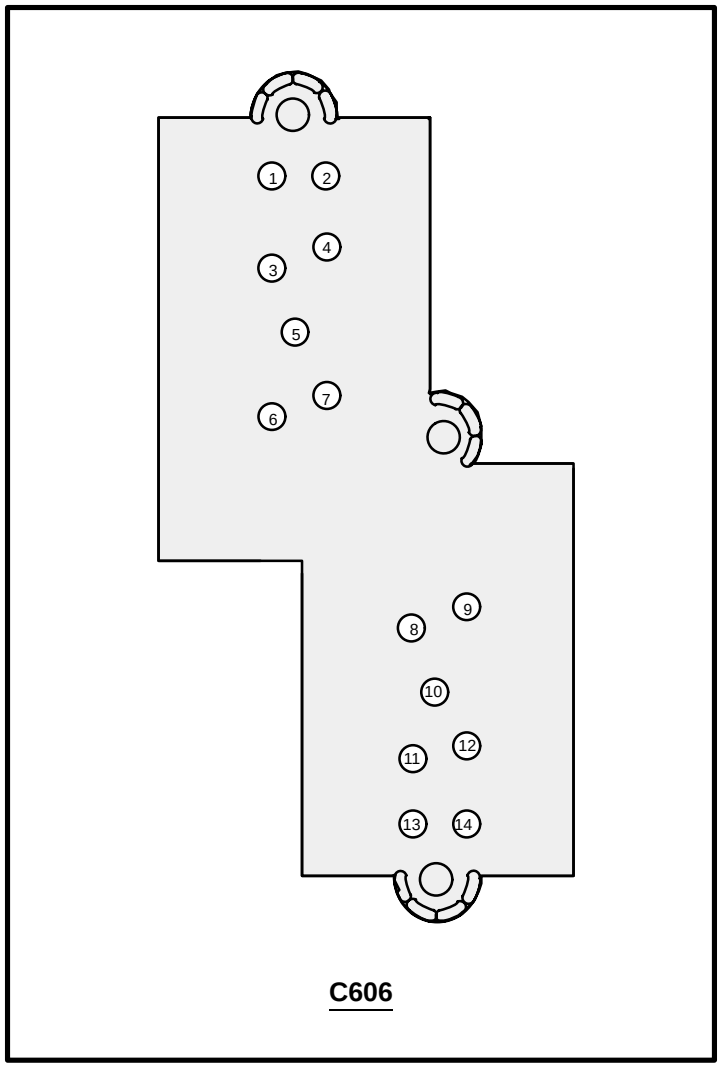
TERMINALS