COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	8 (C501) and 6 (C501) 2 (C501) and 6 (C501)	All Switches (all positions)	Open Circuit
	6 (C501) and 1, 3, 5, 7 (C501) 6 (C501) and 1, 3, 4, 6 (C502)	All Switches (at rest)	Closed Circuit
Left Front Window Circuit	8 (C501) and 7 (C501)	Up	Closed Circuit
	8 (C501) and 3 (C501)	Down	Closed Circuit
Right Front Window Circuit	2 (C501) and 1 (C501)	Up	Closed Circuit
	2 (C501) and 5 (C501)	Down	Closed Circuit
Left Flip Window Circuit	8 (C501) and 1 (C502)	Up	Closed Circuit
	8 (C501) and 4 (C502)	Down	Closed Circuit
Right Flip Window Circuit	8 (C501) and 6 (C502)	Up	Closed Circuit
	8 (C501) and 3 (C502)	Down	Closed Circuit

TERMINALS

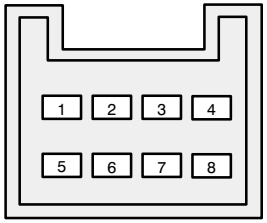

C501

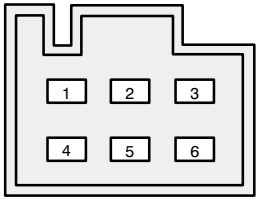

C502