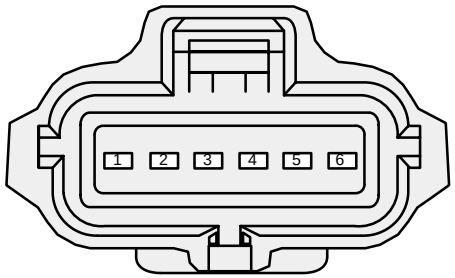

C111

MASS AIR FLOW (MAF) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	359 (GY/RD)	Signal Return
2	361 (RD)	Power (Hot in Start or Run)
3	969 (BK)	MAF Ground
4	968 (TN/LB)	MAF Return
5	967 (LB/RD)	PCM to MAF Sensor
6	743 (GY)	PCM to IAC Sensor

CONNECTOR REFERENCE LIST

CONNECTOR	SECTION-PAGE
C109	29-6
C112	29-5
C177	29-5
C207	34-3
C286	62-6
C287	62-6
C288	62-7
C291	14-3