COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Headlamp Circuit	6 and 4	OFF Park Head	Open Circuit Open Circuit Closed Circuit
Low Beams	5 and 6 or 3 and 4	FLASH LOW HIGH	Open Circuit Closed Circuit Open Circuit
High Beams	6 and 2 and/or 4 and 1	FLASH LOW HIGH	Closed Circuit Open Circuit Closed Circuit
Flash to Pass	6 and 4	ON OFF	Closed Circuit Open Circuit
Flash to Pass	6 and 2 and/or 4 and 1	FLASH LOW HIGH	Closed Circuit Open Circuit Closed Circuit

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Turn Switch Circuit	3 and 1	Left Neutral Right	Closed Circuit Open Circuit Open Circuit
	3 and 2	Left Neutral Right	Open Circuit Open Circuit Closed Circuit
Hazard Switch	2 and 3	ON OFF	Closed Circuit Open Circuit
Fog Switch	1 and 4	ON OFF	Closed Circuit Open Circuit
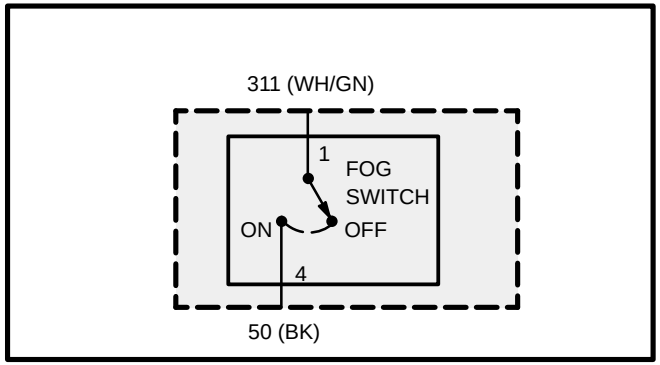
SCHEMATIC