Component Testing – Multifunction Switch, Lamp Portion

SCHEMATIC

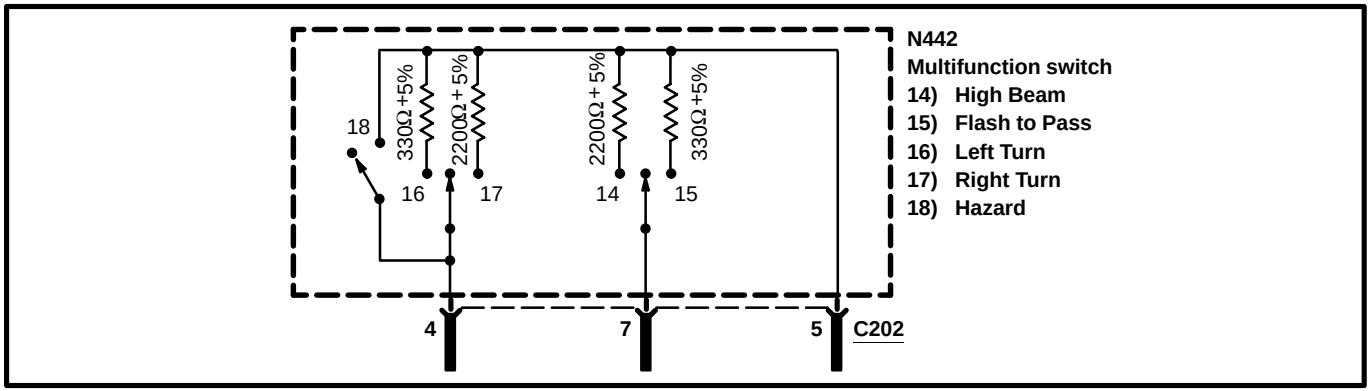

TERMINAL LOCATIONS

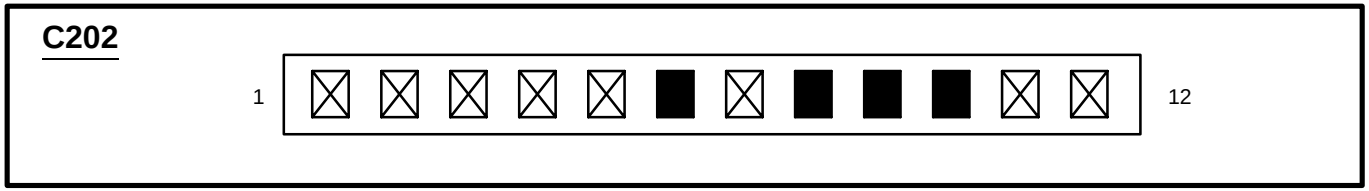

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
High Beam/Flash to Pass	5 and 7	High beam	2200Ω
		Neutral	Open Circuit
		Flash-to-pass	330Ω
Hazard	5 and 4	Turn Signal Switch In Neutral, Hazard On	Closed Circuit
		Turn Signal Switch In Neutral, Hazard Off	Open Circuit
Turn Signal	5 and 4	Left Turn	330Ω
		Neutral	Open Circuit
		Right Turn	2200Ω