Schematic

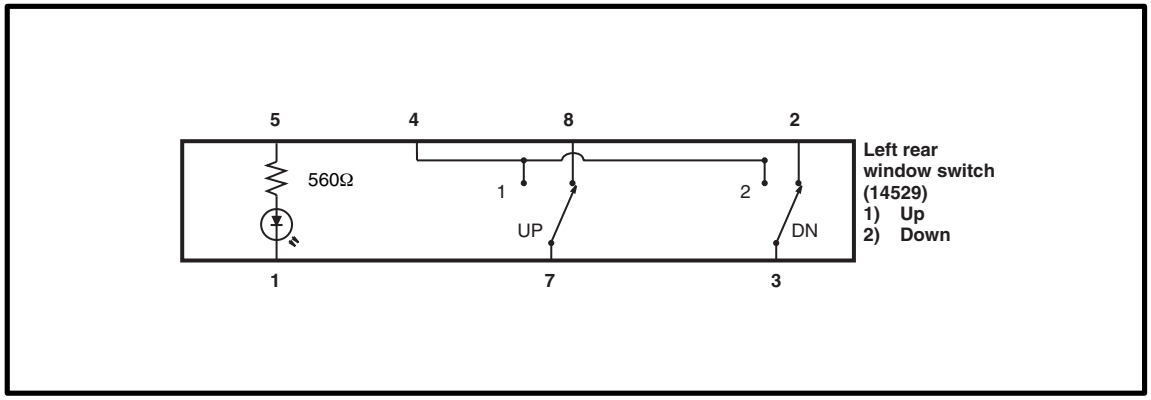

Terminals

C701
C801

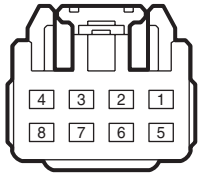

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Window adjust switches	4 and 7	Up	Closed circuit
	4 and 3	Down	Closed circuit
	7 and 8 2 and 3	Rest	Closed circuit