Schematic

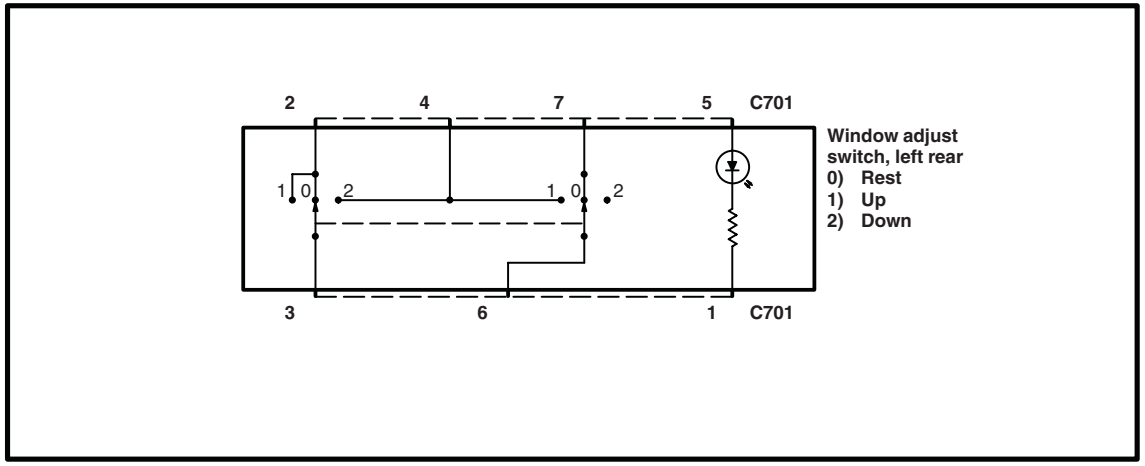

Terminals

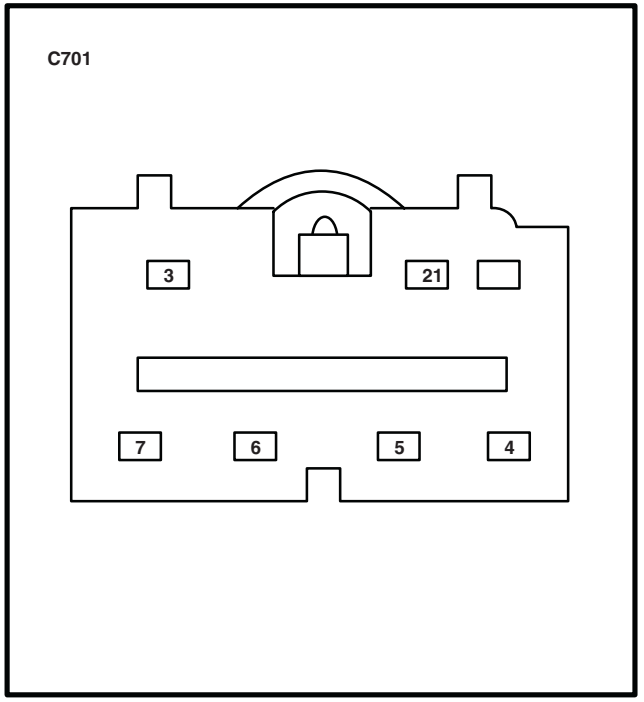

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Down Switch Circuit	4 and 3	Down	Closed circuit
	2 and 3	at rest, Up	Closed circuit
Up Switch Circuit	4 and 6	Up	Closed circuit
	7 and 6	at rest, Down	Closed circuit