Ford Motor Company

Frank M. Ligon
Director
Vehicle Service and Programs
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121


November 1,2002

ADVANCE SAFETY RECALL COMMUNICATION

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Press Release on Upcoming Safety Recalls – Pinch Bolt Torque and Zetec Engine Battery Cable Routing
02S41 - Certain 2000 Model Year Focus Vehicles
02S42 - Certain Other 2000 and certain 2001 Model Year Focus Vehicles

Please Note: The involved vehicles have been divided into two programs so dealers will not need to determine the build date before repairing. Some 2000 model year vehicles are in Safety Recall 02S41, while others are in Safety Recall 02S42. **Consult OASIS to be sure you are administering the correct Safety Recall.**

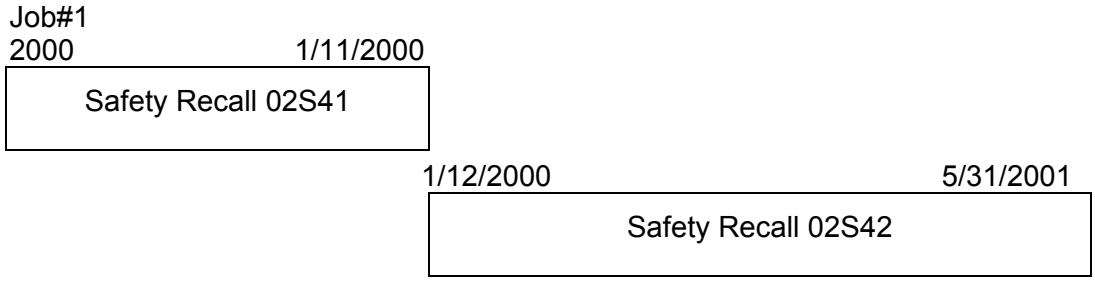

02S41 – Pinch Bolt Torque (Hermosillo and Wayne Assembly Plants) and Zetec Engine Battery Cable Routing (Hermosillo and Wayne Assembly Plants)

AFFECTED VEHICLES

Certain 2000 model year Focus vehicles from Job #1 2000 through January 11, 2000.

02S42 – Pinch Bolt Torque (Only Wayne Assembly Plant) and Zetec Engine Battery Cable Routing (Hermosillo and Wayne Assembly Plants)

AFFECTED VEHICLES

Certain 2000 and 2001 model year Focus vehicles from January 12, 2000 through May 31, 2001.

© Copyright 2002 Ford Motor Company

SAFETY CONCERNS

In some of the affected vehicles equipped with the Zetec engine, the battery cables may be misrouted, improperly secured, or inadequately insulated. If any of these conditions were to exist, overheating or corrosion could occur in the cable. These conditions may cause illumination of the check engine light or battery light, hard start or no start, or dead battery. In extreme cases a short circuit may occur, causing the cable to overheat, and possibly lead to fire.

In addition, on all of the affected vehicles, the pinch bolt that retains the steering knuckle to the lower ball joint may not have the proper torque. If this condition exists, the customer may experience vibration, noise, or joint separation.

SERVICE ACTION

WHEN THE PARTS AND TECHNICAL INSTRUCTIONS BECOME AVAILABLE:

Dealers will inspect the routing of the battery positive cable, verify proper terminal torque, inspect, and if necessary, modify the insulation on the affected vehicles to eliminate the potential for any of the conditions stated above (**Zetec engines only**).

In addition, dealers will torque the pinch bolts on all the affected vehicles.

PLEASE NOTE: PARTS AND TECHNICAL INSTRUCTIONS ARE NOT AVAILABLE AT THIS TIME TO REPAIR THE CONDITION STATED ABOVE.

You will be notified in a follow-up standard communication as soon as possible.

CUSTOMER NOTIFICATION

Owners of record will be notified after the standard dealer bulletins have been issued.

OASIS / CUSTOMER NOTIFICATION

OASIS will not be activated at this time. Dealer involved unit listings will be provided when the final bulletin is issued.

(DEALER ONLY) RECALL QUESTIONS:

Call 1-800-325-5621

Sincerely,

Frank M. Ligon

Frank M. Ligon

© Copyright 2002 Ford Motor Company