Mr. Joe Cool
123 Main Street
Anywhere USA 12345

October 2001

Your Vehicle: 2000 SVT F-150 Lightning
Your Vehicle Identification Number: 12345678901234567
Program: 01B81

Retain Your Power With A New Supercharger Intercooler.

As the owner of an SVT F-150 Lightning, you know the feeling that comes with driving a vehicle that is part truck, part hot rod and all thrill.

To ensure you get the most out of your Lightning, Ford Motor Company wants to make sure that your engine maintains peak performance. Recently, it has come to our attention that the supercharger intercooler in your SVT F-150 Lightning may develop an internal coolant leak. If this condition occurs in your vehicle, you may experience reduced engine performance at full throttle.

What Ford Will Do For You.

Ford Motor Company will install a brand-new supercharger intercooler in your vehicle, at no cost to you. The new intercooler is an improved design that was introduced on the 2001 model year Lightning. For further details on intercooler installation, please refer to the diagram and frequently asked questions on the other side of this letter. **This program will be in effect until September 30, 2002, regardless of mileage.**

Your new intercooler will work to keep your Lightning's intake air cool. And we hope that you will enjoy the enclosed SVT F-150 Lightning cool cup holder to keep your drink cool, too.

What We Are Asking You To Do.

Please contact a Ford representative without delay to schedule an appointment to have your new supercharger intercooler installed. Call toll-free at (800) 248-0186 and inform the Ford representative that you wish to have your vehicle serviced under Customer Satisfaction Program 01B81. Representatives are available 7:30 a.m. to 7:30 p.m. Monday through Friday and 8:00 a.m. to 3:00 p.m. on Saturday (Eastern Standard Time).

Please have this letter with you when you call. The Ford representative will ask for your Vehicle Identification Number (located at the top of this letter).

Arrangements will be made with the dealership of your choice to have parts available, and the dealership will call you to schedule an appointment. If you have not been contacted within two business days, call your dealership to request a service appointment. You need do nothing else except bring your vehicle to the dealership on the service date.

If You Have Already Paid To Have This Service Performed ...

If you have paid to have your supercharger intercooler replaced before the date of this letter, Ford Motor Company will provide a full refund. Just give your original paid receipt to your dealership. To avoid delays, do not send receipts to Ford Motor Company.

Any Questions?

Please contact us at **www.ownerconnection.com** if you have any questions about the information included in this letter.

You may also contact the Ford Motor Company Customer Relationship Center, toll-free, at (866) 436-7332 or (800) 232-5952 (TDD for persons with hearing impairments). One of our representatives will be happy to assist you. Office hours are 8:00 a.m. to 11:00 p.m. Monday through Friday, and 8:00 a.m. to 6:00 p.m. Saturday (EST).

If you have technical questions regarding your SVT F-150 Lightning, please contact the SVT Information Center at (800) 367-3788, Monday through Friday, from 8:30 a.m. to 6:00 p.m. (EST).

Quality Care Is There For You Through Rain Or Shine.

Ford Motor Company is committed to providing you with superior service throughout your entire ownership experience. We regret any inconvenience caused by this program.

And don't forget that to help keep you informed, we have also included a diagram and frequently asked questions with this letter. Please turn the letter over for further information.


THE Park Concept, Design and Electronic Production

Ad No. N/A

Description:	Lightning Letter		
JWT Job No.:	FHB-GEN-313073	Art Director:	N. Kammeraad
Park Job No.:	FCAR-04035	Writer:	K. Jones
Park Producer:	jm,tb,db,jm	Designer:	N/A
live size -	N/A	Account:	D. Bloomquist. / T. Pollicelli
Trim -	5.5" x 17"	Production:	B. Hart
Bleed -	5.75" x 17.25"	Traffic:	J. Summers
Res@Full Size -	N/A	Art Admin:	N/A
Photographer:	N/A	Engraver:	N/A
Retoucher:	N/A	Filed:	FD / Job # / Lightning Letter
Park Project Mgr.:	A. Ayrault		

Proof 6 10/5/01
Galley 1

Output size - 100%

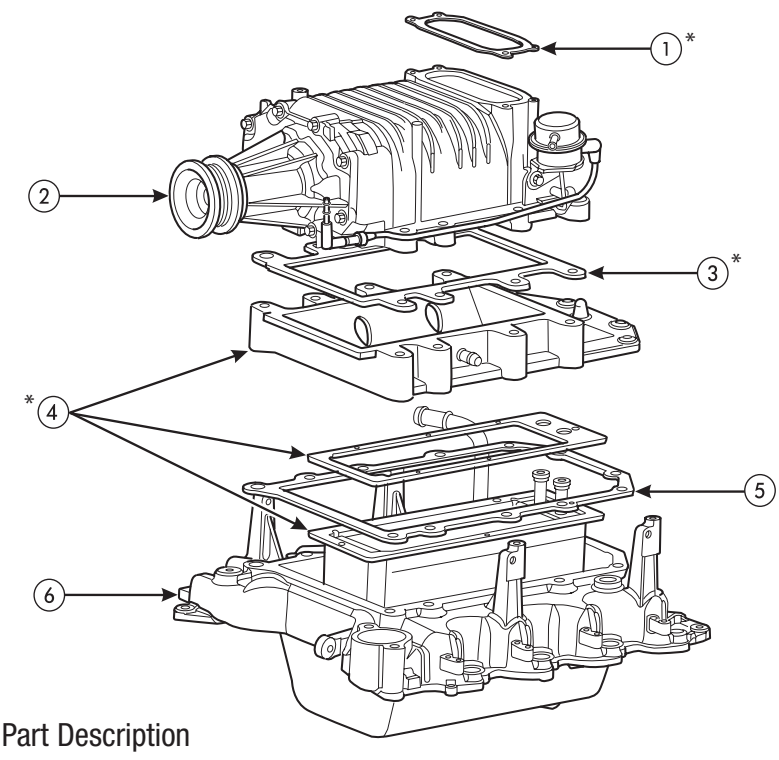

Part Description

1. Throttle Body Spacer Gasket
2. Supercharger
3. Upper Manifold to Supercharger Gasket
4. Upper Manifold and Intercooler Assembly
5. Upper Manifold to Lower Manifold Gasket
6. Lower Manifold

*Parts included in service kit.

Frequently asked questions:

Q. WHAT WILL BE SERVICED ON MY VEHICLE?

A. Dealers will replace a component of the supercharger's intercooler system. This component is known as the charge air cooler (CAC), commonly referred to as the intercooler. The intercooler will come pre-assembled with a new upper intake manifold and gasket as shown in the illustration above (item 4). All other necessary gaskets will be replaced.

Q. WHY DO THE INTERCOOLER AND UPPER INTAKE NEED TO BE REPLACED?

A. In some of the affected vehicles, the intercooler may fracture and create an internal coolant leak. If this occurs, the vehicle may experience loss of engine performance at full throttle. Because the intercooler is a new design (the same as the 2001 design), a new upper intake will be installed to adapt it to the current supercharger.

Q. WHAT IS CAUSING THIS CONDITION?

A. The root cause of this condition is excessive stress on the aluminum extruded intercooler tubes due to heat cycling and thermal expansion contraction. This causes the intercooler tubes to fatigue and develop a hairline fracture.

Q. HOW IS THE NEW INTERCOOLER BETTER THAN THE ONE IT REPLACES?

A. The service part has been redesigned to reduce stress in the critical area. It is the same part that was introduced on the 2001 SVT F-150 Lightning.

Q. HOW LONG WILL IT TAKE?

A. The time needed for this repair is less than one-half day. However, due to the number of variables that could extend service time on your vehicle, such as technician availability, it is a good idea to ask your service advisor for the approximate service time required on your vehicle.

THE Park Concept, Design and Electronic Production

Ad No. N/A

Description: Lightning Letter
JWT Job No.: FHB-GEN-313073
Park Job No.: FCAR-04035
Park Producer: jm,tb,db
live size - N/A
Trim - 5.5" x 17"
Bleed - 5.75" x 17.25"
Res@Full Size - N/A
Photographer: N/A
Retoucher: N/A

Art Director: N. Kammeraad
Writer: K. Jones
Designer: N/A
Account: D. Bloomquist. / T. Pollicelli
Production: B. Hart
Traffic: J. Summers
Art Admin: N/A
Engraver: N/A
Filed: FD / Job # / Lightning Letter

Park Project Mgr.: A. Ayrault

Proof 5 10/4/01
Galley 2

Output size - 100%