FRONT SUSPENSION MOUNTING BRACKET BOLTS

AFFECTED VEHICLES: **CERTAIN 2001 MODEL YEAR U.S. POSTAL STRIPPED CHASSIS**

OVERVIEW

The left and right hand front stabilizer bar mounting bracket bolts on the affected vehicles must be tightened to specification.

SERVICE PROCEDURE

NOTE: If any loose bolts are found, inspect the bolt threads, stabilizer bar bushings and mounting brackets for damage and replace if necessary.

1. Raise the vehicle on a hoist.
2. Tighten all four (4) front stabilizer bar mounting bracket bolts to 40 Nm (30 lb-ft). See Figure 1.
3. Lower the vehicle.

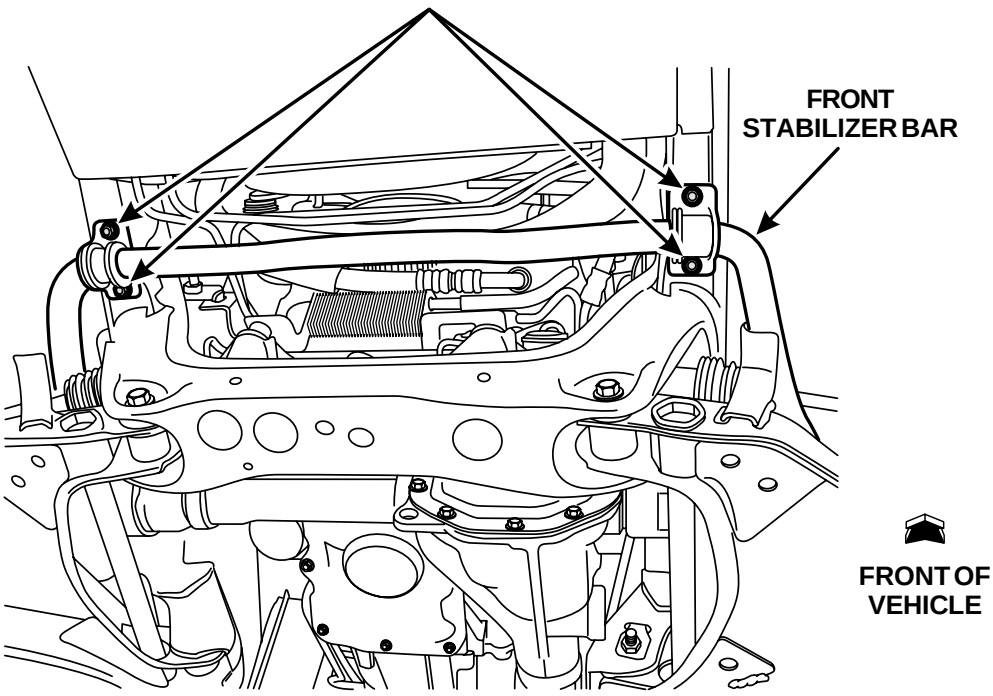

FIGURE 1

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
10/01