ELECTRICAL—HEADLAMP— MOISTURE/CONDENSATION IN LENS ASSEMBLY	Article No. 01-21-1

MERCURY: 2001-2002 COUGAR

This article is being republished in its entirety to update the Model Year coverage and to update the Service Information.

ISSUE

Some vehicles may exhibit condensation in the headlamps. Condensation is a natural occurring phenomenon in headlamps. This is due to the fact that headlamps have to be vented to alleviate pressure differentials on the inside and outside of the lamp.

ACTION

Under normal operating conditions with the headlamps on, this condensation will dissipate. Refer to the following Service Information for details.

SERVICE INFORMATION

Condensation in a headlamp can be eliminated under normal vehicle operating conditions and with the headlamps turned on for 10 minutes. The main globe region in the lamp (Figure 1) should be free of all condensate at the end of the ten minutes. If at the end of ten minutes, excessive condensate still remains in the globe region of the lamp, then the affected lamp assembly should be replaced.

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 00-23-6
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 201000, 201200

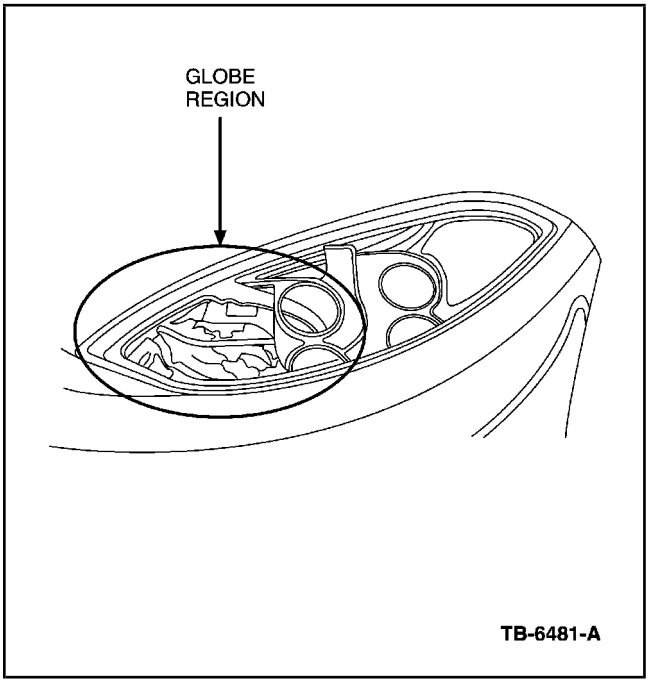


Figure 1 - Article 01-21-1

Copyright © 2001 Ford Motor Company