HOOD LATCH STRIKER REPLACEMENT

AFFECTED VEHICLES: **CERTAIN 2001 MODEL YEAR RANGER, EXPLORER SPORT AND SPORT TRAC VEHICLES**

SERVICE PROCEDURE

1. Remove the hood latch striker.
2. Install the ***new*** hood latch striker. Tighten the bolts to 12 Nm (9 lb-ft). See Figure 1.

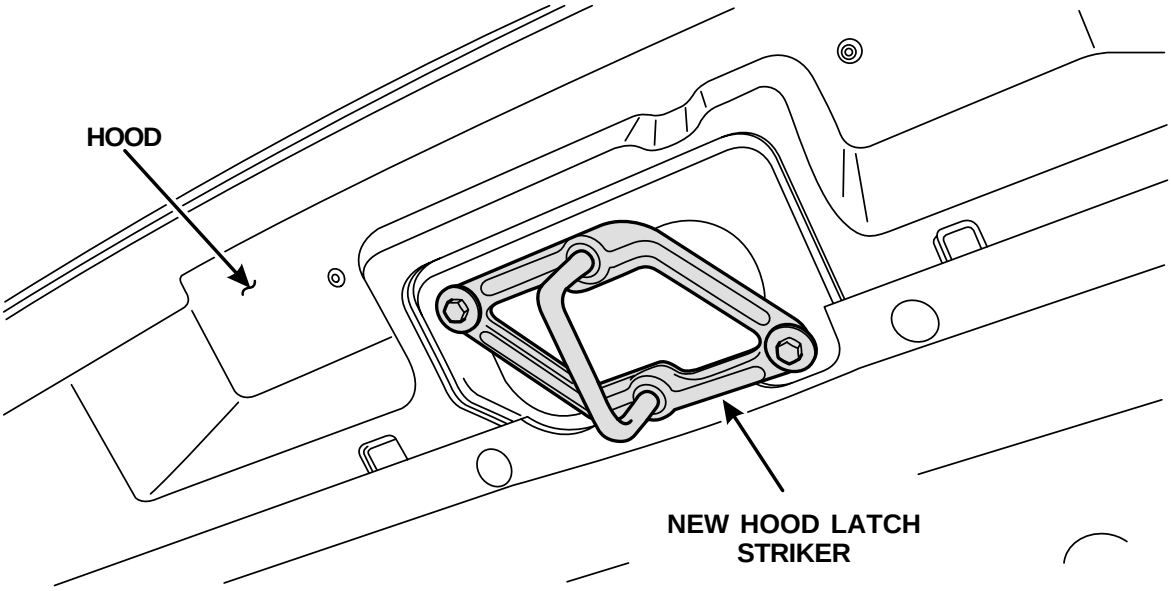

RANGER SHOWN, EXPLORER SPORT/SPORT TRAC SIMILAR **00S45A**

FIGURE 1

3. Close the hood and check hood alignment. Adjust hood latch striker as necessary.

Ford Motor Company

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
11/00