# POWERTRAIN CONTROL MODULE (PCM) REPROGRAM

**AFFECTED VEHICLES:** **CERTAIN 2001 MODEL YEAR TAURUS AND SABLE VEHICLES EQUIPPED WITH A 3.0L FLEXIBLE FUEL VEHICLE (FFV) ENGINE**

## SERVICE PROCEDURE

1. Reprogram the PCM to the latest calibration level. Use one (1) of the following two (2) methods:
   - Worldwide Diagnostic System (WDS), with software level B13.7 or later.
   - New Generation STAR (NGS) Tester with Rotunda Flash Cable (007-00531) and Rotunda Flash Card (007-00532). The calibration must be downloaded to a flash card using WDS with software level B13.7 or later.

## PREPARE AUTHORIZED MODIFICATIONS LABEL

1. Obtain and prepare the Authorized Modifications Label. Write the modification completed, your P&A Code, date of repair and the recall program type and program number. See Figure 1.

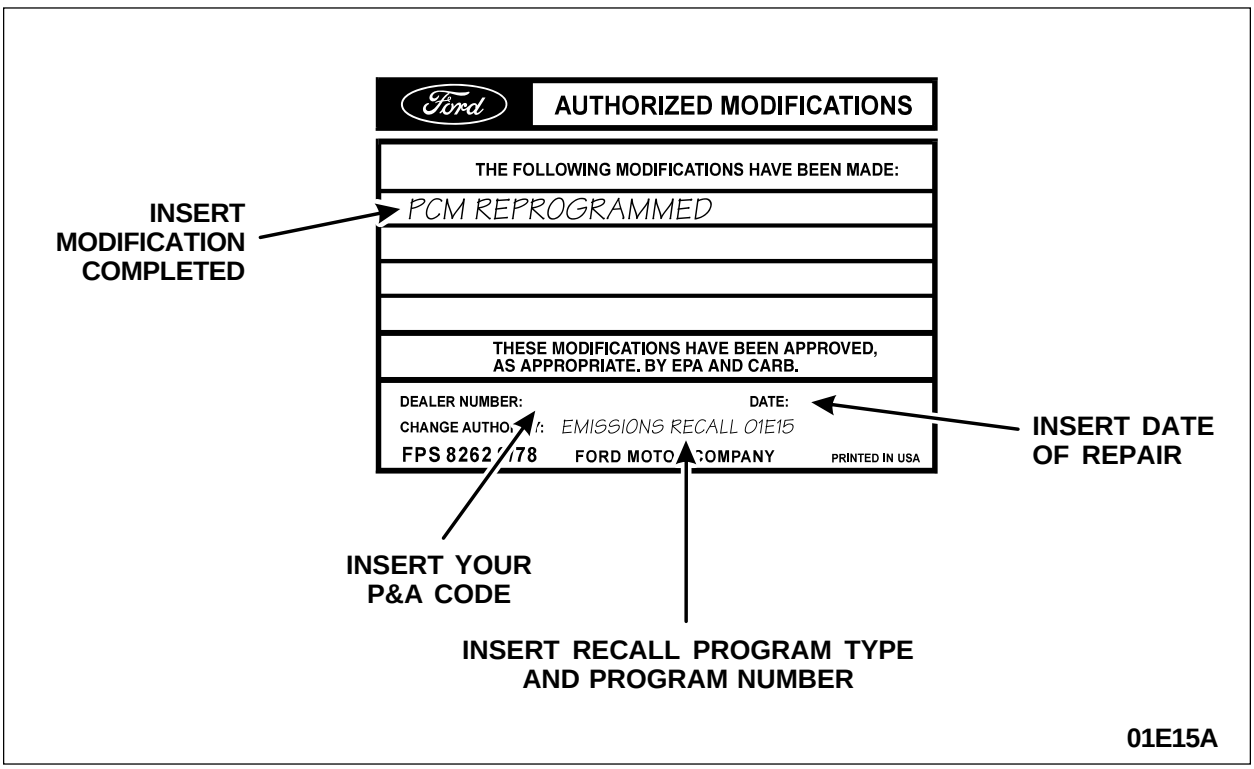



**FIGURE 1**

2. Clean an area on the upper radiator support.
3. Apply the label to this clean area.
4. Provide California and Massachusetts owners with a “Vehicle Emission Recall-Proof of Correction” certificate.

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
06/01

RTS