



Builder	DRB Group
Region	North Carolina
Division	Raleigh
Community	Sidney Creek SF 40's (NC)(RAL)
Lot	00.0495
Street Address	532 Hipwood Dr.
Field Manager	Daniel Morris
	Eric Morphy
Reviewer	Jon Bennett
Date	6/17/2026
Type	New Review
Product Type	

Score	93.48%
Second Look, Paint & Drywall?	No
Possible Points	115.00
Adj. Possible Points	115.00
Tic Marks	14
# of Items	21
Customer Exceptions	0
Weather Exceptions	0
Division Exceptions	0
Builder Items	0
No Action Items	0

Reschedules


Tic Mark Items

Item	Tic Marks	Description	Points
Minor Drywall	3		0.25
Minor Paint	9		1
Minor Clean	2		0.25

Items

Room	Trade	Item	Description	Points	Initials	
Bath - Hall	Drywall	1410 - Major Drywal Issue	Vertical corner, left of shower head, above tub enclosure/surround is bowed	0.25		
Bath - Owner's	HVAC	615 - Bath Exhaust Issues	Exhaust fan in toilet closet is not working	0.25		
Bath - Powder	Plumbing	721 - Pedastal Sink Water Lines Visible	Water line visible on right side of pedestal sink	0.25		
Bedroom - Owner's	Interior_Trim	1510 - Not Pieced Together Well	Right and left mitered top corners of closet door are not pieced together well	0.25		
Bedroom 1	Flooring	1300D - Damage	BR1, front left, White marks on carpet, back wall, left of door stop	0.25		
Bedroom 2	Interior_Trim	1510 - Not Pieced Together Well	BR2, left rear, case molding to closet, top right mitered corner is not pieced together well	0.25		
Exterior	Brick_Stone_Stucco	5005 - Missing Pieces	Honeycomb/foam blocks are missing at weep holes above garage door lintel	0.25		
Exterior	Brick_Stone_Stucco	5005 - Missing Pieces	Honeycomb/foam inserts missing at weep holes above front door, front windows and along base of front porch wall	0.25		
Exterior	Exterior_Trim	20050 - Ext. Trim Miscut	2nd level soffit. Open gap at corner of soffit, above right side of garage door.	0.25		
Exterior	Exterior_Trim	20000 - Miscellaneous	House left, metal is not secured flush at right end of rake, behind gutter	0.25		
Exterior	Siding	4000 - Miscellaneous	Right side of front porch roof, beneath downspout, a piece of siding is unzipped	0.25		
Family Room	HVAC	610 - Floor/Ceiling/Wall Register Installation	Ceiling register on right side wall is not flush with ceiling	0.25		
Garage	Foundation	400D - Damage	Right side foundation wall in garage, above relief cut in floor, is cut	0.25		
Garage	Major_Item	No Hotwater	No hot water - whole house	1		
General	Doors	50000D - Damage	Threshold is dented on latch side of pedestrian door to garage	0.25		
Kitchen/Dinette	Ceramic	1220 - Tile Installation Issue	Open gap in tile on left side of receptacle, right of range	0.25		
Kitchen/Dinette	Ceramic	1220 - Tile Installation Issue	Open gap in tile at top of receptacle left of range	0.25		
Kitchen/Dinette	Drywall	1410 - Major Drywal Issue	Drywall on right outer side of island is bowed/wavy	0.25		
Kitchen/Dinette	Framing	1050 - Bowed Wall	Front left side of island wall is bowed	0.25		
Stairs/Hall	Framing	1030 - Out of Square/Level	Wall right of stairway is not square	0.25		
Stairs/Hall	Framing	1030 - Out of Square/Level	Wall right of coat closet is not square	0.25		

Scored Photos

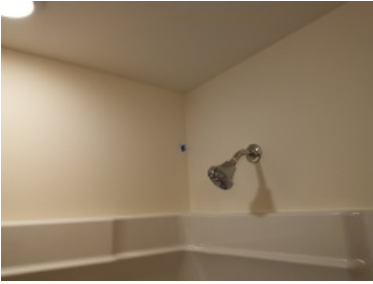

Bath - Hall
1410 - Major Drywal Issue
Vertical corner, left of shower head, above tub enclosure/surround is bowed



Bath - Owner's
615 - Bath Exhaust Issues
Exhaust fan in toilet closet is not working



Bath - Powder
721 - Pedastal Sink Water Lines Visible
Water line visible on right side of pedestal sink



Bedroom - Owner's
1510 - Not Pieced Together Well
Right and left mitered top corners of closet door are not pieced together well



Bedroom 1
1300D - Damage
BR1, front left, White marks on carpet, back wall, left of door stop



Bedroom 2
1510 - Not Pieced Together Well
BR2, left rear, case molding to closet, top right mitered corner is not pieced together well



Exterior
20000 - Miscellaneous
House left, metal is not secured flush at right end of rake, behind gutter



Exterior
20050 - Ext. Trim Miscut
2nd level soffit. Open gap at corner of soffit, above right side of garage door.



Exterior
4000 - Miscellaneous
Right side of front porch roof, beneath downspout, a piece of siding is unzipped



Exterior
5005 - Missing Pieces
Honeycomb/foam blocks are missing at weep holes above garage door lintel



Exterior
5005 - Missing Pieces
Honeycomb/foam inserts missing at weep holes above front door, front windows and along base of front porch wall



Family Room
610 - Floor/Ceiling/Wall Register Installation
Ceiling register on right side wall is not flush with ceiling



Garage
400D - Damage
Right side foundation wall in garage, above relief cut in floor, is cut



Garage
No Hotwater
No hot water - whole house



General
50000D - Damage
Threshold is dented on latch side of pedestrian door to garage



Kitchen/Dinette
1050 - Bowed Wall
Front left side of island wall is bowed




Kitchen/Dinette
1220 - Tile Installation Issue
Open gap in tile at top of receptacle left of range




Kitchen/Dinette
1220 - Tile Installation Issue
Open gap in tile on left side of receptacle, right of range



Kitchen/Dinette
1410 - Major Drywal Issue
Drywall on right outer side of island is bowed/wavy

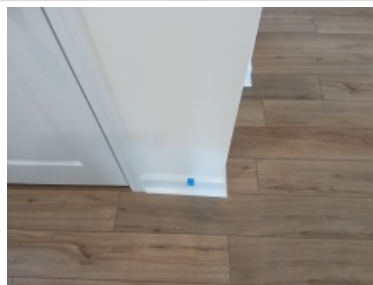

Stairs/Hall
1030 - Out of Square/Level
Wall right of coat closet is not square

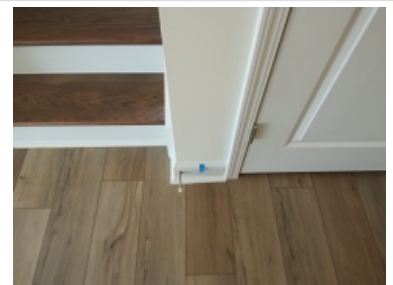

Stairs/Hall
1030 - Out of Square/Level
Wall right of stairway is not square



