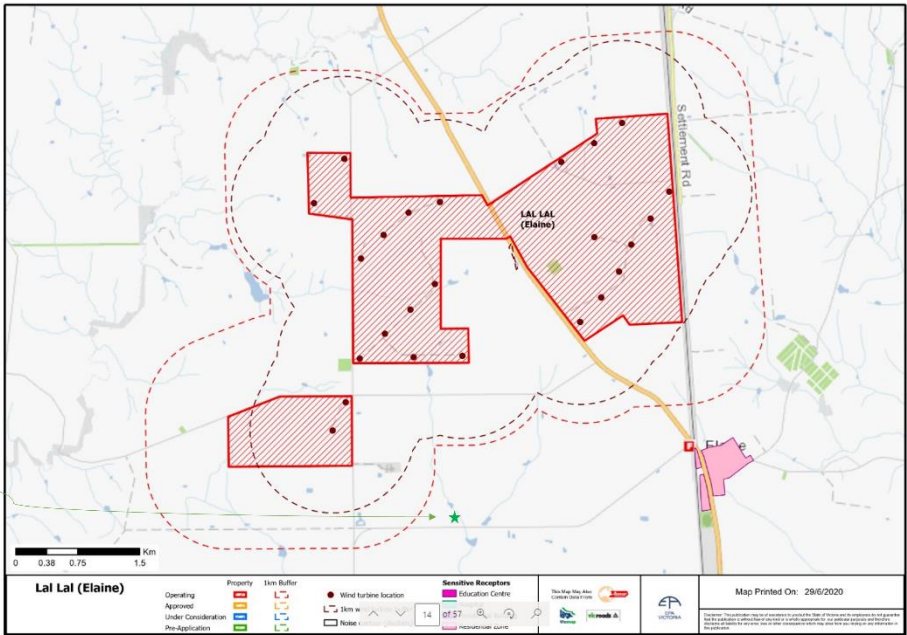
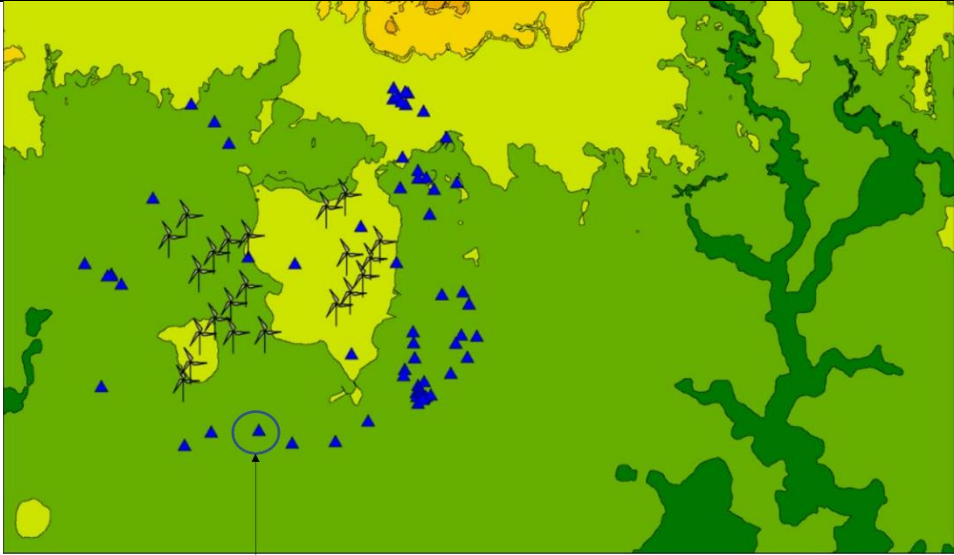


Lal Lal WEF Desk Top Review

The following is representative of the data to be collected for a desk-top review. Some data may require contact with DELWP and/or Council. **PRU has a copy of the documentation

EPA Region	SW	
Case File	CSE-00001577 Linked case file CSE-090001665	
Report	Prepared in support of a report (PRI-00002264)	
Location	Moorabool Shire	
Reporter Location	Reporter location 308 Elaine-Mt Mercer Road, Elaine Google Maps can be used to find the spatial location Lat 37.7882S Long 143.99313 Note: The Noise Reports use Easting and Northing coordinates (GDA 94 MGA Zone54) for the turbine locations and the dwelling locations Web site converters are available to convert between these coordinates and Longitude and Latitude www.latlong.net/lat-long-utm.html Dwelling location Easting 236427, Northing 5813464 Note: These steps may not be necessary depending on the level of detail provided in the consultant noise assessment reports. In this case the Sonus noise assessment report lacks sufficient detail (see below) 	

Dwelling Land Use Zoning	Farming Zone (FZ) This is important to know regarding the potential application of the High Amenity Area noise limit penalty in the NZS. It does not apply to dwellings in the FZ.	
WEF	Operating WEF (60 turbines) comprising two sites – Yendon (38 turbines) and Elaine (22 turbines)	
Planning Permit	PL-SP/05/0461/C (Amended March 2017, April 2018, September 2019)	**
Relevant Noise Standard	NZS 6808:2010 (This was amended in March 2017)	
Noise Sensitive Locations	Noise sensitive locations existing as at 20 March 2017	
Responsible Authority	Moorabool Shire Council is the RA for compliance and enforcement of the planning permit conditions	
Operational status	Operating WEF. AEMO certificates include 5MW for the Elaine site, and 42MW (day) and 144MW (night) for the Yendon site	
Post Construction Noise Assessment PostCNA	PostCNA was commenced in March 2021	
Pre Construction Noise Assessment Report	Sonus Lal Lal Wind Farm Pre-Construction Noise Assessment April 2018 This report provides Easting and Northing coordinates for all residences close to the Yendon and the Elaine sites The turbine and residences map does not include a legend so it is not easy to determine where the reporter dwelling is located (Hence the need for further desk top research – see below) The report provides the predicted noise levels. It does not provide noise contours.	**

	 House Location	
Background Noise Monitoring Report	The Sonus report refers to a Marshall Day background noise monitoring report Report No.001 01Draft 20170640 The background noise monitoring report identified seven noise sensitive locations for monitoring This is not available (DELWP should have a copy but say they do not)	
Predicted Noise Contours	The Sonus report does not provide noise contours. However, MDA report below does include contours (see picture). The reporter dwelling location is shown and it is located just outside the 35dB noise contour. Therefore, under the NZS noise monitoring is not required for the location. Given the predicted 5dB margin (to the minimum noise limit of 40dB) it is reasonable to expect operational compliance with the noise limit at this location. At the time of writing the specific noise complaint(s) being made is not known.	

	House Location (Just outside the 35dB contour)	
Noise Compliance Test Program	Marshal Day Acoustics. Report No. 003 R03 20170649 23 Jan 2018 Lal Lan Wind Farm – Noise Compliance Test Plan Note: This report states that repeat monitoring was undertaken for receiver location K15aa although is not included in the report. A report to the RA (Council) should have occurred. The is no measurement point located South of the turbines as shown above. Wind conditions from a Nth direction may not be adequately represented. The MDA report does include wind speed roses and they show that northerly wind direction is fairly common in this lo9cation. As shown in the diagram, the dwellings where the noise was predicted to be above 35dB are predominately located on the North-East side of the turbines.	**
Interim Conclusion (subject to seeing the specific noise complaint made)	GED: It is reasonably practicable to wait for the PostCNA to be completed to show how the actual noise measurements compare with the predicted levels. UN: It is still possible that UN may be present due to a turbine fault or due to the presence of Special Audible Characteristics (SACs) that may be present in the noise emissions. If so, this may require a noise limit adjustment. This can only be known after the PostCNA is completed. Therefore, since the actual noise limits are not definitely known at the moment the regulations cannot be applied and therefore, the factors of unreasonable noise in section 3 of the Act need to be used.	