

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

QRT Inc.

HTOL Set-up Report

This report is protected by copyright and may not be copied, scanned or reproduced in any form without express written permission from QRT

COMPANY	:	UBIVELOX
PRODUCT	:	SLC52AIA
PACKAGE	:	10 DFN
PURPOSE	:	Set-up
ISSUED DATE	:	2026-07-08

Prepared by : Chanyoung Kim

Approved by : Kwangsun Jung

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

Revision History

Revision No.	Date	Contents
0	24.07.08.	Initial Set-up

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)


1. Test Setup Details

(1) HTOL Test Configuration

Test Item : HTOL	Test condition : 105 °C
Power Name	V0 : 5.500 V
VIH	5.5 V
PNP Name : i2c_get_info_0707	Cycle Time : 10000 ns
Power up sequence	V0_5.500V
Note	
- Power ON → Write (delay 5.2ms) → Read (delay 5ms) → Write (delay 5.2ms) → Read (delay 5ms) → Looping	


(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(2) HTOL Test Board

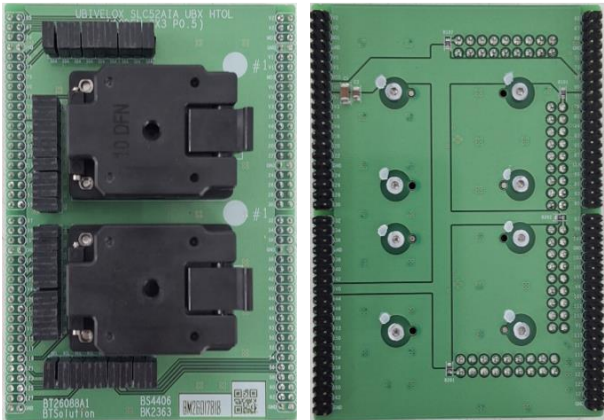Test Board	Board Information
	Product : SLC52A1A
	Package Type : 10 DFN
	Board Type : HTOL Socket Board
	Board S/N : BT26088A1
	Material Code : BS4406
	Quantity : 120 EA (240 DUT)

(3) HTOL Schematic

HTOL Schematic

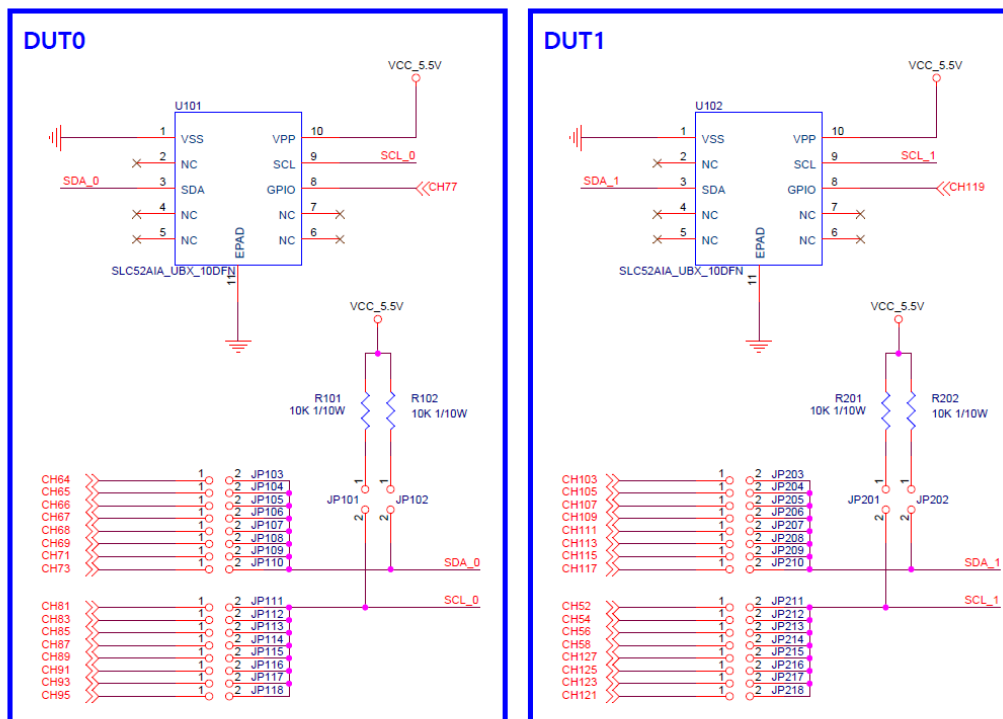


BTSolution			
Title UBIVELOX SLC52AIA UBX 10DFN HTOL			
Size A	Document Number <Doc>	Rev <Rev>	
Date:	Thursday, May 14, 2026	Sheet	2 of 2

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

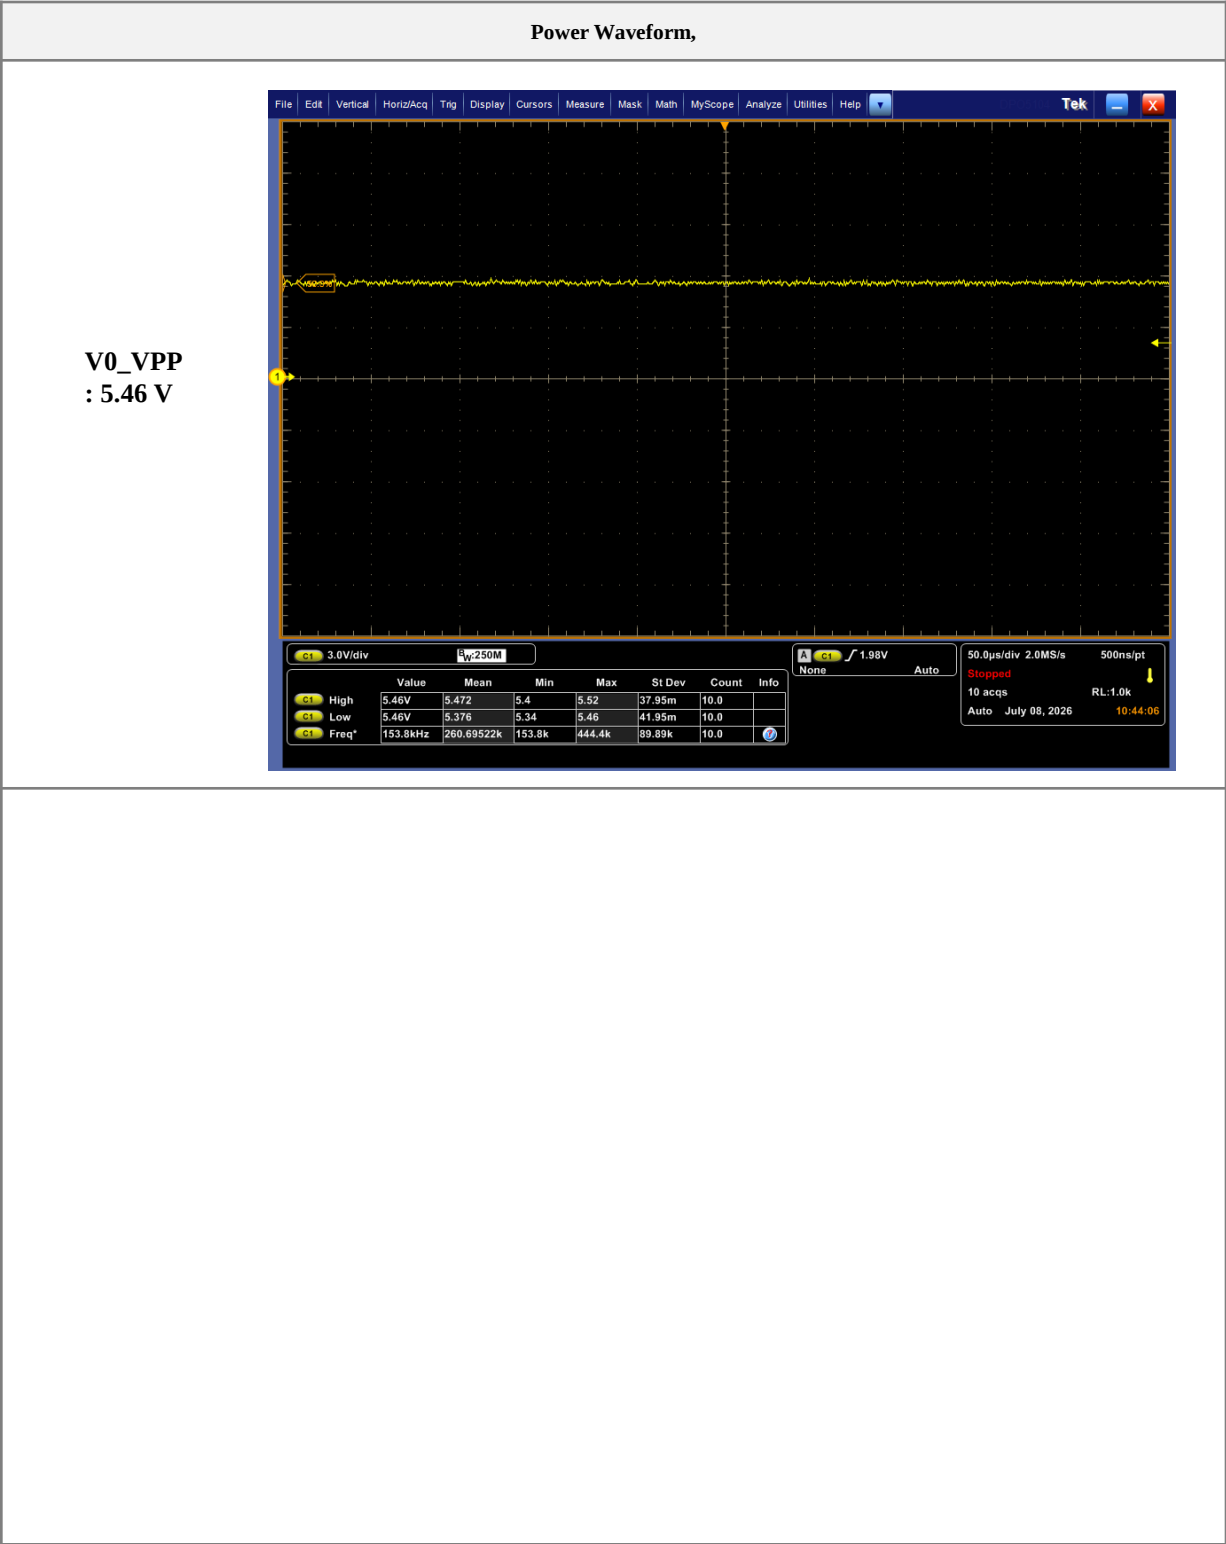

(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

Input/Output Waveform,

Trigger

SLC

SDA

GPIO

The figure displays two oscilloscope waveforms, labeled 'Write' and 'Read', showing the timing of an I2C communication sequence. The waveforms are captured on a Tektronix scope, with the following settings:

- Trigger: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SLC: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SDA: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- GPIO: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div

Write Operation:

- Trigger: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SLC: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SDA: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- GPIO: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- Delay: 5.22ms

Read Operation:


- Trigger: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SLC: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- SDA: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- GPIO: 5.0V/div, 5.0V/div, 5.0V/div, 5.0V/div
- Delay: 5.04ms

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

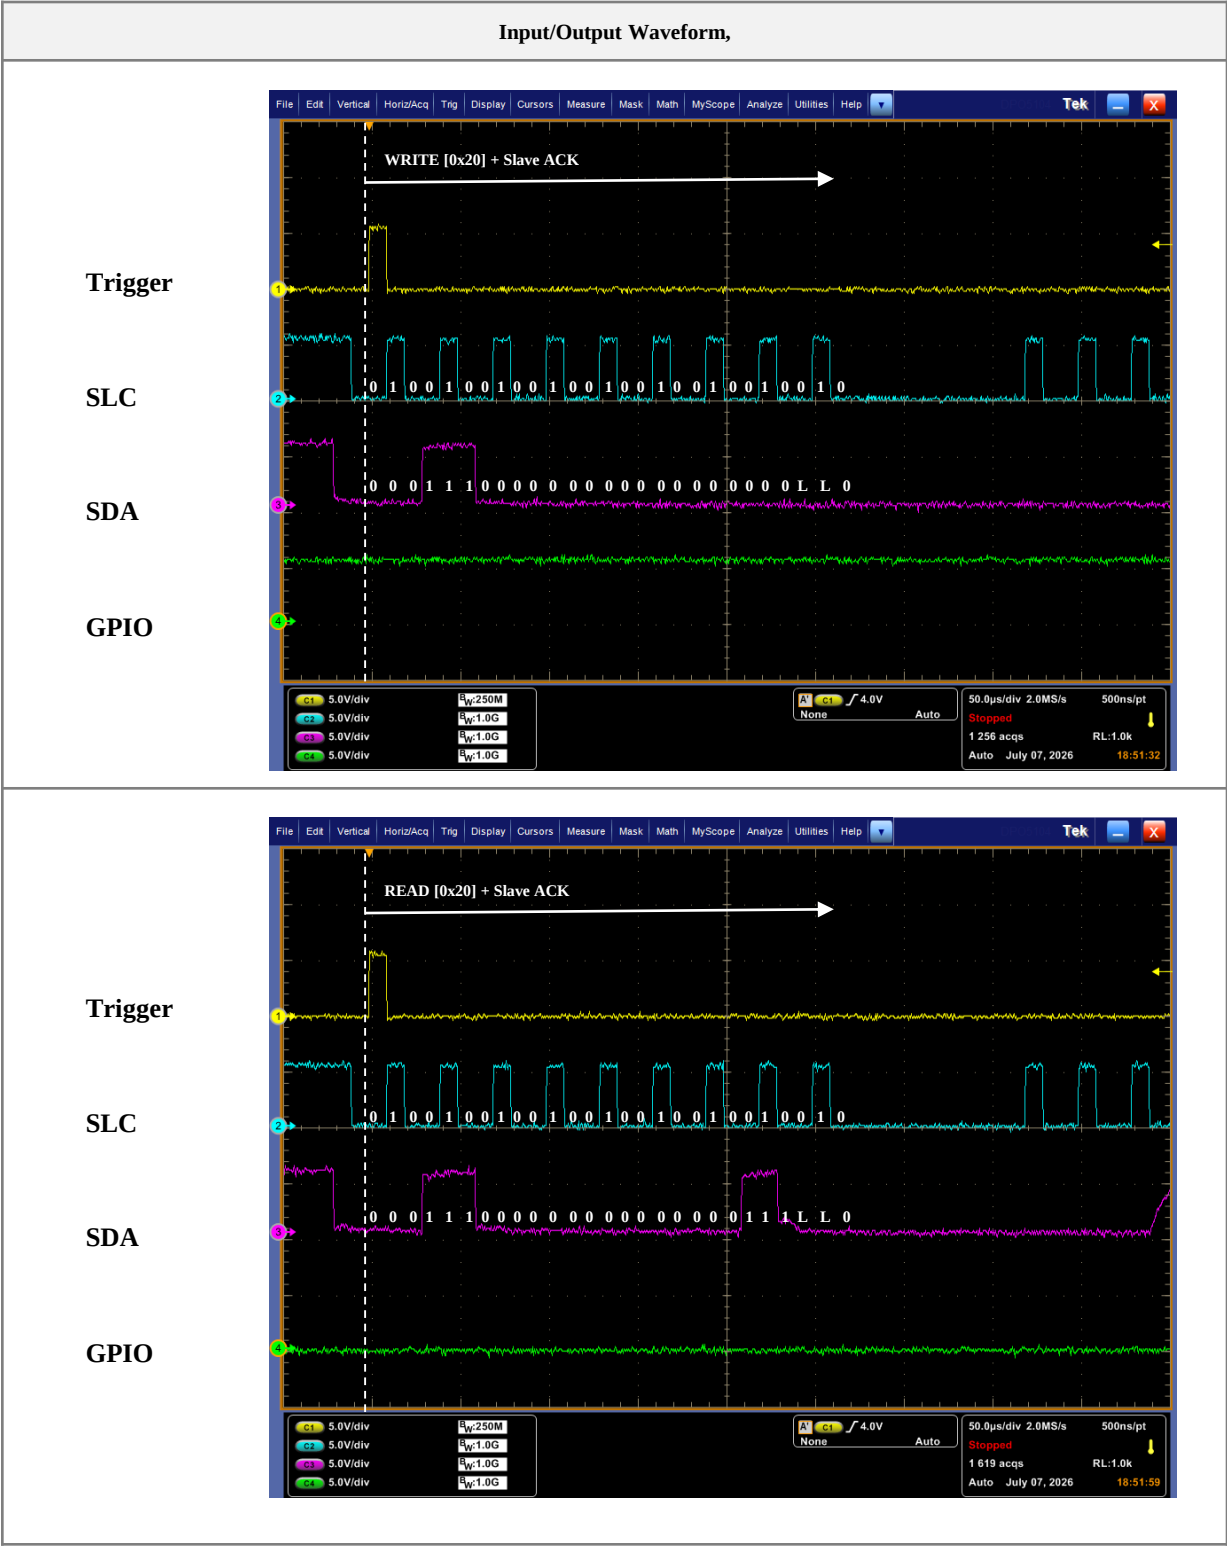


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

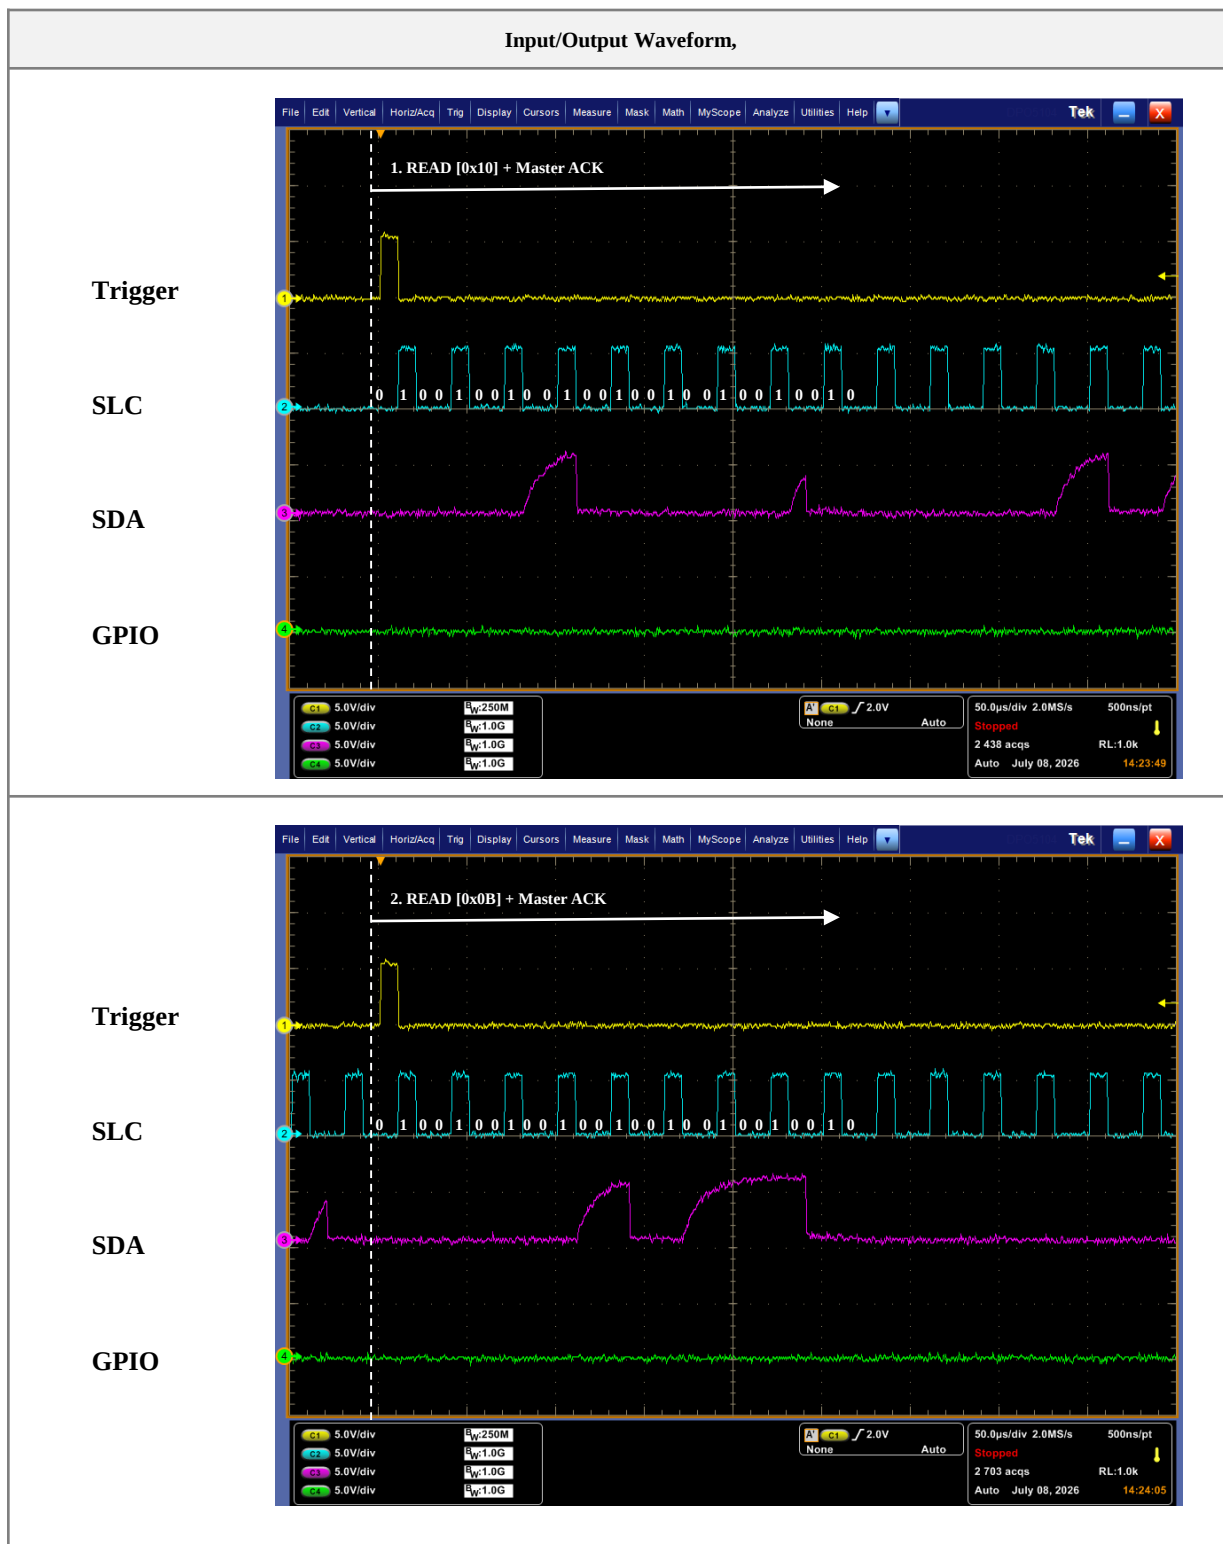


SETUP REPORT




219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

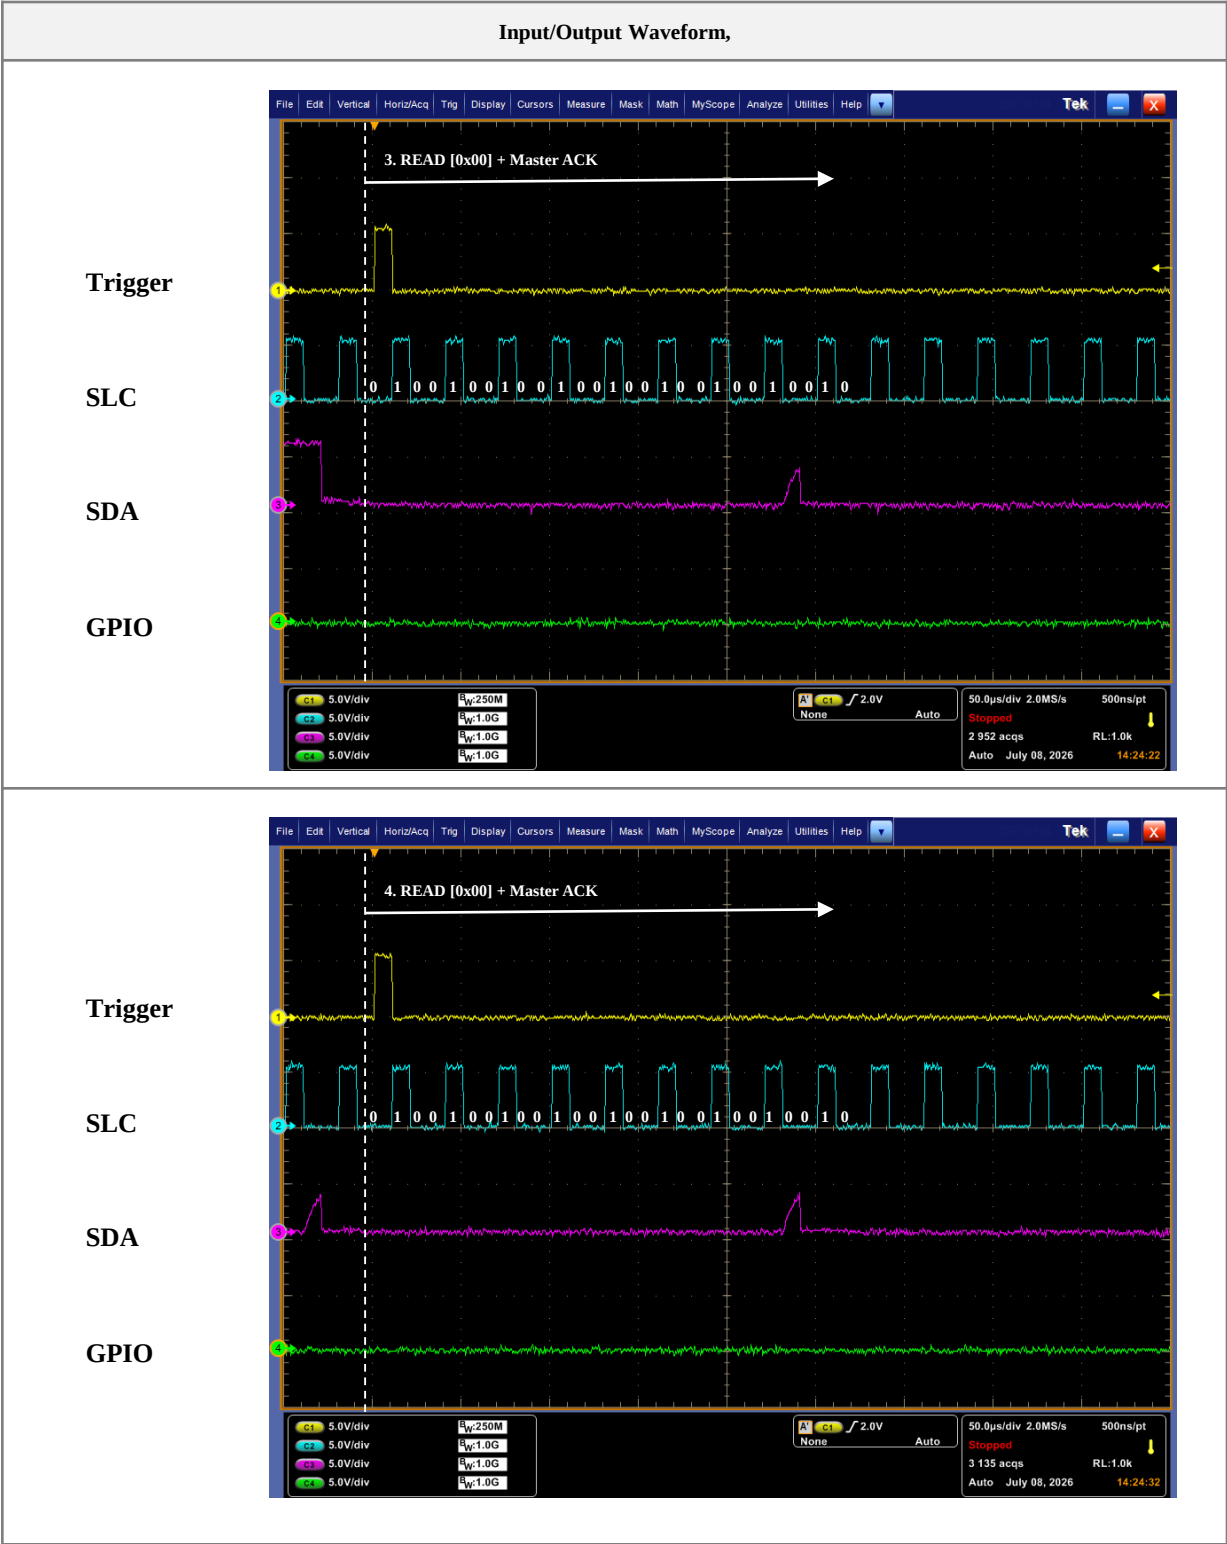

(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

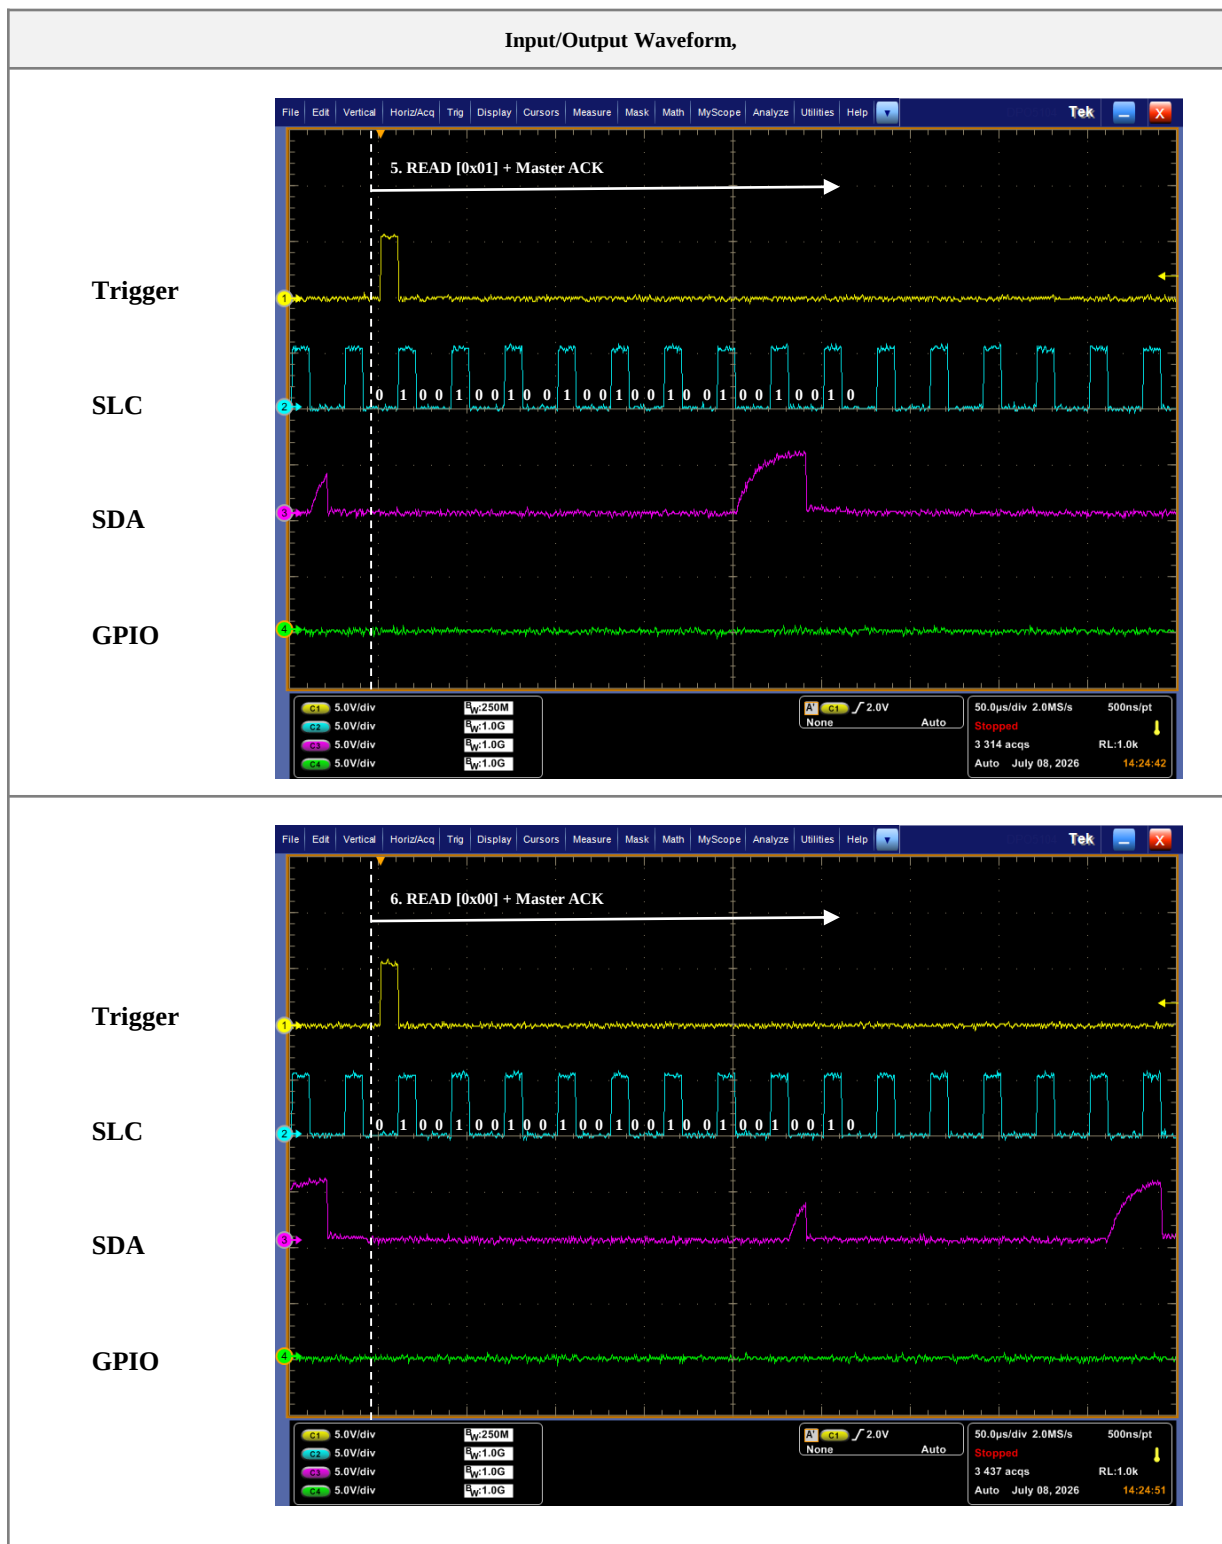


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA

(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

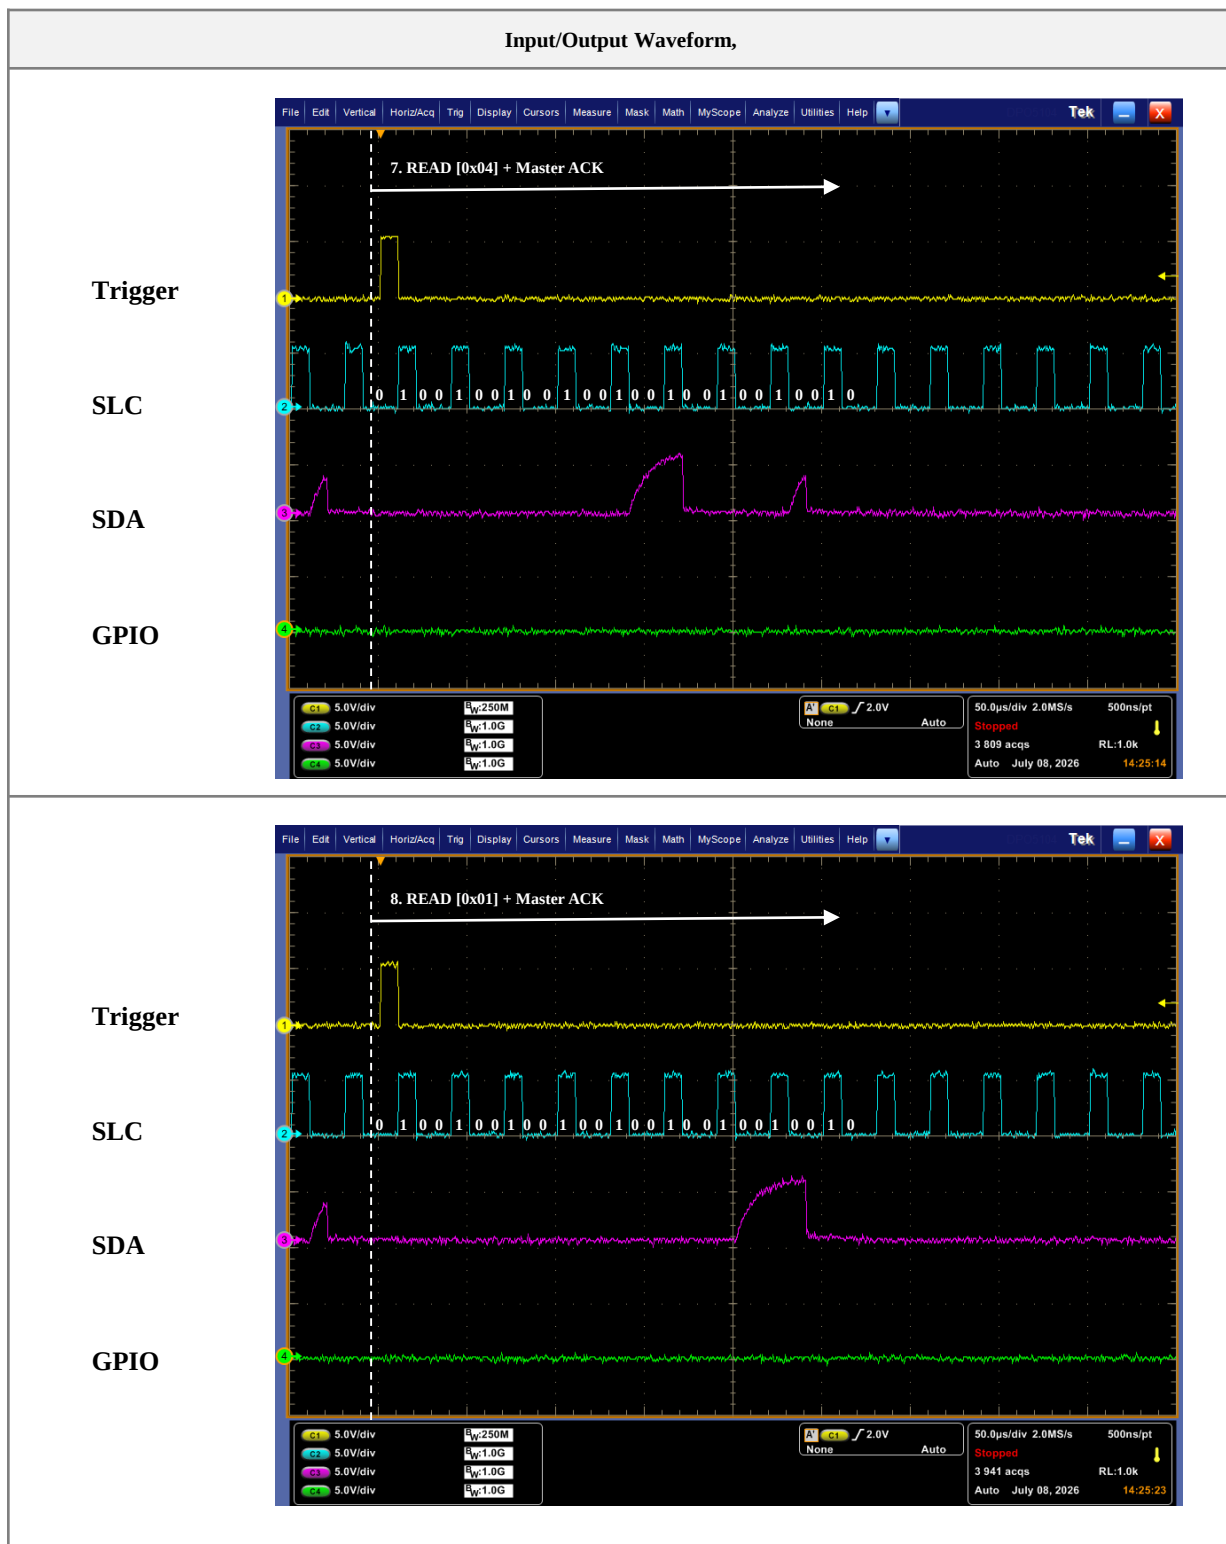


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

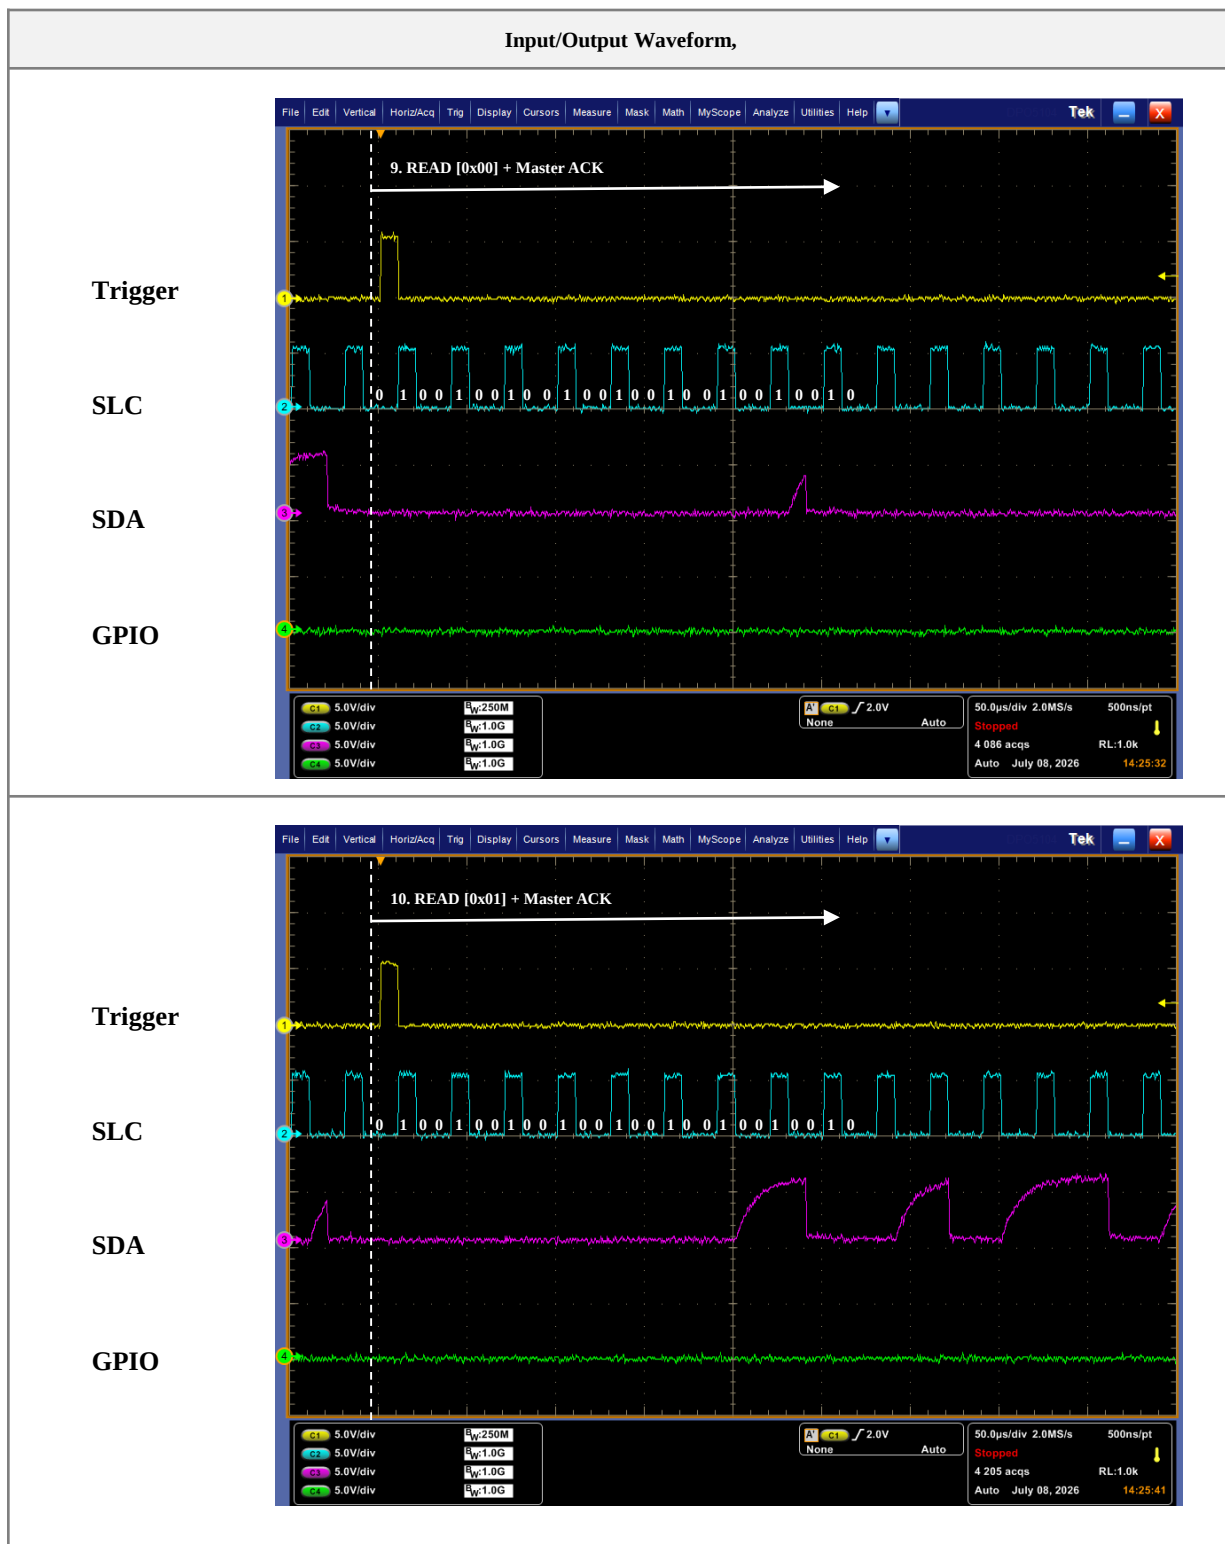


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

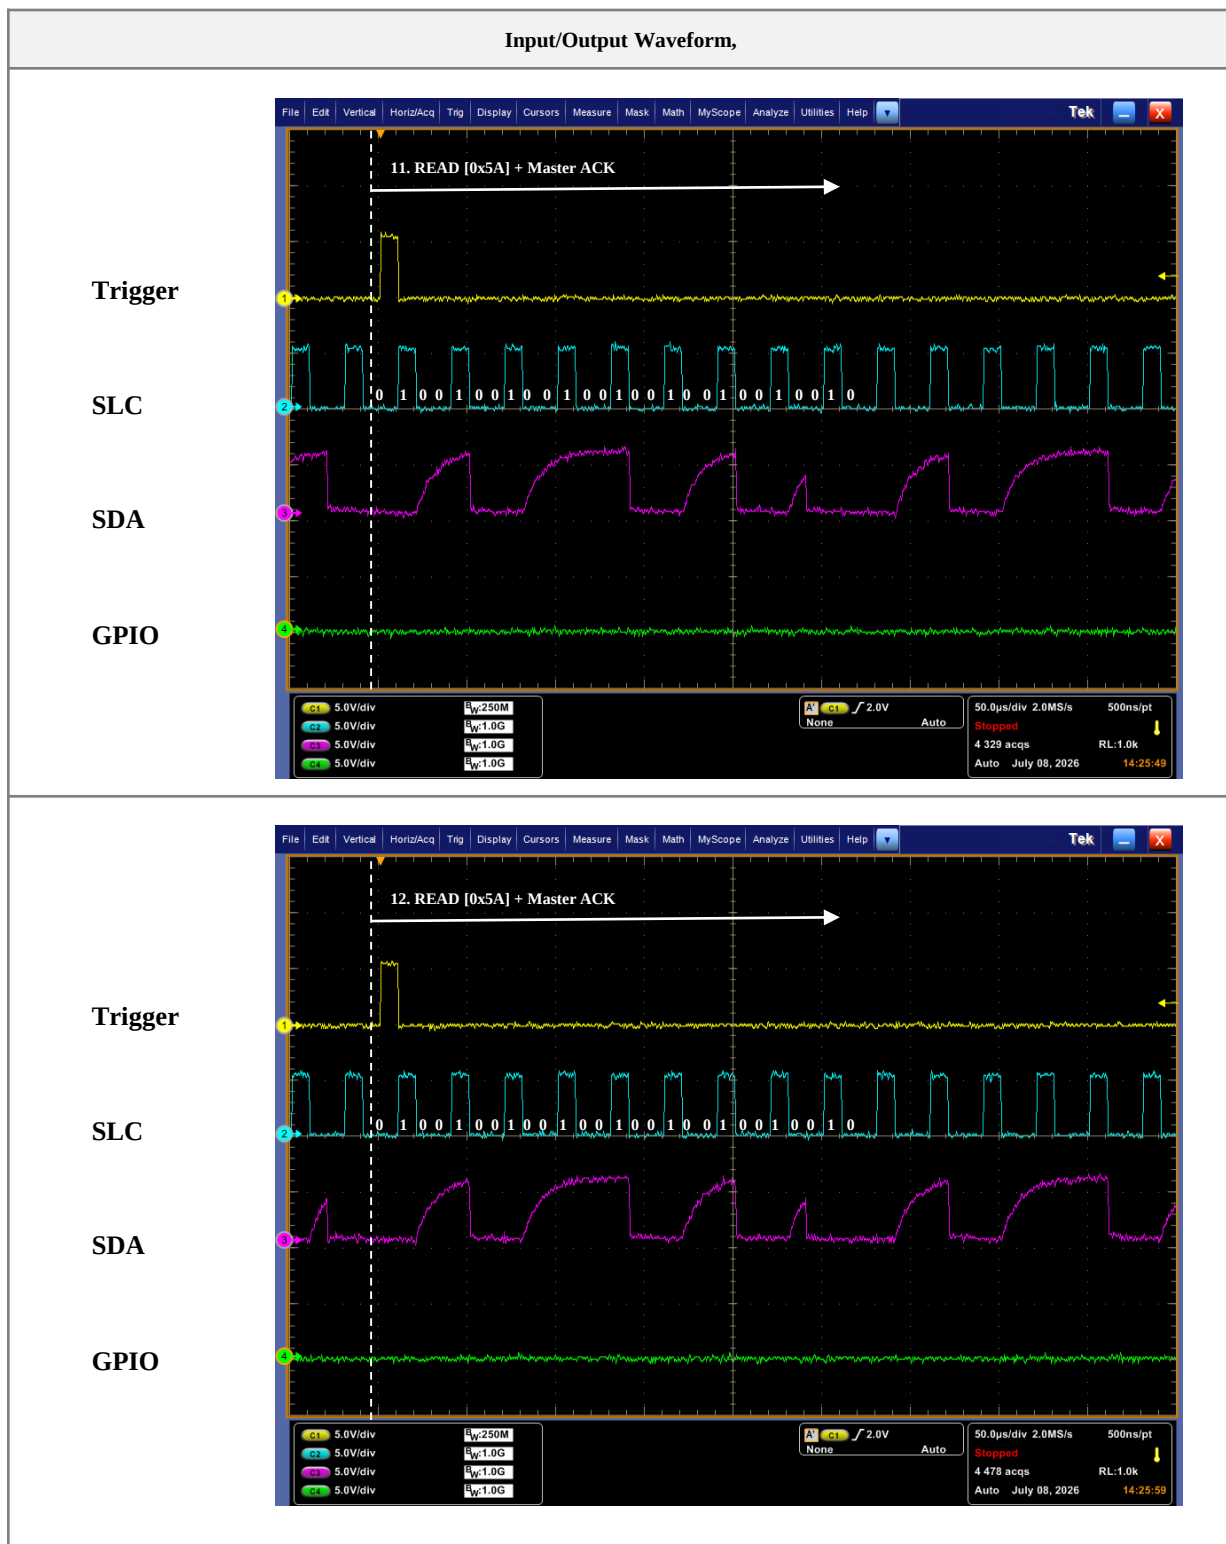


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA

(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

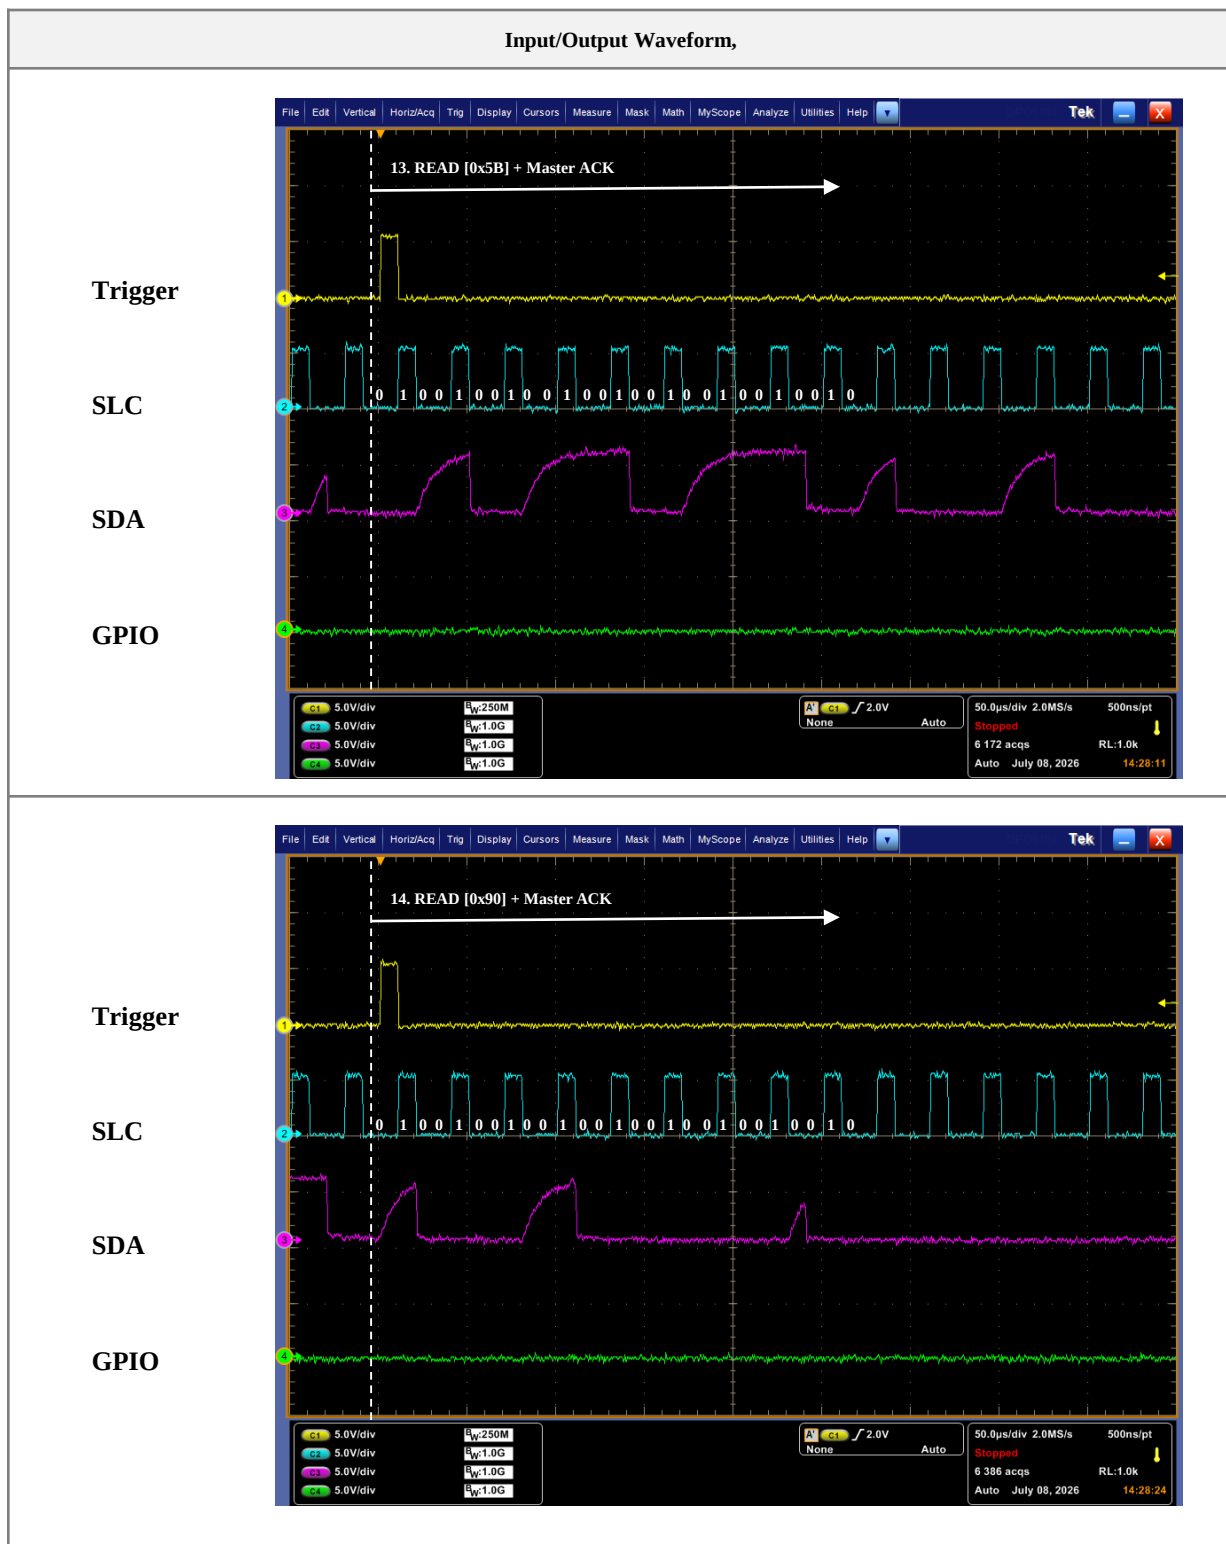


SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

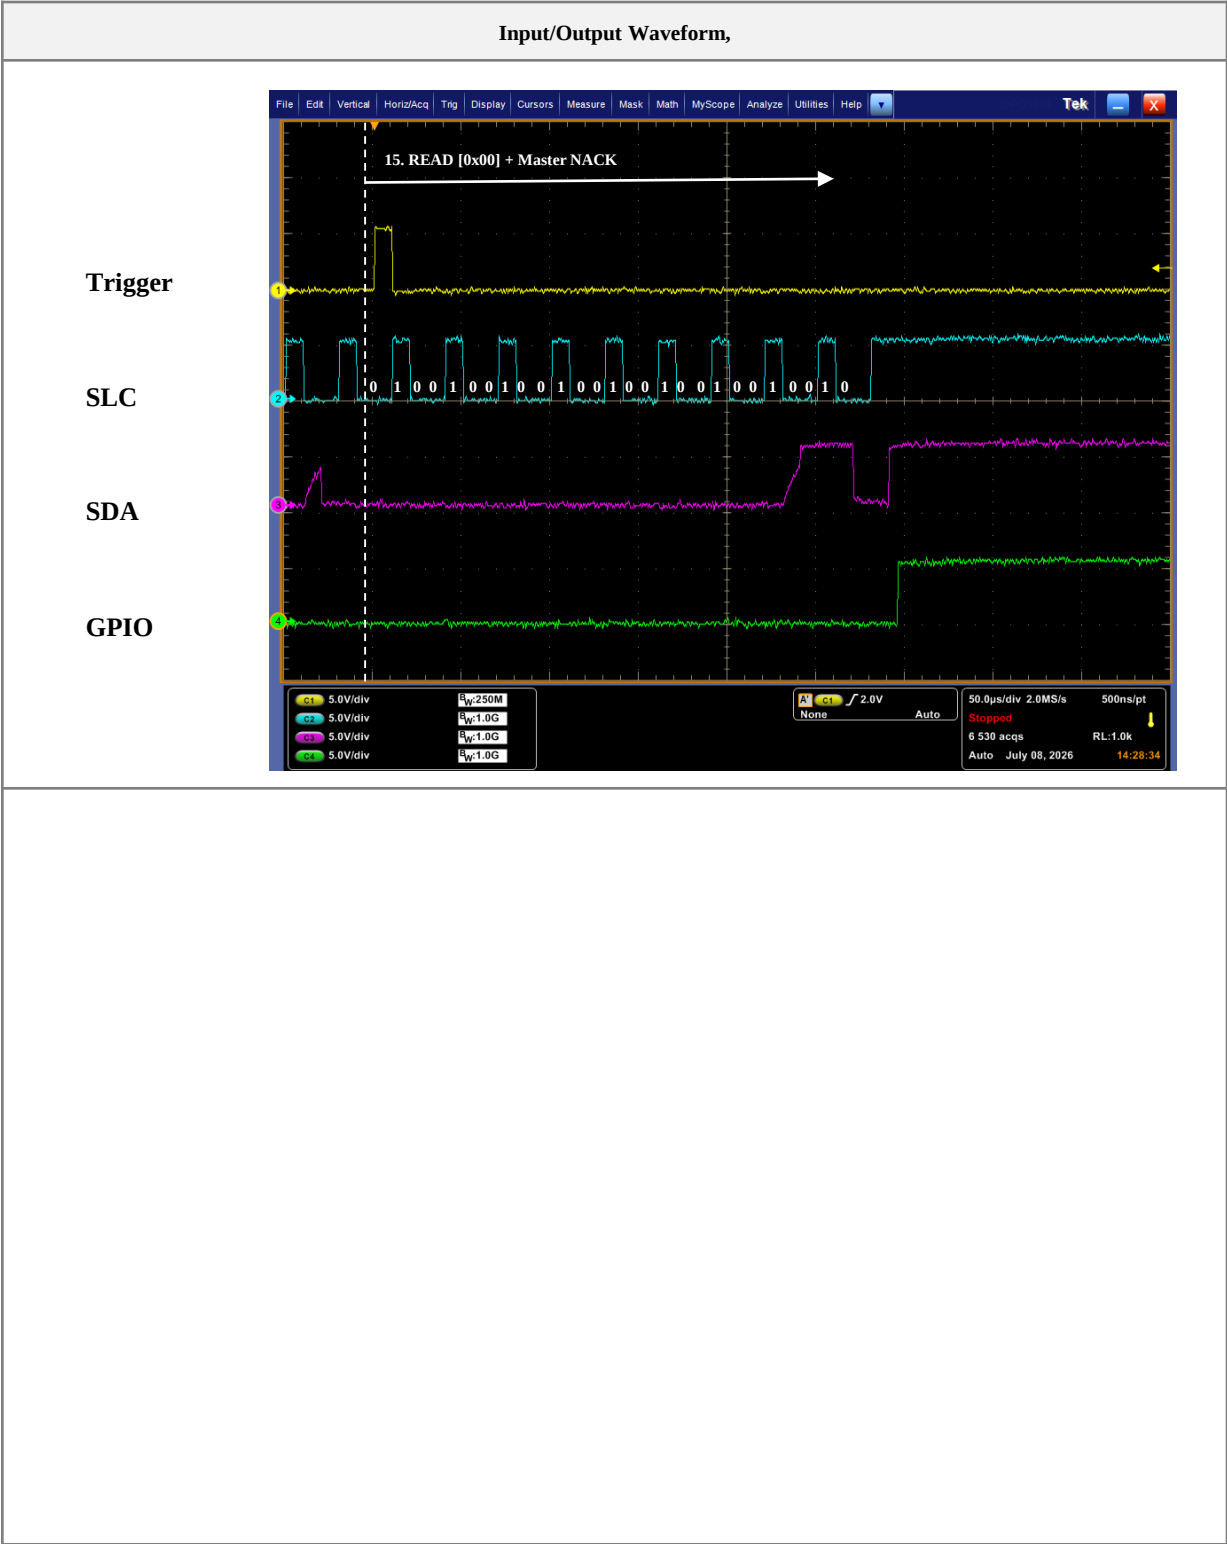

SETUP REPORT



219, Gyeongchung-daero, Bubal-eub, Icheon-si, Gyeonggi-do, KOREA
(Tel: + 82 031-8094-8224 Fax +82 031-8094-8240)

(4) Operation Check

Ambient	Qty	Power Name	Bias Set	Measured Current	Remark																								
Room	1	V0	5.500 V	0.000 A																									
<table><tr><th>V0</th><th>V1</th><th>V2</th><th>V3</th><th>V4</th><td></td></tr><tr><td>5.500</td><td>0.000</td><td>0.000</td><td>0.000</td><td>0.000</td><td>Set Voltage</td></tr><tr><td>5.521</td><td>-0.005</td><td>-0.005</td><td>-0.006</td><td>-0.003</td><td>Read Voltage</td></tr><tr><td>0.000</td><td>0.003</td><td>0.004</td><td>-0.001</td><td>-0.003</td><td>Read Current</td></tr></table>						V0	V1	V2	V3	V4		5.500	0.000	0.000	0.000	0.000	Set Voltage	5.521	-0.005	-0.005	-0.006	-0.003	Read Voltage	0.000	0.003	0.004	-0.001	-0.003	Read Current
V0	V1	V2	V3	V4																									
5.500	0.000	0.000	0.000	0.000	Set Voltage																								
5.521	-0.005	-0.005	-0.006	-0.003	Read Voltage																								
0.000	0.003	0.004	-0.001	-0.003	Read Current																								
Room condition_1EA																													