


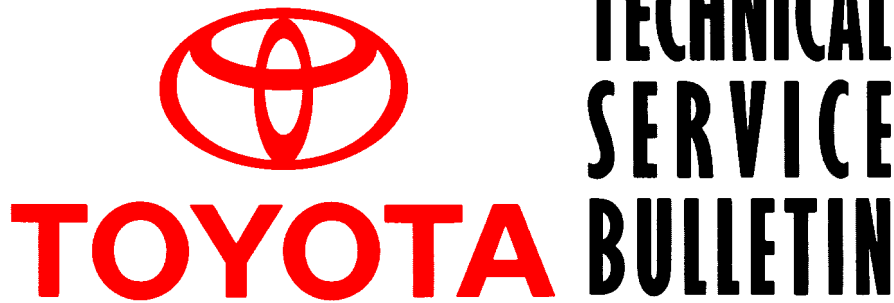

REF.: PRODUCT GENERAL INFORMATION
NO.: PG93-013
DATE: DECEMBER 17, 1993
MODEL: AT, ST

CELICA ALIGNMENT REPAIR MANUAL CORRECTIONS

Page 1 of 1

Listed below are corrections for the 1992 & 1993 Celica Repair Manual's **Service Specifications – Suspension and Axle** section. Actual repair manual changes are attached as paste-in pages.

Pub No.	Publication Name
RM251U2	1992 Celica Volume 2 Repair Manual
RM305U2	1993 Celica Volume 2 Repair Manual

Note: The correct portion is indicated by: ☞

SERVICE SPECIFICATIONS – Suspension and Axle

Page	Item	Incorrect	Correct
A-21 (RM251U2)	Rear wheel alignment/Camber	$-45' \pm 30'$ 30' or less	$-1^{\circ}15' \pm 45'$ 30' or less ☞
A-17 (RM305U2)	Rear wheel alignment/Camber	$-45' \pm 30'$ 30' or less	$-1^{\circ}15' \pm 45'$ 30' or less ☞

Additional repair manual correction pages are available through the **Dealer Support Material Network** (MDC NPM system) by ordering part number **00400-RM222-B3019**.