

COLLISION REPAIR INFORMATION BULLETIN



SUBJECT:	SEALING OF HEMMING FLANGES AND BODY & PANEL SEAMS		
BULLETIN NO.:	TS–TCI–CRIB–2015	DATE ISSUED:	May, 2013
MODELS:	All Toyota & Scion Models	SECTION:	Exterior

To assure proper sealing of all sheet metal replacement components, as well as structural members and body seams, always use a quality urethane body seam sealer during body repairs. Silicone based sealers are not recommended for use as seam sealers as paint will not adhere to the silicone in the sealer, causing voids in the painted surface which allow corrosion to develop near the seam. Synthetic rubber sealers are also not recommended for use as seam sealers because their tensile strength, bending and shape retention properties may not perform as well as urethane sealers. If seam sealer is not applied during collision repairs, the new car corrosion warranty may not cover improperly replaced components replaced during the repair.

Refer to the appropriate Toyota/Scion Collision Repair Manuals for detailed instructions and locations of joints and seams to be sealed. For Toyota/Scion Collision Centre facilities, visit the ETAS and Toyota Technical Information System (TIS) site located in the Infostream website portal at <http://infostream.toyota.ca/> to access Service Repair Manuals, Repair Manuals for Collision Damage, Service Bulletins and Collision Repair Information Bulletins. For independently operated collision centres interested in these publications, visit www.techinfo.toyota.com for a subscription and access.

In partnership with Würth Canada, Toyota Canada Inc. (TCI) recommends and offers a complete line-up of body shop supplies, adhesives, fasteners, abrasives, connectors, safety supplies, tools, etc., that are available through the Würth Body Shop Products Program. Toyota and Scion Dealers can order all of Würth's products through this program. Dealers can access program details in the Infostream website portal at <http://infostream.toyota.ca/>. For independently operated collision centres interested in these products, please contact your local Toyota and Scion Dealer.

Specifically in regards to this bulletin, Toyota Canada Inc. recommends the following Würth products:


Würth Product Name	Art. No.	Illustration
Bond and Seal	890.1001 White 890.1002 Grey	
Special Beading Nozzle	891.660	

NOTE: Issue of this Collision Repair Information Bulletin by Toyota Canada Inc. is to ensure that proper repair information is available. It does not constitute an authorization for repair. PLEASE ROUTE THIS BULLETIN TO YOUR COLLISION REPAIR CENTER MANAGER AND COLLISION & REFINISH TECHNICIANS.


SEALING OF HEMMING FLANGES AND BODY & PANEL SEAMS

The following pages are examples of some of the areas that require sealing by the Collision Repair Technician during collision repair.


Hood

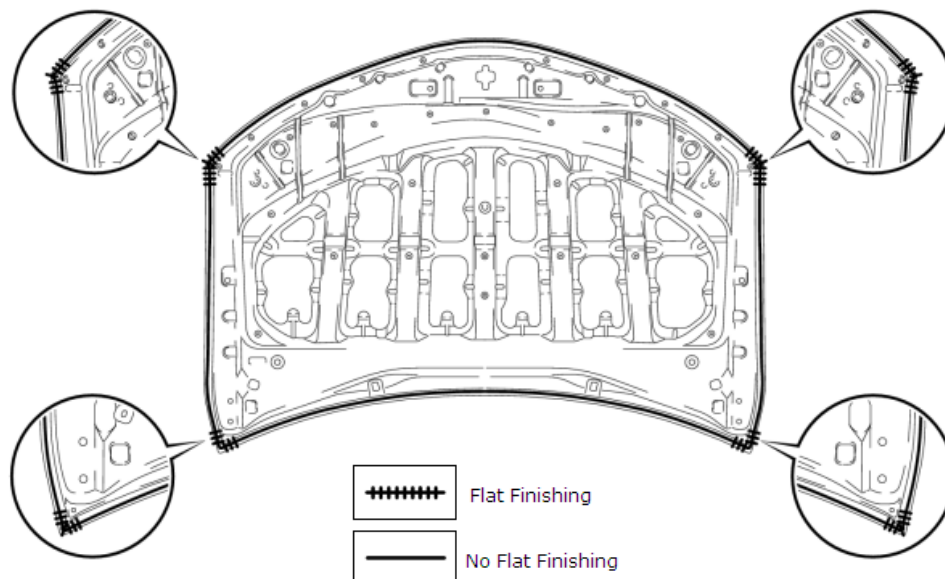

Trunk

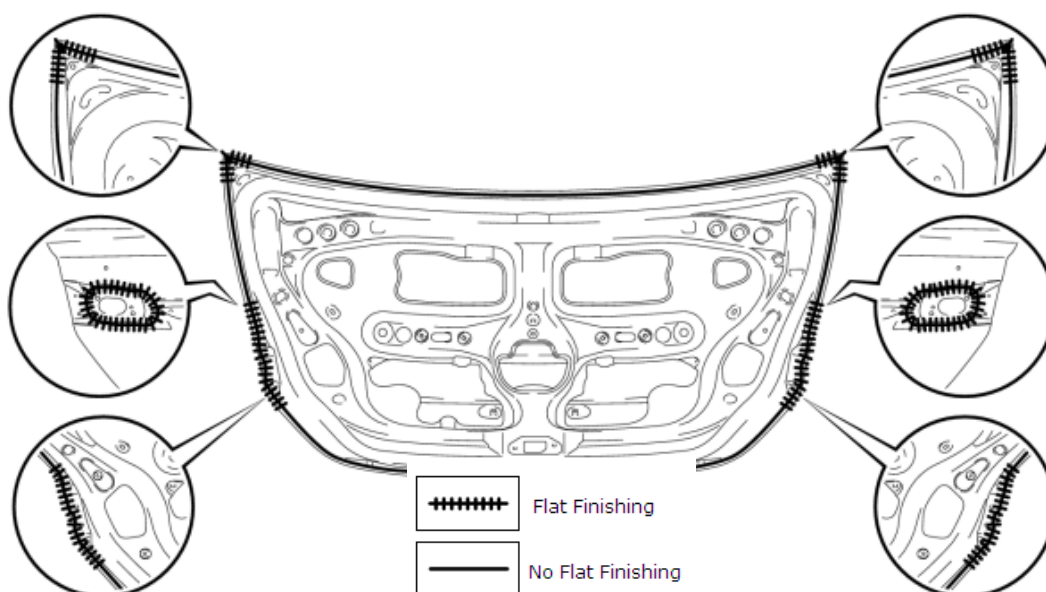

Front Door

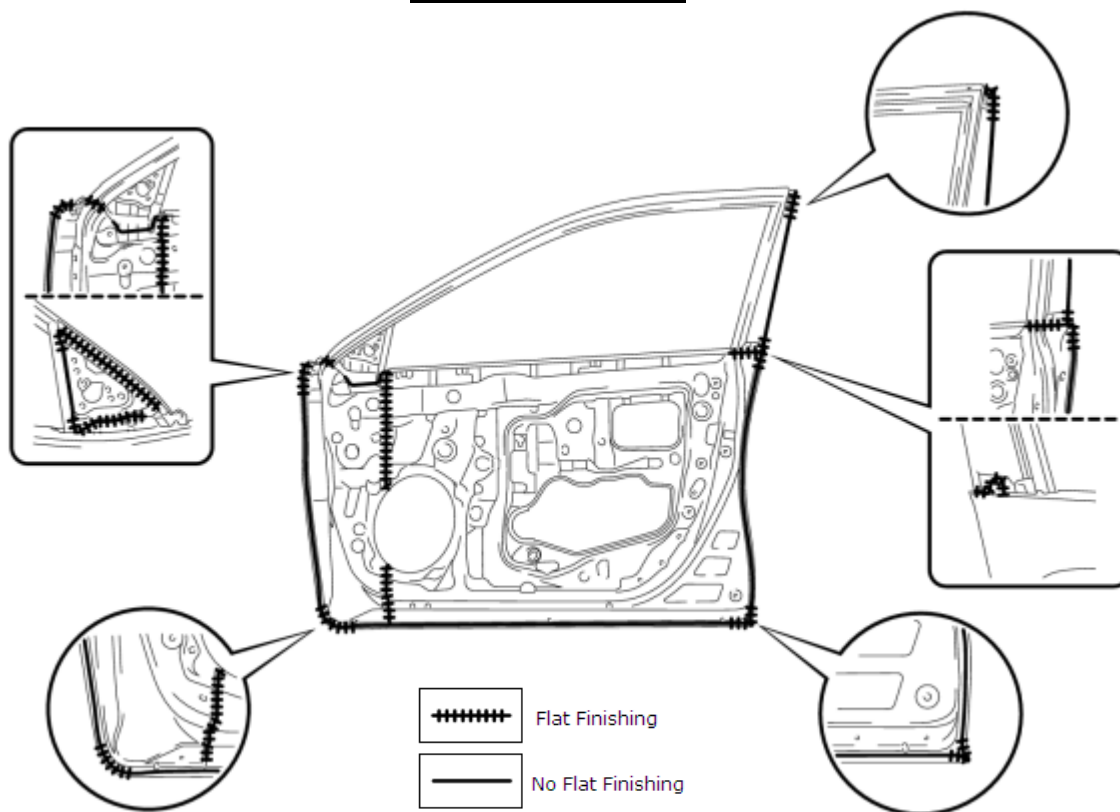

NOTICE:

Failure to seal the various seams according to the Toyota/Scion Collision Repair Manuals may result in a premature corrosion. **Always refer to the model specific Repair Manual for Collision Damage for complete information on sealing areas and instructions.**

For handling precautions, application instructions, safety precautions, personal protection equipment requirements and clean-up instructions, always refer to the product labels and MSDS sheets.