

COLLISION REPAIR INFORMATION BULLETIN



SUBJECT:	ANTI-CORROSION TREATMENT		
BULLETIN NO.:	TS-TCI-CRIB-2032	DATE ISSUED:	May, 2013
MODELS:	All Toyota & Scion Models	SECTION:	Exterior

To help prevent corrosion and reduce interior vehicle noise when replacing body panels, always apply corrosion protection and sound dampening materials such as body sealer, cavity wax, undercoating and body foam as recommended by Toyota/Scion.

Toyota/Scion recommendations can be found in the Anti-Rust Treatment (AR) section for each Toyota/Scion Repair Manual for Collision Damage. For Toyota or Scion Collision Centre facilities, visit the ETAS and Toyota Technical Information System (TIS) site located in the Infostream website portal at <http://infostream.toyota.ca/> to access Repair Manuals for Collision Damage. For independently operated collision centres interested in these publications, visit www.techinfo.toyota.com for a subscription and access.

BODY SEALER:

For waterproofing and corrosion protection measures, always apply body sealer to the seams and hems of doors, hoods, etc. as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model.

Apply body sealer to required areas as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model. Typical areas include:

- Door seams (Illustration A)
- Underhood seams (Illustration B)
- Wherever body sealer has been removed during a repair or a new replacement panel has been installed (new OEM replacement panel seams have no sealer applied)

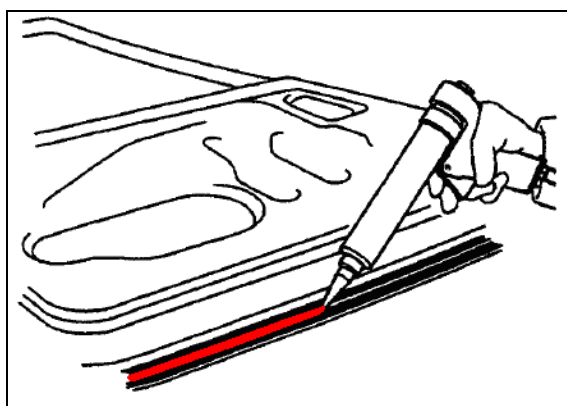


Illustration A

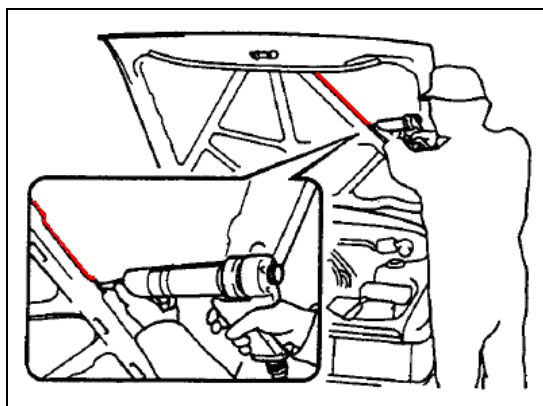


Illustration B

NOTE: Issue of this Collision Repair Information Bulletin by Toyota Canada Inc. is to ensure that proper repair information is available. It does not constitute an authorization for repair. PLEASE ROUTE THIS BULLETIN TO YOUR COLLISION REPAIR CENTER MANAGER AND COLLISION & REFINISH TECHNICIANS.



TS-TCI-CRIB-2032

May, 2013

ANTI-CORROSION TREATMENT**CAVITY WAX:**

To help provide corrosion resistance, apply cavity wax to the inside of the hemming areas of the doors and hoods, around the hinges, and to the welded surfaces inside the boxed cross-section structure of the side member, body pillar, etc. as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model.

Apply cavity wax to required areas as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model. Typical areas include:

- Inside of the hems of the doors and hood (Illustration C)
- Around the hinges of the doors and hood (Illustration D)
- Wherever the original cavity wax was disturbed during a repair or a new replacement panel has been installed

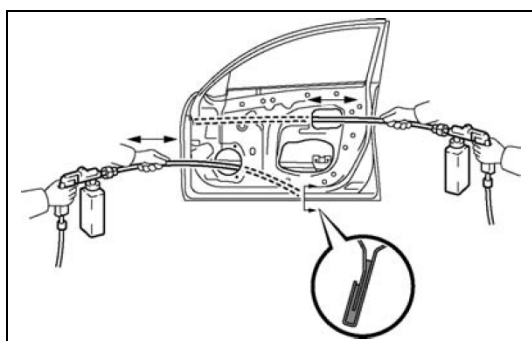


Illustration C

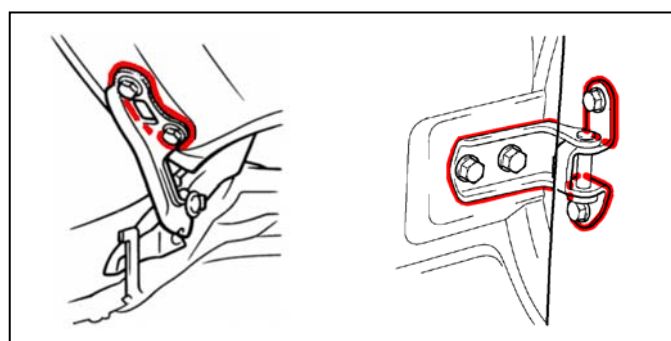


Illustration D

UNDERCOATING:

To help protect the vehicle from damage from stones or road debris, always apply chip resistant materials to the bottom surfaces of the underbody and inside of the wheel housing.

Apply chip resistant materials as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model. Apply the material to all welded areas and panel joints (Illustration E); then apply to the entire area (Illustration F).

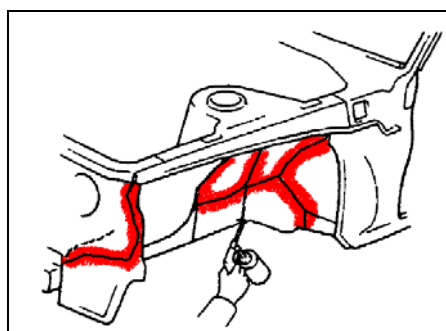


Illustration E

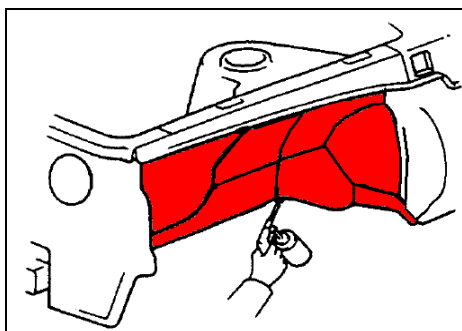


Illustration F



TS-TCI-CRIB-2032

May, 2013

ANTI-CORROSION TREATMENT

BODY FOAM:

Apply body foam to all areas where foam is missing, damaged or removed during a collision. This will restore the vehicle's sound deadening characteristics and corrosion protection.

Apply body foam to all required areas as indicated in the Repair Manual for Collision Damage for the specific Toyota/Scion model. Typical areas include:

- "A", "B" and "C" pillar (Illustration G)
- Rocker panels (Illustration G)
- Wherever foam is missing or damaged as a result of the collision or after the repair

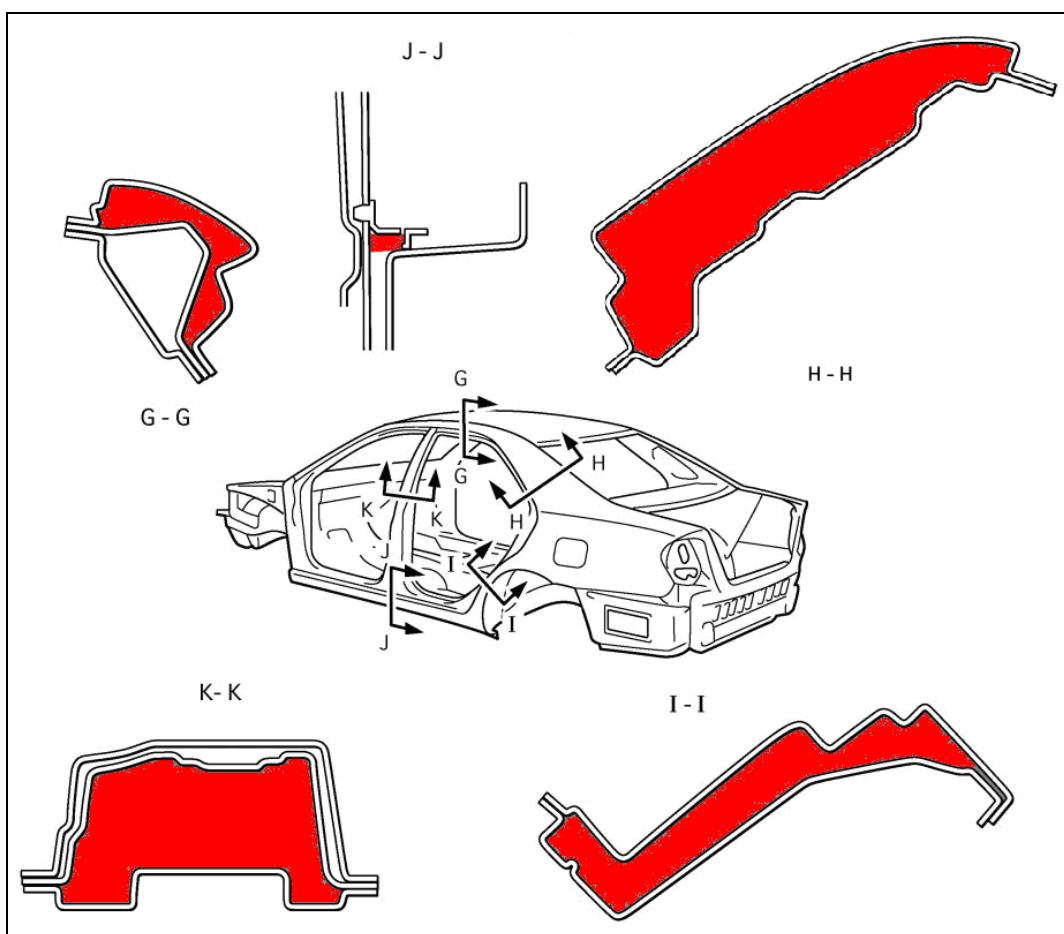


Illustration G

Always refer to the model specific Repair Manual for Collision Damage for information on the application of all anti-corrosion materials contained in the Anti-Corrosion Treatment section (AR), and throughout the Body Panel Replacement section of the publication.