


COLLISION REPAIR INFORMATION BULLETIN



SUBJECT:	QUARTER PANEL SECTIONING (CUT-P) PROCEDURE		
BULLETIN NO.:	TS-TCI-CRIB-2033	DATE ISSUED:	May, 2013
MODELS:	All Toyota & Scion Models	SECTION:	Structural

Toyota/Scion actively promotes quality repairs by providing Collision Repair Centers with updates and changes in OEM recommendations, collision repair procedures, standards and technology.

The Quarter Panel Sectioning (CUT-P) procedure, as illustrated in certain Toyota/Scion Body Collision Damage Repair Manuals, and sometimes referred to as “vertical cut” is no longer an approved repair procedure (when replacing a damaged quarter panel) for any Toyota/Scion vehicle. See illustration below.

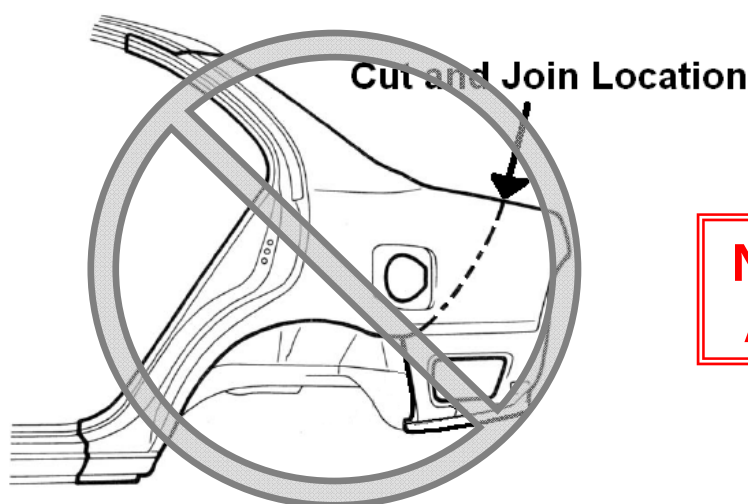

**NO LONGER
APPROVED**

This procedure may not satisfy customer expectations in terms of visible repair quality. As a result, Toyota/Scion no longer approves this CUT-P procedure for the following reasons:

- Cut and join locations from inner trunk compartment may be visible
- Body character lines are difficult to weld across and may not produce a quality appearance
- High degree of difficulty to perform an undetectable and quality repair
- Vehicle value may be reduced

NOTE: Issue of this Collision Repair Information Bulletin by Toyota Canada Inc. is to ensure that proper repair information is available. It does not constitute an authorization for repair. PLEASE ROUTE THIS BULLETIN TO YOUR COLLISION REPAIR CENTER MANAGER AND COLLISION & REFINISH TECHNICIANS.




TS-TCI-CRIB-2033

May, 2013

QUARTER PANEL SECTIONING (CUT-P) PROCEDURE

Any revised removal and installation instructions and specifications for Quarter Panel sectioning are set out in the model-specific Repair Manual for Collision Damage (Body Panel Replacement section-Quarter Panel (CUT) Procedure). The diagram below illustrates the recommended cut and join location for most Toyota/Scion models.

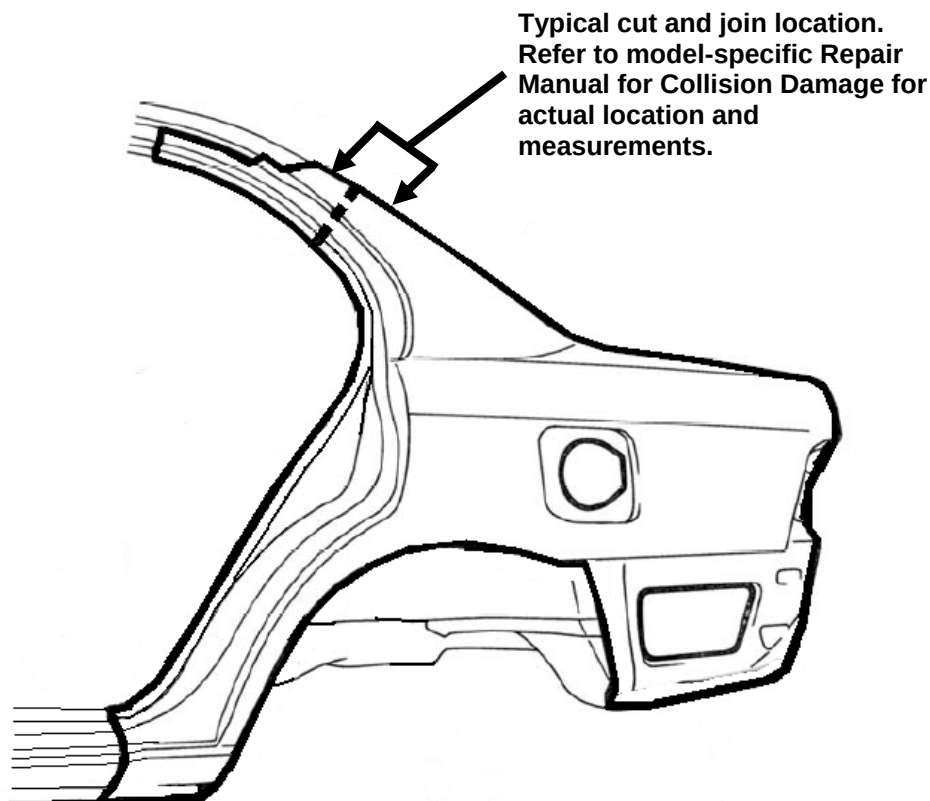

Always refer to the Toyota/Scion model-specific repair manual for the actual cut/join location measurements, welding requirements and other important information.

For Toyota or Scion Collision Centre facilities, visit the ETAS and Toyota Technical Information System (TIS) site located in the Infostream website portal at <http://infostream.toyota.ca/> to access the Repair Manuals for Collision Damage. For independently operated collision centres interested in these publications, visit www.techinfo.toyota.com for a subscription and access.