

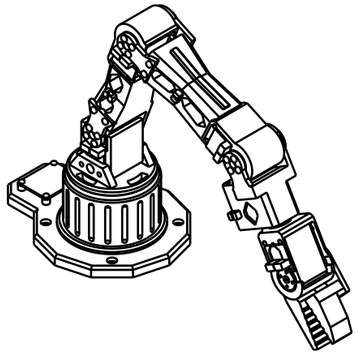


ISOMETRIC (NOT TO SCALE)

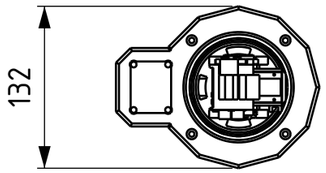

TOP

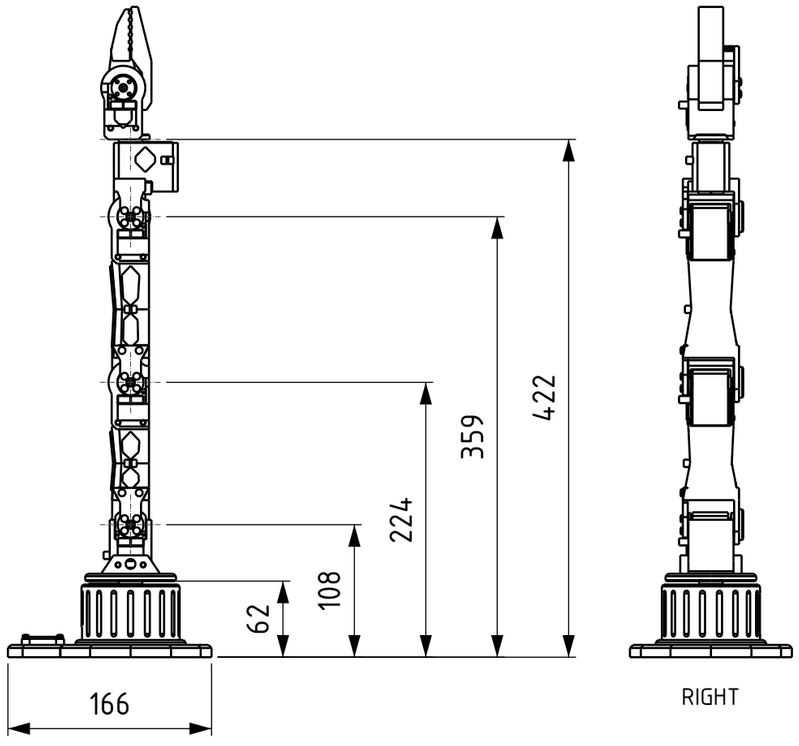

FRONT

RIGHT

PRINTED PARTS

PART NO.	NAME	QTY	SET
TAL-101	Base	1	A
TAL-102	Shoulder (turntable + cradle)	1	A
TAL-103	Upper arm	1	A
TAL-104	Forearm	1	B
TAL-105	Wrist	1	B
TAL-106	Gripper body	1	B
TAL-107	Moving jaw	1	B
TAL-108	Hub cap	3	A
TAL-110	Idler plate	2	B
TAL-111	Servo fit gauge (print first)	1	A

BOUGHT PARTS

ITEM	QTY
Feetech STS3215 servo (12 V: C018 / C047)	6
Waveshare Bus Servo Adapter (A)	1
M3 x 6 button head (output and passive horns)	36
M3 x 10 button head (idler plates)	4
M2 x 5 self-tapping (servo cases)	10
M2 x 6 self-tapping (servo cases)	12
M2.5 x 6 self-tapping (board)	4
M4 bolts to the table (user's)	4
3-pin bus servo cables (with servos)	6

JOINT LAYOUT

1. Pan axis vertical through the base centre; pan horn face 62 above the table. Plinth 132 across corners.
2. Shoulder axis (along Y) 46 above the pan horn face. Upper arm 116, forearm 135 (axis to axis). Wrist flex axis to roll horn face 63.
3. Front view: zero pose (all joints 0). Isometric: 'ready' pose.
4. Assembly, each joint: take both horns off the servo (one centre screw each; the base and wrist roll servos may keep theirs); plug a 3-pin cable into the servo; push the servo into its part along its entry path (part sheet notes); fit its M2 case screws; refit both horns through the R10.8 openings, each with its centre screw; fit the next link with 4X M3 × 6 into the output horn and 4X M3 × 6 into the passive horn.
5. Print TAL-111 first and check the servo fit before printing the arm. Each part sheet gives the print orientation; print-ready 3MF files are in cad/print.

NOTES

- All dimensions mm. Third-angle projection. Do not scale the drawing.
- Part sheets give each part in its own frame; this sheet shows where those frames sit.

THIRD ANGLE PROJECTION

REFERENCE SHEET: in work sets A and B	
PROJECT TALOS 5-axis arm	EST. MASS -
PART General assembly and parts list	SCALE 1:5
PART NO. TAL-000	UNITS / REV mm / A
QTY / ARM -	DATE 2026-11-10
MATERIAL -	SHEET 1 of 21