5.0 AHERA RE-INSPECTION SUMMARIES & RISK ASSESSMENTS

5.1 AHERA Re-Inspection

5.1.1 Re-Inspection Information & Procedures

The undersigned has completed the inspection for this (or these) building(s) and have met the requirements stated in 40 CFR 763.85 (A), (B), (C), (D), and (E), SUBPART E. The building's identification and date of inspection are mentioned throughout this section (5) of the Asbestos Management Plan.

Inspectors Signature _____
John F. Van Wazer Accreditation Number: 0915
Eric J. Havelick Accreditation Number: DR090691-02 AM
Brandon Ramer Accreditation Number: 4766
Rick Seiler Accreditation Number: 3481
Darren Trujillo Accreditation Number: 22590

The inspectors conducted a review of the construction records, including available plans and specifications, in an effort to discover any materials specified as asbestos containing. The construction chronology was researched to define areas containing like materials. Different construction areas, which contain like-appearing materials, would require separate sampling to evaluate asbestos content. Common usage room names and numbers were determined for use in this plan.

Schematic drawings were made of the building, which indicates buildings, additions or construction areas, functional spaces/rooms, homogeneous areas, salient, and sample locations. These drawings are attached to this report in Section 5.5.

Every accessible internal space in the buildings was toured and observed during inspections. The Inspectors attempted to discover and record any material suspected of containing asbestos. All suspected material discovered was tested by physical hand pressure to determine whether or not the material was friable. An assessment of the material's condition and potential for disturbance or damage was made based upon the inspector’s experience and judgment.

Inspection procedures were conducted in accordance with the requirements of the AHERA regulations to the best of the contributing inspector's abilities.

5.1.2 AHERA Re-Inspection Report Summaries

Certified Inspectors performed all inspecting and bulk sampling. The work was not delegated in any way to non-certified personnel.

All bulk samples were tested using polarized light microscopy (PLM), EPA interim method using dispersion staining, to determine the asbestos content.

5.2 Classifying The Condition Of Suspect Material

5.2.1 AHERA Category Physical Assessment

AHERA Category	Definitions
1. - - - - -	Damaged or significantly damaged friable thermal system insulation.
2. - - - - -	Damaged friable surfacing ACM.
3. - - - - -	Significantly damaged friable surfacing ACM.
4. - - - - -	Damaged or significantly damaged friable miscellaneous ACM.
5. - - - - -	ACBM with potential for damage.
6. - - - - -	ACBM with potential for significant damage.
7. - - - - -	Any remaining friable ACBM or friable suspected ACBM.

5.2.2 Suspect Asbestos-Containing Surfacing & Miscellaneous Material

Significantly Damaged

Material with one or more of the following characteristics:

The surface crumbing or blistered over at least one tenth of the area if the damage is evenly distributed, or at least one quarter if the damage is localized.

One tenth (one quarter, if localized) of material hanging from the surface, deteriorated, or showing adhesive failure.

Water stains or gouges, or mars over at least one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Damaged

Material with the following characteristics:

The surface blistered, crumbling, water stained, or gouged, marred or otherwise abraded over less than one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.3 Suspect Asbestos-Containing Thermal Insulation

Significantly Damaged

Material with one or more of the following characteristics:

Missing jackets on at least one tenth of the piping or equipment.

Crushed or heavily gouged or punctured insulation on at least one tenth of pipe runs/risers, boiler, tank, duct, etc., if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Damaged

Material with one or more of the following characteristics:

A few water stains or less than one tenth of the insulation with missing jackets.

Crushed insulation or water stains, gouges, punctures, or mars on up to one tenth of the insulation if the damage is evenly distributed (or up to one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.4 Factors Used To Determine The Potential For Disturbance

Potential For Contact With The Material: Accessible -- when referring to ACM means that the material is subject to disturbance by school or building occupants or custodial or maintenance personnel in the course of their normal activities.

High: Service workers work in the vicinity of the material more than once per week, or

The material is in a public area (e.g., hallway, corridor, auditorium) and accessible to building occupants.

Moderate: Service workers work in the vicinity of the material once per month to once per week, or

The material is in a room or office and accessible to the occupants.

Low: Service workers work in the vicinity of the material less than once per month, or

The material is visible but not within reach of building occupants.

Influence Of Vibration: Vibration -- means the periodic motion of friable ACM, which may result in the release of asbestos fibers.

High: Loud motors or engines present (e.g. some fan rooms), or

Intrusive noises or easily sensed vibrations e.g., major airports, a major highway).

Moderate: Motors or engines present, not obtrusive (e.g., ducts vibrating but no fan in the area) or

Occasional loud sounds.

Low/None None of the above.

Potential For Air Erosion: Air Erosion -- means the passage of air over friable ACBM, which may result in the release of asbestos fibers.

High: High velocity air (e.g., elevator shaft, fan room).

Moderate: Noticeable movement of air (e.g., air shaft, ventilator air stream).

Low/None: None of the above.

5.2.5 Determination Of Potential For Disturbance

High Disturbance -- ACM which ranks "high" in any one of potential for contact, Influence of vibration, or potential for air erosion.

Examples are (1) acoustical plaster on a low ceiling in a high school band room, (2) thermal system insulation on air ducts connected to ventilation fans and readily accessible to workers conducting maintenance on the ventilation system, and (3) fireproofing on structural members or metal/concrete decks in a return air plenum.


Moderate Disturbance -- ACM which ranks "moderate" in any one potential for contact, Influence of vibration, or potential for air erosion.

Examples are ACM on corridor walls, on a ceiling underneath a gymnasium, or in an elevator shaft.

Low Disturbance -- ACM which ranks "low" in all three of potential for contact, Influence of vibration, or potential for air erosion.

5.2.6 Response Action Category Determination

The following decision tree was used to determine the Response Action Category.....

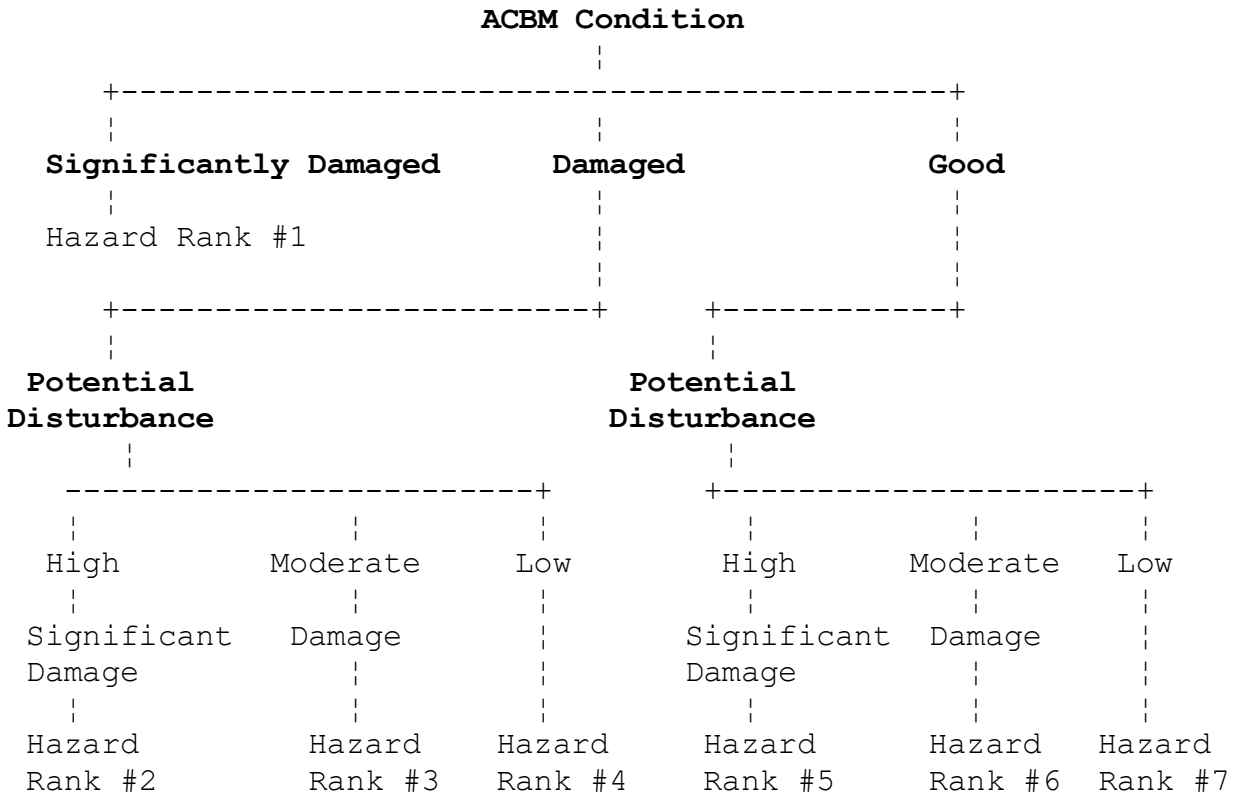

Response Actions Based On Hazard Ranking

Hazard Rank	Response Action Categories	Response Action Required By AHERA
1	Significantly Damaged	Evacuate or isolate the area if needed. Remove the ACBM (or encapsulate if sufficient to contain fibers). Repair of thermal system insulation is allowed if feasible and safe. O&M required for all friable ACBM.
2	Damaged + High Potential For Significant Damage	Evacuate or isolate the area if needed. Remove, enclose, encapsulate, or repair to correct damage. Take steps to reduce damage. Take steps to reduce potential for disturbance. O&M required for all friable ACBM.
3	Damaged + Moderate Potential For Damage	Remove, enclose, encapsulate, or repair to correct damage. O&M required for all friable ACBM.
4	Damaged	Same as Hazard Rank 3.
5	Good + High Potential For Significant Damage	Evacuate or isolate the area if needed. Take steps to reduce potential for disturbance. O&M required for all friable ACBM and TSI.
6 Moderate	Good + and TSI. Potential For Damage	O&M required for all friable ACBM

7	All Remaining	O&M required for all ACBM, but measures need not be as extensive as above.

5.3 ACBM Descriptive Log & Summary Of Areas

The areas are organized by functional space within the building. The Homogeneous Area, Hazard Assessment Rank and Response Action have been identified.

Pages 13 through 21 list the homogeneous areas in the order they appear in this report and as detailed on the blue print for this building. Also shown are the type of material, the description of the area, and the square footage of the area.

Homogeneous Area Acronyms		Autosketch File Name
ACM-	Asbestos Containing Material	Misc.
BC-	Base Cove	Misc.
CB-	Chalk Boards	Misc.
CBP-	Cinder Block Patch	Misc.
CM-	Ceiling Mastic	CT
CORK-	Cork Tile	Misc.
CT-	Ceiling Tile	CT
CTW-	Ceiling Tile Walls	Wall
CMS-	Ceiling Material Sprayed On	CT
CMU-	Concrete Masonry Unit	Misc.
CTDW-	Ceiling Tile Drywall	CT
DWB-	Decorative Wall Board	Wall
DWC-	Drywall Ceiling	CT
DWW-	Drywall Wall	Wall
DWWC-	Drywall Wall & Ceiling	Wall
FB-	Gasket Material	Misc.
FD-	Fire Doors	Misc.
FT-	Floor Tile	FT
FTM-	Floor Tile Mastic	FT
GVW-	Gray Vinyl Window Replacement	Misc.
LN-	Linoleum	FT
PC-	Plaster Ceiling	CT
PW-	Plaster Wall	Wall
PWC-	Plaster Wall & Ceiling	Wall
STM-	Stair Tread Mastic	Misc.
TM-	Transite Material	Misc.
TSI-	Thermal System Insulation	Misc.

VD-	Vibration Dampener	Misc.
WES-	White End Sealant	Misc.
WP-	Window Putty	Misc.

Changes In Homogeneous Area Titles From 1988 Report:

Homogeneous Area TM-1 was Homogeneous Area ACM-1.

Changes In Homogeneous Area Titles From 1990 Report:

Homogeneous Area CT-1 was ATC Homogeneous Area 1.
Homogeneous Area CT-6 was ATC Homogeneous Area 6.
Homogeneous Area PC-3 was ATC Homogeneous Area 3.
Homogeneous Area DWB-7 was ATC Homogeneous Area 7.
Homogeneous Area CT-2 was ATC Homogeneous Area 2.
Homogeneous Area CT-4 was ATC Homogeneous Area 4.
Homogeneous Area DWWC-5 was ATC Homogeneous Area 5.

Changes In Homogeneous Area Titles From 1991 Report:

Homogeneous Area FT-5 - Corridor Floor Tile.
Homogeneous Area VES-1 - Vestibule Soffit.

Changes In Homogeneous Area Tiles From ATC 1994 Report:

Homogeneous Area TSI-2 was incorporated into TSI-1.
Homogeneous Area FT-7 was created.
Homogeneous Area FT-8 was created.
Homogeneous Area CT-8 was created.
Homogeneous Area DWW-9 was created.
Homogeneous Area FD-2 was created.

Changes In Homogeneous Area Tiles From ATC 1996 Report:

Homogeneous Area FT-4 has been changed to FT-04.
Homogeneous Areas FT-01 through FT-03 and FT-05 through FT-16 has been created.
Homogeneous Areas BC-01 through BC-03 has been created.
Homogeneous Area WP-01 has been created.
Homogeneous Area TM-1 has been replaced by ACM-01.
Homogeneous Area VD-01 has been created.
Homogeneous Area DWW-01 has been created.
Homogeneous Areas TSI-01 and TSI-02 has been created.
Homogeneous Area CT-01 has been created.

Changes In Homogeneous Area Tiles From ATC 1998 Report:

FB-1 has been created. (White Gasket Material)

Changes In Homogeneous Area Tiles From 2005 Update:

Homogeneous Area FT-12 incorporated into FT-07.
Homogeneous Area FT-15 incorporated into FT-02.
Homogeneous Area FT-14 incorporated into FT-3.
Homogeneous Area FT-16 incorporated into FT-1.
Homogeneous Area FT-5 incorporated into FT-01.
Homogeneous Area TSI-01 incorporated into TSI-1.
Homogeneous Area TM-1 incorporated into ACM-01.
Homogeneous Area FT-03 incorporated into FT-11.

Changes In Homogeneous Area Tiles From 2008 Update:

Homogeneous Area CMU-1 has been created. (Concrete Masonry Unit)
Homogeneous Area WES-1 has been created. (White End Sealant)

Changes In Homogeneous Area Tiles From 2009 Update:

Homogeneous Area CTM-1 has been created. (Brown Ceiling Tile Mastic)

According to the ATC Report, Project Surveillance & Air Monitoring, dated June 1991, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile (Mastic Remains)	Gymnasium	3,675 Square Feet

According to the ATC Report, Project Surveillance & Air Monitoring, dated June 1998, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Boiler Seam Caulk	Boiler Room	600 Linear Feet
Floor Tile & Mastic	Southwest Foyer	40 Square Feet
Vibration Dampener	Stage	30 Linear Feet
Rope Gasket	Boiler Room Chimney	8 Linear Feet

According to the Higgins & Assoc Report, Project Surveillance & Air Monitoring, Dated June 2004, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Carpet, Floor Tile & Mastic	Media Center And Classrooms #1,3,5,7,9	5,250 Square Feet

According to the Higgins & Assoc Report, Project Surveillance & Air Monitoring, Dated October 2005, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Carpet, Floor Tile & Mastic	Stage & Teacher's Lounge	1,437 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated June 2014, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Carpet Over Encapsulated Black Mastic	Gymnasium & PE Office	3,923 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated June 2015, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity

Carpet Over Carpet Over Floor Tile/Mastic	Front Main Corridor & Custodial Storeroom	1,958 Square Feet
12" x 12" Floor Tile/Mastic	North/South Classroom Corridor	2,006 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated June 2017, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Carpet Over Carpet Over Floor Tile/Mastic	Main office and principals	470 Square Feet
CMU	Nurses North wall	28 Square Feet
12" x 12" Floor Tile/Mastic	Nurses office, work room, bathroom	473 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated June 2022, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile/Mastic	Kitchen	810 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated June 2026, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile/Mastic	ALL REMAINING FLOORS	6,444 Square Feet

The Homogeneous Areas Are In Consecutive Order As In The Following Report.

FT-01 **(LOCATED ON PAGE 22)**
HOMOGENEOUS AREA - TAN 12" X 12" MOTTLED FLOOR TILE W/TAN ADHESIVE
CORRIDORS & STORAGE ROOM
1,958 SQUARE FEET
TESTED-POSITIVE
(12" X 12" FLOOR TILE/MASTIC – NORTH/SOUTH CLASSROOM CORRIDOR & CUSTODIAL STOREROOM - ABATED SUMMER 2015)

FT-1 **(LOCATED ON PAGE 25)**
HOMOGENEOUS AREA – TAN 9" X 9" FLOOR TILE W/BLACK MASTIC
NURSE OFFICE & OFFICE STOREROOM
460 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - OFFICES - ABATED SUMMER 2005)

FT-02 **(LOCATED ON PAGE 28)**
HOMOGENEOUS AREA - GRAY FLOOR TILE W/BLACK MASTIC & CARPET W/TAN ADHESIVE
CLASSROOM #17, LOUNGE & STAGE
2,430 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - LOUNGE & STAGE - ABATED SUMMER 2005)

FT-2 **(LOCATED ON PAGE 31)**
HOMOGENEOUS AREA – FLOOR TILE COVERED BY CARPET
ADMINISTRATIVE AREA
520 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC – Admin area - ABATED SUMMER 2005)

FT-3 **(LOCATED ON PAGE 33)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
KITCHEN
550 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - Kitchen - ABATED SUMMER 2022)

FT-04 **(LOCATED ON PAGE 36)**

HOMOGENEOUS AREA – PINK 9” X 9” FLOOR TILE
W/STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOMS #15
660 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC – Classroom 15 - ABATED SUMMER 2026)

FT-05 **(LOCATED ON PAGE 38)**
HOMOGENEOUS AREA - ORANGE 9” X 9” FLOOR TILE
W/STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOMS #1, #4 & #18
1,320 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - CLASSROOM #1 – ABATED SUMMER 2004)

FT-06 **(LOCATED ON PAGE 40)**
HOMOGENEOUS AREA - BEIGE 9” X 9” FLOOR TILE
W/YELLOW & PINK STREAKS W/BLACK MASTIC (UNDER CARPET)
CLASSROOM #13
850 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC – Classroom 13 - ABATED SUMMER 2026)

FT-6 **(LOCATED ON PAGE 42)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET
CORRIDORS
2,006 SQUARE FEET
ASSUMED-ACM
(CARPET OVER CARPET OVER FLOOR TILE/MASTIC – FRONT MAIN CORRIDOR – ABATED SUMMER 2015)

FT-07 **(LOCATED ON PAGE 44)**
HOMOGENEOUS AREA - OLIVE 9” x 9” FLOOR TILE
W/BLACK MASTIC (UNDER CARPET)
CLASSROOMS #2, #3, #7, #8, #14 & #19
3,960 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - CLASSROOMS #3 & #7 - ABATED 2004)

FT-7 **(LOCATED ON PAGE 46)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
GYMNASIUM
3,675 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE - ABATED 1991) (ENCAPSULATED BLACK FLOOR TILE MASTIC ABATED SUMMER 2014)

FTM-7 **(LOCATED ON PAGE 49)**
HOMOGENEOUS AREA – BLACK FLOOR TILE MASTIC (UNDER CARPET)
GYMNASIUM
3,675 SQUARE FEET
TESTED-POSITIVE
(ENCAPSULATED BLACK FLOOR TILE MASTIC ABATED SUMMER 2014)

FT-08 **(LOCATED ON PAGE 52)**
HOMOGENEOUS AREA - WHITE 9" X 9" FLOOR TILE
W/BLACK MASTIC (UNDER CARPET)
MEDIA CENTER
1,200 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-8 **(LOCATED ON PAGE 54)**
HOMOGENEOUS AREA - CARPET OVER CONCRETE
MODULAR UNIT & ALL PURPOSE ROOM
4,250 SQUARE FEET
NOT A SUSPECT MATERIAL

FT-09 **(LOCATED ON PAGE 56)**
HOMOGENEOUS AREA - TAN 9" X 9" FLOOR TILE
W/BROWN STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOMS #5, #6, & #10
2,320 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - CLASSROOM #5 – ABATED SUMMER 2004)

FT-9 **(LOCATED ON PAGE 59)**

HOMOGENEOUS AREA – 12” X 12” FLOOR TILE W/MASTIC
OFFICE RESTROOM
20 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC – Restroom - ABATED SUMMER 2026)

FT-10 **(LOCATED ON PAGE 61)**
HOMOGENEOUS AREA – 9” X 9” GREEN FLOOR TILE
W/STREAKS (UNDER CARPET)
CLASSROOM #9
660 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-11 **(LOCATED ON PAGE 63)**
HOMOGENEOUS AREA - WHITE 9” x 9” FLOOR TILE
W/GREEN STREAKS & BLACK MASTIC
CLASSROOM CLOSETS
200 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - CLASSROOMS #1, 3, 5, 7, 9, & STAGE ABATED SUMMER 2004)

FT-13 **(LOCATED ON PAGE 67)**
HOMOGENEOUS AREA - TAN, BEIGE 12” x 12” FLOOR TILE
MOTTLED W/TAN ADHESIVE
KITCHEN
REPLACEMENT FLOOR TILE
TESTED-NEGATIVE (BLACK MASTIC POSITIVE)

TSI-1 **(LOCATED ON PAGE 70)**
HOMOGENEOUS AREA - THERMAL INSULATION MATERIAL ON PIPE FITTING
BOILER ROOM
96 FITTINGS
TESTED-NEGATIVE

TSI-02 **(LOCATED ON PAGE 75)**
HOMOGENEOUS AREA - TSI POWDERY FITTING, LARGE DIAMETER
BOILER ROOM
QUANITY UNKNOWN
TESTED-NEGATIVE

WES-1 **(LOCATED ON PAGE 78)**
HOMOGENEOUS AREA – WHITE END SEALANT ON PIPING
THROUGHOUT BUILDING
QUANITY UNKNOWN
TESTED-NEGATIVE

CT-01 **(LOCATED ON PAGE 81)**
HOMOGENEOUS AREA - WHITE 2’ x 4’ CEILING PANEL
W/CROSS FISSURES & RANDOM PERFORATION
MODULAR UNIT
450 SQUARE FEET
TESTED-NEGATIVE

CT-1 **(LOCATED ON PAGE 84)**
HOMOGENEOUS AREA - 2.5' x 4' CEILING PANEL (TECTUM)
CLASSROOMS & GYMNASIUM
23,050 SQUARE FEET
TESTED-NEGATIVE

CT-2 **(LOCATED ON PAGE 88)**
HOMOGENEOUS AREA - 2' x 4' RANDOM PERFORATED CEILING TILE
OFFICE AREA & HALLWAYS
4,889 SQUARE FEET
TESTED-NEGATIVE

CT-4 **(LOCATED ON PAGE 92)**
HOMOGENEOUS AREA - 12" x 12" PERFORATED CEILING TILE
STAGE
700 SQUARE FEET
TESTED-NEGATIVE
(CEILING REMOVED 2012 & REPLACED WITH #915 TEXTURED FIREGUARD 2’ X 4’ CEILING TILE)

CT-6 **(LOCATED ON PAGE 96)**
HOMOGENEOUS AREA - 2' x 4' DOT MATRIX CEILING TILE
HALLWAY CEILING
15 SQUARE FEET
TESTED-NEGATIVE

CT-8 **(LOCATED ON PAGE 99)**
HOMGENEOUS AREA - 2' X 4' RANDOM PERFORATED CEILING TILE
MODULAR UNIT
3,250 SQUARE FEET
TESTED-NEGATIVE

CTM-1 **(LOCATED ON PAGE 103)**
HOMOGENEOUS AREA - BROWN CEILING TILE MASTIC
STAGE
75 SQUARE FEET
TESTED-NEGATIVE
(CEILING REMOVED 2012 & REPLACED WITH #915 TEXTURED FIREGUARD 2′ X 4′ CEILING TILE)

PC-3 **(LOCATED ON PAGE 106)**
HOMOGENEOUS AREA - PLASTER CEILING
KITCHEN & RESTROOMS
1,510 SQUARE FEET
TESTED-NEGATIVE

DWW-01 **(LOCATED ON PAGE 110)**
HOMOGENEOUS AREA – DRYWALL WALL W/JOINT COMPOUND
SOUTH MODULAR BUILDING
820 SQUARE FEET
TESTED-NEGATIVE

DWWC-5 **(LOCATED ON PAGE 114)**
HOMOGENEOUS AREA - DRYWALL WALL & CEILING W/JOINT COMPOUND
STAGE, P.E.OFFICE & ADMINISTRATIVE AREA
1,700 SQUARE FEET
TESTED-NEGATIVE

DWB-7 **(LOCATED ON PAGE 118)**
HOMOGENEOUS AREA - DECORATIVE WALL BOARD (WOOD)
LOUNGE WALL
280 SQUARE FEET
TESTED-NEGATIVE

DWW-9 **(LOCATED ON PAGE 121)**
HOMOGENEOUS AREA - DRYWALL WALL W/VINYL COVERING
SOUTH MODULAR UNIT
2,600 SQUARE FEET
TESTED-NEGATIVE

VES-1 **(LOCATED ON PAGE 125)**
HOMOGENEOUS AREA - SOFFIT
SOUTHEAST VESTIBULE
64 SQUARE FEET
TESTED-NEGATIVE (REMOVED)

CB-1 **(LOCATED ON PAGE 127)**
HOMOGENEOUS AREA - CHALKBOARDS
CLASSROOMS
2,560 SQUARE FEET
(**NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)**
(NO MASTIC BEHIND CHALKBOARDS)

WP-01 **(LOCATED ON PAGE 129)**
HOMOGENEOUS AREA - GRAY WINDOW GLAZING
WINDOWS
WHERE PRESENT AROUND WINDOWS
TESTED-POSITIVE

WP-1 **(LOCATED ON PAGE 132)**
HOMOGENEOUS AREA - WINDOW PUTTY
CLASSROOMS
500 SQUARE FEET
TESTED-TRACE

BC-01 **(LOCATED ON PAGE 135)**
HOMOGENEOUS AREA - BLACK COVE BASE W/BROWN ADHESIVE
CLASSROOMS
WHERE PRESENT AROUND CLASSROOMS
TESTED-NEGATIVE

BC-1 **(LOCATED ON PAGE 138)**
HOMOGENEOUS AREA – COVE BASE W/MASTIC
THROUGHOUT BUILDING
1,500 SQUARE FEET
TESTED-TRACE

BC-02 **(LOCATED ON PAGE 141)**
HOMOGENEOUS AREA - BLACK COVE BASE W/TAN ADHESIVE
CLASSROOMS
WHERE PRESENT AROUND CLASSROOMS
TESTED-POSITIVE

BC-03 **(LOCATED ON PAGE 143)**
HOMOGENEOUS AREA - BROWN COVE BASE W/BROWN ADHESIVE
MODULAR UNIT
360 SQUARE FEET
TESTED-NEGATIVE

FD-1 **(LOCATED ON PAGE 146)**
HOMOGENEOUS AREA - MATERIAL WITH-IN FIRE RATED DOOR
BOILER ROOM
1 DOOR
DOOR - REMOVED 1988

FD-2 **(LOCATED ON PAGE 148)**
HOMOGENEOUS AREA - EXTERIOR FIRE DOORS
THROUGHOUT BUILDING
10 DOORS
NO SUSPECT MATERIAL WITH-IN DOORS

VD-01 **(LOCATED ON PAGE 150)**
HOMOGENEOUS AREA - WHITE CLOTH VIBRATION DAMPENER
STAGE
1 DAMPENER
TESTED-POSITIVE
(VIBRATION DAMPENER ABATED 1998)

ACM-01 **(LOCATED ON PAGE 153)**
HOMOGENEOUS AREA - TRANSITE PANEL HEAT SHEILD
ELECTRICAL ROOM
28 SQUARE FEET
TESTED-POSITIVE
(TRANSITE PANEL ABATED 1998)

FB-1 **(LOCATED ON PAGE 155)**
HOMOGENEOUS AREA - WHITE GASKET MATERIAL
BOILER ROOM
QUANITY UNKNOWN
TESTED-POSITIVE
(GASKET ABATED 1998)

CMU-1 **(LOCATED ON PAGE 157)**
HOMOGENEOUS AREA – CONCRETE MASONRY UNIT
THROUGHOUT BUILDING
150,000 SQUARE FEET
TESTED-POSITIVE

Harris Park Elementary

Homogeneous Area ID: FT-01

(12″ X 12″ FLOOR TILE/MASTIC – NORTH/SOUTH CLASSROOM CORRIDOR & CUSTODIAL STOREROOM - ABATED SUMMER 2015)

Description:	Tan 12″ x 12″ Mottled Floor Tile W/Tan Adhesive
Functional Space:	Corridors & Storage Room
Date Inspected:	03-18-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	10.A
Blueprint Location:	Maintenance Records Office

---- Physical Assessment ----------

Size:	1,958 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-01-01**
Location:	Northwest Vestibule Outside, Classroom #18
Date Sampled:	04-22-1996
Asbestos Content:	**5.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-02**
Location:	Corridor Kitchen Entry (Mastic Only)
Date Sampled:	04-22-1996
Asbestos Content:	**20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-03**
Location:	Entry, Storage North Of Lounge
Date Sampled:	04-22-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,958 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(12″ x 12″ Floor Tile/Mastic – North/South Classroom Corridor & Custodial Storeroom - Abated Summer 2015)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-1

Description: Tan 9” x 9” Floor Tile W/Black Mastic
Functional Space: Nurse Office & Office Storeroom
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 460 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-16-01**
Location:	South Nurse's Office
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)**
	15.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-16-02**
Location:	Nurse's Office
	East Side
Date Sampled:	04-22-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	460 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/year:	900
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-02

(FLOOR TILE/MASTIC - LOUNGE & STAGE - ABATED SUMMER 2005)

Description: Gray Floor Tile W/Black Mastic & Carpet W/Tan Adhesive
Functional Space: Classroom #17, Lounge, & Stage
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 2,430 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996
1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-02-01**
Location:	East Center Classroom #17
Date Sampled:	04-22-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-15-01**
Location:	Northeast Corner Platform Storage
Date Sampled:	04-22-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	2,430 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Lounge & Stage - Abated Summer 2005)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-2

Description: Floor Tile Covered By Carpet
Functional Space: Administrative Area
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 520 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	520 Square Feet
Average People/Hr:	3
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	200
Person-Hours/Year:	4,800
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-3

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Kitchen
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 550 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-14-01**
Location:	Kitchen, Southwest Center
Date Sampled:	04-22-1996
Asbestos Content:	**3.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-14-02**
Location:	Center, Kitchen Storage
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total – Mastic Only
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	550 Square Feet
Average People/Hr:	60
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	64,800
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-04

Description: Pink 9” x 9” Floor Tile W/Streaks & Black Mastic (Under Carpet)
Functional Space: Classroom #15
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 660 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-04-01**
Location:	Classroom #15 Southwest Corner
Date Sampled:	04-22-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	660 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-05

(FLOOR TILE/MASTIC - CLASSROOM #1 – ABATED SUMMER 2004)

Description: Orange 9” x 9” Floor Tile W/Streaks & Black Mastic (Under Carpet)
Functional Space: Classrooms #1, #4, & #18
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 1,320 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-05-01**
Location:	Classroom #15 Southwest Corner
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	1,320 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Classroom #1 - Abated Summer 2004)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-06

Description: Beige 9” x 9” Floor Tile, W/Yellow & Pink Streaks W/Black Mastic (Under Carpet)
Functional Space: Classroom #13
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 850 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-06-01**
Location:	Closet, Classroom #15
Date Sampled:	04-22-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	850 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-6

(CARPET OVER CARPET OVER FLOOR TILE/MASTIC – FRONT MAIN CORRIDOR – ABATED SUMMER 2015)

Description: Floor Tile Covered By Carpet
Functional Space: Corridors
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 2,006 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	2,006 Square Feet
Average People/Hr:	300
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	324,000
Preventive Measures:	**None Required**

(Carpet Over Carpet Over Floor Tile/Mastic – Front Main Corridor Abated Summer 2015)

----- Recommended Response Action ----------
-

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-07

(FLOOR TILE/MASTIC - CLASSROOMS #3 & #7 - ABATED SUMMER 2004)

Description: Olive 9” x 9” Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Classrooms #2,#3,#7,#8,#14, & #19
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A.
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 3,960 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-12-01**
Location:	Closet, Classroom #3
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	3,960 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Classrooms #3 & #7 - Abated Summer 2004)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-7

(FLOOR TILE - ABATED SUMMER 1991)
(ENCAPSULATED MASTIC – ABATED SUMMER 2014)

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Gymnasium
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 3,675 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 01-10-1991

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-1-1**
Location:	Southeast Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**7.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-2**
Location:	Northwest Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**7.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-1**
Location:	Southeast Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**7.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank	N/A
Quantity:	3,675 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(Floor Tile - Abated Summer 1991)
(Encapsulated Mastic – Abated Summer 2014)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FTM-7

(ENCAPSULATED MASTIC - ABATED SUMMER 2014)

Description: Black Floor Tile Mastic (Under Carpet)
Functional Space: Gymnasium
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 3,675 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 01-10-1991

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-1-1**
Location:	Southeast Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**20.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-2**
Location:	Northwest Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**20.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-1**
Location:	Southeast Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**20.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-2**
Location:	Northwest Corner Gymnasium
Date Sampled:	01-10-1991
Asbestos Content:	**20.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-10-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	3,675 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(Encapsulated Mastic Under Carpet – Abated Summer 2014)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-08

(FLOOR TILE/MASTIC – ABATED SUMMER 2004)

Description: White 9” x 9” Floor Tile
W/Black Mastic (Under Carpet)
Functional Space: Media Center
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 1,200 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-08-01**
Location:	Northwest Center Media Center
Date Sampled:	04-22-1996
Asbestos Content:	**20.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,200 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated Summer 2004)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-8

(NOT A SUSPECT MATERIAL)

Description: Carpet Over Concrete
Functional Space: Modular Unit & All Purpose Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 4,250 Square Feet
Assumed ACM: No Condition: Good
Results Of Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: No
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	4,250 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(Carpet – Modular's - Installed 1989)
(Carpet - All Purpose Room - Installed 2005)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-09

(FLOOR TILE/MASTIC - CLASSROOM #5 – ABATED SUMMER 2004)

Description: Tan 9” x 9” Floor Tile W/Brown Streaks & Black Mastic (Under Carpet)
Functional Space: Classrooms #5, #6, & #10
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	2,320 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-09-01**
Location:	Closet, Classroom #9
Date Sampled:	04-22-1996
Asbestos Content:	**10.0% Total (Floor Tile)**
	20.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-09-02**
Location:	Closet, Classroom #10
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)**
	15.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-09-03**
Location:	Closet, Classroom #5
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)**
	20.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	2,320 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Classroom #5 - Abated Summer 2004)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-9

Description: 12” x 12” Floor Tile W/Mastic
Functional Space: Office Restroom
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 20 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	20 Square Feet
Average People/Hr:	1
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	200
Person-Hours/Year:	160
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-10

(FLOOR TILE/MASTIC – ABATED SUMMER 2004)

Description: 9” X 9” Green Floor Tile W/Streaks (Under Carpet)
Functional Space: Classroom #9
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 660 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-10-01**
Location:	Closet, Classroom #9
Date Sampled:	04-22-1996
Asbestos Content:	**5.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	660 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated Summer 2004)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-11

(FLOOR TILE/MASTIC - CLASSROOMS #1,3,5,7,9, & STAGE - ABATED 2004)

Description: White 9” x 9” Floor Tile W/Green Streaks
W/Green Streaks & Black Mastic
Functional Space: Classroom Closets
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 200 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996
3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-11-01**
Location:	Closet, Classroom #7
Date Sampled:	04-22-1996
Asbestos Content:	**8.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-11-02**
Location:	Closet, Classroom #3
Date Sampled:	04-22-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS accred Lab:	102031

Sample Number:	**FT-03-01**
Location:	Closet, Classroom #18
Date Sampled:	04-22-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-02**
Location:	Closet, Classroom #14
Date Sampled:	04-22-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-03**
Location:	Closet, Classroom
Date Sampled:	04-22-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	200 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Classrooms #1,3,5,7,9, & Stage - Abated 2004)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-13

(BLACK MASTIC POSITIVE)

Description: Tan, Beige 12” x 12” Floor Tile
Mottled W/Tan Adhesive (Replacement Tile)
Functional Space: Kitchen
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	Replacement Floor Tile
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-13-01**
Location:	Center, Kitchen Area
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-13-02**
Location:	South Vestibule Outside, Lounge
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	Replacement Floor Tile
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance (Replacement Floor Tile - Mastic Positive)**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: TSI-1

Description: Thermal Insulation Material
Pipe Fittings
Functional Space: Boiler Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 96 Fittings
Assumed ACM: No Condition: Damaged
Results From Sampled ACM: Negative
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: <5%
Accessible: High
Potential For Contact: High
Influence Of Vibration: High
Potential For Air Erosion: High
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 09-23-1988
6 Samples Taken --- ATC Report Dated: 10-26-1992
3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**-1**
Location:	South End, Boiler
Date Sampled:	08-22-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-23-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

Sample Number	**10-26-01**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-04**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-05**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5247-065

Sample Number:	**10-26-06**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-02**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-03**
Location:	Boiler Room
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**TSI-01-01**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-01-02**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-01-03**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	96 Fittings
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	1
Average Days/Year:	200
Person-Hours/Year:	200
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-02

Description: TSI Powdery Fitting Large Diameter
Functional Space: Boiler Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	Quantity Unknown
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	High
Potential For Air Erosion:	High
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TSI-02-01**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-02-02**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-02-03**
Location:	Boiler Room
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: WES-1

Description: White End Sealant On Piping
Functional Space: Throughout Building
Date Inspected: 9-25-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 11-10-2009

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-09-B008**
Location:	Boiler Room North End
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B009**
Location:	Boiler Room Center
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B010**
Location:	Boiler Room South End
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-01

Description: White 2’ x 4’ Ceiling Panel W/Cross Fissures & Random Perforation
Functional Space: Modular Unit
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 450 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: Impact: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N\A

Hazard Rank: N\A

**** Bulk Sample Information ****

Sample Number:	**CT-01-01**
Location:	Center, North Room North Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-01-02**
Location:	Along West Wall, North Room North Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-01-03**
Location:	Center, North Room South Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N\A
Quantity:	450 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-1

Description: 2.5' x 4' Ceiling Panel (Tectum)
Functional Space: Classrooms & Gymnasium
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 23,050 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-1-1**
Location:	Northeast Corner Ceiling Classroom #14
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-2**
Location:	Southwest Corner Ceiling Classroom #13
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-3**
Location:	Northwest Corner Ceiling Classroom #19
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-4**
Location:	Southwest Corner Ceiling Classroom #9
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-5**
Location:	Northeast Corner Ceiling Classroom #6
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-1-6**
Location:	Southwest Corner Ceiling Classroom #3
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209

EPA/NBS Accred Lab: 1081-01

Sample Number: **HP-1-7**
Location: Northwest Corner Ceiling
Classroom #5
Date Sampled: 04-24-1990
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-24-1990

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 2600 West 29th Ave.
Denver, CO 80211
Telephone: (303)-480-0209
EPA/NBS Accred Lab: 1081-01

----- Risk Assessment -----

Hazard Rank: N/A
Quantity: 23,050 Square Feet
Average People/Hr: 200
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 216,000
Preventive Measures: **None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-2

Description: 2' x 4' Random Perforated Ceiling Tile
Functional Space: Office Area & Hallways
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 4,889 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**HP-2-1**
Location:	South End, Main Hallway Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-2**
Location:	South Central Portion Main Hallway Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-3**
Location:	North End, Main Hallway Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-4**
Location:	Hallway Ceiling Entrance, Classroom #10
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-5**
Location:	Hallway Ceiling Entrance, Boy's Restroom
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	4,889 Square Feet
Average People/Hr:	200
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	216,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-4

(12″ x 12″ CEILING TILE REMOVED 2012 & REPLACED WITH #915 TEXTURED FIREGUARD 2′ x 4′ CEILING TILE)

Description: 12" x 12" Perforated Ceiling Tile
Functional Space: Stage
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 700 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**HP-4-1**
Location:	Stage, Northwest Corner, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-4-2**
Location:	Stage, West Central Portion, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-4-3**
Location:	Stage, Center
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-4-4**
Location:	Stage, East Central Portion, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-4-5**
Location:	Stage, Center East Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	700 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(12″ x 12″ Ceiling Tile Removed In 2012 & Replaced With #915 Textured Fireguard 2′ x 4′ Ceiling Tile)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-6

Description: 2' x 4' Dot Matrix Ceiling Tile
Functional Space: Hallway Ceiling
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 15 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 04-25-1990
1 Sample Taken --- Reservoirs Report Dated: 09-19-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-6-1**
Location:	South End, South Hallway Entrance, Below Exit Sign
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-6-2**
Location:	Hallway Ceiling Entrance, Classroom #10
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-13-B010**
Location:	Corridor Outside Classroom #13
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	15 Square Feet
Average People/Hr:	200
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	216,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-8

Description: 2' X 4' Random Perforated Ceiling Tile
Functional Space: Modular Unit
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 3,250 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 04-25-1990
3 Samples Taken --- Reservoirs Report Dated: 09-19-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-2-6**
Location:	West Annex, Northwest Corner, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-2-7**
Location:	East Annex, Northwest Corner, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-13-B001**
Location:	Classroom 23A Center of Room
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-13-B002**
Location:	Classroom 23 Center of Room
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-13-B003**
Location:	Classroom 21A Southeast Corner
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	3,250 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CTM-1

(12″ x 12″ CEILING TILE REMOVED IN 2012 & REPLACED WITH #915 TEXTURED FIREGUARD 2′ x 4′ CEILING TILE)

Description: Brown Ceiling Tile Mastic
Functional Space: Stage
Date Inspected: 11-03-2009
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	75 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- Reservoirs Report Dated: 11-10-2009

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-09-B011**
Location:	Stage, Center
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B012**
Location:	Stage, West End
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B013**
Location:	Stage, Northwest Corner
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	75 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(12″ x 12″ Ceiling Tile Removed In 2012 & Replaced With 2′ X 4′ Fissured Ceiling Tile Drop Ceiling)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: PC-3

Description: Plaster Ceiling
Functional Space: Kitchen & Restrooms
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 1,510 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**HP-3-1**
Location:	West Central Ceiling Kitchen
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-3-2**
Location:	North Boy's Restroom Northwest Corner, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-3-3**
Location:	South Boy's Restroom Southeast Corner, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-3-4**
Location:	South Restroom, Office Area Ceiling Above Entrance
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-3-5**
Location:	South Girl's Restroom Center, Ceiling
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,510 Square Feet
Average People/Hr:	20
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	21,600
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWW-01

Description: Drywall Wall W/Joint Compound
Functional Space: South Modular Building
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 820 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996
1 Sample Taken --- ATC Report Dated: 01-1999
2 Samples Taken --- Reservoirs Report Dated: 09-19-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**DWW-01-01**
Location:	North Center Wall South Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**DWW-01-02**
Location:	Center Wall, South Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**DWW-01-03**
Location:	Storage Room South Modular Building
Date Sampled:	01-19-1999
Asbestos Content:	0.0% Total Drywall 0.0% Total Joint Compound
Asbestos Type:	None
Analysis Date:	01-21-1999
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	6746 S. Revere Parkway, Suite 180 Englewood, Colorado 80112
Telephone:	(303)-799-6100

EPA/NBS Accred Lab: 102031

Sample Number:	**10-13-B004**
Location:	Classroom #23 North Office
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total (Drywall) 0.0% Total (Joint Compound)
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-13-B005**
Location:	Classroom #23A Southwest Corner
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total (Drywall) 0.0% Total (Joint Compound)
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	820 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWWC-5

Description: Drywall Wall & Ceiling W/Joint Compound
Functional Space: Stage, PE Office, & Administrative Area
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 1,700 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-5-1**
Location:	South Boy's Restroom Closet Walls
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-5-2**
Location:	Storage Closet, Gym South Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-5-3**
Location:	Storage Closet, Gym East Side, South Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-5-6**
Location:	Stage, Center Ceiling Above Ceiling Tile
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-5-7**
Location:	Stage, East Central Ceiling, Above Ceiling Tile
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,700 Square Feet
Average People/Hr:	60
Population:	Students
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	86,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWB-7

Description: Decorative Wall Board (Wood)
Functional Space: Lounge Wall
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 280 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**HP-7-1**
Location:	Teacher's Lounge, Southwest Corner, West Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-7-2**
Location:	Teacher's Lounge, Northwest Corner, West Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-7-3**
Location:	Teacher's Lounge, Center South Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	280 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWW-9

Description: Drywall Wall W/Vinyl Covering
Functional Space: South Modular Unit
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 2,600 Square Feet
Assumed ACM: No Condition: Good
Results From Sample ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 04-25-1990
3 Samples Taken --- Reservoirs Report Dated: 09-19-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**HP-5-4**
Location:	East Annex, Center North Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**HP-5-5**
Location:	East Annex, South Central Portion, East Wall
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80221
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-13-B006**
Location:	Classroom 23A North Wall, Center
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total (Vinyl) 0.0% Total (Drywall)
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986

EPA/NBS Accred Lab: 101533-480

Sample Number: **10-13-B007**
Location: Classroom 23
Center Storeroom, South Wall
Date Sampled: 08-05-2013
Asbestos Content: 0.0% Total (Vinyl)
0.0% Total (Drywall)
Asbestos Type: None
Analysis Date: 09-19-2013

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan St. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **10-13-B008**
Location: Classroom 23A
East Wall, South End
Date Sampled: 08-05-2013
Asbestos Content: 0.0% Total (Vinyl)
0.0% Total (Drywall)
Asbestos Type: None
Analysis Date: 09-19-2013

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan St. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,600 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: VES-1

(REMOVED)

Description: Soffit
Functional Space: South East Vestibule
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 64 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 01-10-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**-1R**
Location:	Southeast Vestibule
Date Sampled:	01-10-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	01-10-1990
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	64 Square Feet
Average People/Hr:	300
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	324,000
Preventive Measures:	**None Required**

(Removed)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CB-1

(NO SUSPECT MATERIAL IN CHALKBOARDS/NO MASTIC BEHIND CHALKBOARDS)

Description: Chalkboards
Functional Space: Classrooms
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 2,560 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,560 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**
	(No Suspect Material In Chalkboards)
	(No Mastic Behind Chalkboards)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: WP-01

Description: Gray Window Glazing
Functional Space: Windows
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----Physical Assessment----------

Size: Where Present Around Windows
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**WP-01-01**
Location:	Center, West Window Classroom #19
Date Sampled:	04-22-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-02**
Location:	Center, North Window Classroom #16
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-03**
Location:	Center Window Media Center
Date Sampled:	04-22-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL, INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

-----Risk Assessment----------

Hazard Rank:	7
Quantity:	Where Present Around Windows
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

-----Recommended Response Action----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: WP-1

Description: Window Putty
Functional Space: Classrooms
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: <5%
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 11-02-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-26-10**
Location:	Throughout Building
Date Sampled:	10-26-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-11**
Location:	Throughout Building
Date Sampled:	10-26-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5247-065

Sample Number:	**10-26-12**
Location:	Throughout Building
Date Sampled:	10-26-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	50 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-01

Description: Black Cove Base W/Brown Adhesive
Functional Space: Classrooms
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----Physical Assessment----------

Size:	Where Present Around Classrooms
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**BC-01-01**
Location:	Northwest Vestibule Outside, Classroom #18
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-01-02**
Location:	(Not Listed)
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-01-03**
Location:	Entry, Classroom #2
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

-----Risk Assessment----------

Hazard Rank:	N/A
Quantity:	Where Present Around Classrooms
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

-----Recommended Response Action----------

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-1

Description: Cove Base W/Mastic
Functional Space: Throughout Building
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 1,500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 11-02-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-26-13**
Location:	Throughout Building
Date Sampled:	10-26-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

Sample Number:	**10-26-14**
Location:	All Walls
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5247-065

Sample Number:	**10-26-15**
Location:	All Walls
Date Sampled:	10-26-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-02-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-065

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,500 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-02

Description: Black Cove Base W/Tan Adhesive
Functional Space: Classrooms
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----Physical Assessment----------

Size: Where Present Around Classrooms
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**BC-02-01**
Location:	Entry, Classroom #1
Date Sampled:	04-22-1996
Asbestos Content:	**5.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

-----Risk Assessment----------

Hazard Rank:	7
Quantity:	Where Present Around Classrooms
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

-----Recommended Response Action----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: BC-03

Description: Brown Cove Base W/Brown Adhesive
Functional Space: Modular Unit
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----Physical Assessment----------

Size:	360 Linear Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	Moderate
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996
1 Sample Taken --- Reservoirs Report Dated: 09-19-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**BC-03-01**
Location:	Northwest Entry North Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-03-02**
Location:	East Northwest Entry South Temporary Building
Date Sampled:	04-22-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**10-13-B009**
Location:	Classroom #23A Southwest Wall
Date Sampled:	08-05-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-19-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

-----Risk Assessment----------

Hazard Rank:	N/A
Quantity:	360 Linear Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

-----Recommended Response Action----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-1

(DOOR - ABATED 1988)

Description: Material With-In Fire Rated Door
Functional Space: Boiler Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 1 Door
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1 Door
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	0
Average Days/Year:	200
Person-Hours/Year:	200
Preventive Measures:	**None Required**

(Door - Abated 1988)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-2

(NO SUSPECT MATERIAL WITH-IN DOOR)

Description: Exterior Fire Doors
Functional Space: Throughout Building
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 10 Doors
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: No
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	10 Doors
Average People/Hr:	200
Population:	Students
Average Hours/Day	6
Average Days/Year:	180
Person-Hours/Year:	216,000
Preventive Measures:	**None Required**

(No Suspect Material With-In Doors)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: VD-01

(VIBRATION DAMPENER – ABATED 1998)

Description: White Cloth Vibration Dampener
Functional Space: Stage
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 1 Dampener
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: High
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996
1 Sample Taken --- ATC Report Dated: 06-1998

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**VD-01-01**
Location:	HVAC, Above Stage
Date Sampled:	05-10-1996
Asbestos Content:	**65.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-15-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**VD-1-1**
Location:	Center, Stage
Date Sampled:	06-25-1998
Asbestos Content:	**65.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	06-25-1998
Laboratory Name:	ATC ASSOCIATES, INC.
Address:	6746 S. Revere Pkwy. Suite 100 Englewood, Colorado 80112-6708
Telephone:	(303)-799-6100
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1 Dampener
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

(Vibration Dampener – Abated 1998)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: ACM-01

(TRANSITE PANEL – ABATED 1998)

Description: Transite Panel Heat Shield
Functional Space: Electrical Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 28 Square Feet
Assumed ACM: No Condition: N/A
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**ACM-01-01**
Location:	Electrical Room
Date Sampled:	04-22-1996
Asbestos Content:	**30.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-26-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	28 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Transite Panel - Abated 1998)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FB-1

(GASKET – ABATED 1998)

Description: White Gasket Material
Functional Space: Boiler Room
Date Inspected: 03-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: N/A
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: High
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 06-1998

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FB-1-1**
Location:	Boiler Flu Exhaust
Date Sampled:	04-22-1996
Asbestos Content:	**70.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	06-25-1998
Laboratory Name:	ATC ASSOCIATES, INC.
Address:	6746 S. Revere Pkwy. Suite 100 Englewood, Colorado 80112-6708
Telephone:	(303)-799-6100
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Gasket - Abated 1998)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CMU-1

Description: Concrete Masonry Unit
Functional Space: Throughout Building
Date Inspected: 9-25-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 10.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 150,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- Reservoirs Report Dated: 11-10-2009

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**10-09-B001**
Location:	Stage, East Wall
Date Sampled:	11-03-2009
Asbestos Content:	**8.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B002**
Location:	Stage, Northwest Wall
Date Sampled:	11-03-2009
Asbestos Content:	**8.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B003**
Location:	Multi-Purpose Room East Wall
Date Sampled:	11-03-2009
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B004**
Location:	Classroom #19 Northwest Wall
Date Sampled:	11-03-2009
Asbestos Content:	**8.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B005**
Location:	Classroom #15 Southwest Wall
Date Sampled:	11-03-2009
Asbestos Content:	**8.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**10-09-B006**
Location:	Library Southwest Wall
Date Sampled:	11-03-2009
Asbestos Content:	**5.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	11-05-2009
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan St. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986

EPA/NBS Accred Lab: 101533-480

Sample Number: **10-09-B007**
Location: Classroom #6
Northeast Wall
Date Sampled: 11-03-2009
Asbestos Content: **5.0% Total**
Asbestos Type: **Chrysotile**
Analysis Date: 11-05-2009

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan St. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank: 7
Quantity: 150,000 Square Feet
Average People/Hr: 30
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

5.4 Prioritized Listing Of Homogeneous Materials & Salients

Harris Park Elementary

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
FT-01	Corridors & Storage	N/A	7,200	$0
FT-1	Nurse & Storeroom	N/A	900	$0
FT-02	Classrooms #14, Lounge, Office, & Stage	N/A	7,200	$0
FT-2	Administrative Area	N/A	4,800	$0
FT-3	Kitchen	N/A	64,800	$0
FT-04	Classroom #15	N/A	7,200	$0
FT-05	Classrooms #1,#4, & #18	N/A	7,200	$0
FT-06	Classroom #13	N/A	7,200	$0
FT-6	Corridors	N/A	324,000	$0
FT-07	Classrooms #2,#3,#7,#8, #14 & #19	N/A	7,200	$0
FT-7	Gymnasium	N/A	27,000	$8893
FTM-7	Gymnasium	N/A	27,000	$0
FT-08	Media Center	N/A	7,200	$0
FT-8	Modular Unit & All Purpose Room	N/A	27,000	$0
FT-09	Classrooms #5,#6, & #10	N/A	7,200	$0
FT-9	Office Restroom	N/A	160	$0
FT-10	Classroom #9	N/A	7,200	$0
FT-11	Classroom Closets	N/A	7,200	$0
FT-13	Kitchen	N/A	7,200	$0
TSI-1	Boiler room	N/A	200	$0
TSI-02	Boiler Room	N/A	5,400	$0
WES-1	Throughout Building	N/A	1,080	$0

CT-01	Modular Unit	N/A	32,400	$0
CT-1	Classroom & Gymnasium	N/A	216,000	$0
CT-2	Office & Hallways	N/A	216000	$0
CT-4	Stage	N/A	27,000	$0
CT-6	Hallway Ceiling	N/A	216,000	$0
CT-8	Modular Unit	N/A	27,000	$0
CTM-1	Stage	N/A	27,000	$0
PC-3	Kitchen & Restrooms	N/A	21,600	$0
DWW-01	East Modular Building	N/A	5,400	$0

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
DWWC-5	Stage, PE Office, & Administrative Area	N/A	86400	$0
DWB-7	Lounge Wall	N/A	7,200	$0
DWW-9	South Modular Unit	N/A	27,000	$0
VES-1	Southeast Vestibule	N/A	324,000	$0
CB-1	Classrooms	N/A	32,400	$0
WP-01	Windows	7	32,400	$0
WP-1	Classrooms	7	32,400	$0
BC-01	Classrooms	N/A	32,400	$0
BC-1	Throughout Building	N/A	32,400	$0
BC-02	Classrooms	7	32,400	$0
BC-03	Modular Unit	N/A	32,400	$0
FD-1	Boiler Room	N/A	200	$0
FD-2	Throughout Building	N/A	216,000	$0
VD-01	Stage	N/A	5400	$0
ACM-01	Electrical Room	N/A	7,200	$0
FB-1	Boiler Room	N/A	7,200	$0
CMU-1	Throughout Building	7	32,400	$0

Total Cost Of Recommended Actions: $8,893

5.5 Floor Plans

HARRIS PARK
TABLE OF CONTENT FOR DRAWINGS

FILE - 10F1
LAYER
1 - 9 OPEN
10 MASTER

FILE - WALL
LAYER
1 DWB-7
2 DWW-9
3 - 9 OPEN
10 MASTER

FILE - FT1-9
LAYER
1 FT-1
2 FT-2
3 FT-3
4 FT-4
5 FT-6
6 FTM-7
7 FT-9
8 FT-5
9 FT-7
10 MASTER

FILE - FT11-19
LAYER
1 FT-8
2 - 9 OPEN
10 MASTER

FILE - CT
LAYER
1 CT-1
2 CT-6
3 PC-3
4 CT-2
5 CT-4
6 DWWC-5
7 CT-8
8 - 9 OPEN
10 MASTER

FILE - MISC
LAYER
1 TSI-1
2 FD-1
3 TM-1
4 VES-1
5 BC-1
6 CB-1
7 WP-1
8 FD-2
9 BC-2
10 MASTER

MISC - 2
LAYER
1 ACM-1