5.0 AHERA RE-INSPECTION SUMMARIES & RISK ASSESSMENTS

5.1 AHERA Re-Inspection

5.1.1 Re-Inspection Information & Procedures

The undersigned has completed the inspection for this (or these) building(s) and have met the requirements stated in 40 CFR 763.85 (A), (B), (C), (D), and (E), SUBPART E. The building's identification and date of inspection are mentioned throughout this section (5) of the Asbestos Management Plan.

Inspectors Signature _____
Kyle C. Baber Accreditation Number: 0910
Eric J. Havelick Accreditation Number: DR090691-02
Brandon Ramer Accreditation Number: 4766
Rick Seiler Accreditation Number: 3481
Darren Trujillo Accreditation Number:22590

A review of the construction records, including available plans and specifications, was conducted by the inspectors in an effort to discover any materials specified as asbestos-containing. The construction chronology was researched to define areas containing like materials. Different construction areas which contain like-appearing materials would require separate sampling to evaluate asbestos content. Common usage room names and numbers were determined for use in this plan.

Schematic drawings were made of the building which indicates buildings, additions or construction areas, functional spaces/rooms, homogeneous areas, salient and sample locations. These drawings are attached to this report in Section 5.5.

Every accessible internal space in the buildings was toured and observed during inspections. The Inspectors attempted to discover and record any material suspected of containing asbestos. All suspected material discovered was tested by physical hand pressure to determine whether or not the material was friable. An assessment of the material's condition and potential for disturbance or damage was made based upon the inspector’s experience and judgment.

Inspection procedures were conducted in accordance with the requirements of the AHERA regulations to the best of the contributing inspector's abilities.

5.1.2 AHERA Re-Inspection Report Summaries

All inspecting and bulk sampling was performed by Certified Inspectors. The work was not delegated in any way to non-certified personnel.

All bulk samples were tested using polarized light microscopy (PLM), EPA interim method using dispersion staining, to determine the asbestos content.

5.2 Classifying The Condition Of Suspect Material

5.2.1 AHERA Category Physical Assessment

AHERA Category	Definition
1. - - - - -	Damaged or significantly damaged friable thermal system insulation.
2. - - - - -	Damaged friable surfacing ACM.
3. - - - - -	Significantly damaged friable surfacing ACM.
4. - - - - -	Damaged or significantly damaged friable miscellaneous ACM.
5. - - - - -	ACBM with potential for damage.
6. - - - - -	ACBM with potential for significant damage.
7. - - - - -	Any remaining friable ACBM or friable suspected ACBM.

5.2.2 Suspect Asbestos-Containing Surfacing & Miscellaneous Material

Significantly Damaged

Material with one or more of the following characteristics:

The surface crumbing or blistered over at least one tenth of the area if the damage is evenly distributed, or at least one quarter if the damage is localized.

One tenth (one quarter, if localized) of material hanging from the surface, deteriorated, or showing adhesive failure.

Water stains or gouges, or mars over at least one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Damaged

Material with the following characteristics:

The surface blistered, crumbling, water stained, or gouged, marred or otherwise abraded over less than one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.3 Suspect Asbestos-Containing Thermal Insulation

Significantly Damaged

Material with one or more of the following characteristics:

Missing jackets on at least one tenth of the piping or equipment.

Crushed or heavily gouged or punctured insulation on at least one tenth of pipe runs/risers, boiler, tank, duct, etc., if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Damaged

Material with one or more of the following characteristics:

A few water stains or less than one tenth of the insulation with missing jackets.

Crushed insulation or water stains, gouges, punctures, or mars on up to one tenth of the insulation if the damage is evenly distributed (or up to one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.4 Factors Used To Determine The Potential For Disturbance

Potential For Contact With The Material: Accessible -- when referring to ACM means that the material is subject to disturbance by school or building occupants or custodial or maintenance personnel in the course of their normal activities.

High: Service workers work in the vicinity of the material more than once per week, or

The material is in a public area (e.g., hallway, corridor, auditorium) and accessible to building occupants.

Moderate: Service workers work in the vicinity of the material once per month to once per week, or

The material is in a room or office and accessible to the occupants.

Low: Service workers work in the vicinity of the material less than once per month, or

The material is visible but not within reach of building occupants.

Influence Of Vibration: Vibration -- means the periodic motion of friable ACM, which may result in the release of asbestos fibers.

High: Loud motors or engines present (e.g. some fan rooms), or

Intrusive noises or easily sensed vibrations e.g., major airports, a major highway).

Moderate: Motors or engines present, not obtrusive (e.g., ducts vibrating but no fan in the area) or Occasional loud sounds.

Low/None None of the above.

Potential For Air Erosion: Air Erosion -- means the passage of air over friable ACBM which may result in the release of asbestos fibers.

High:	High velocity air (e.g., elevator shaft, fan room).
Moderate:	Noticeable movement of air (e.g., air shaft, ventilator air stream).
Low/None	None of the above.

5.2.5 Determination Of Potential For Disturbance

High Disturbance -- ACM which ranks "high" in any one of potential for contact, Influence of vibration, or potential for air erosion.

Examples are (1) acoustical plaster on a low ceiling in a high school band room, (2) thermal system insulation on air ducts connected to ventilation fans and readily accessible to workers conducting maintenance on the ventilation system, and (3) fireproofing on structural members or metal/concrete decks in a return air plenum.


Moderate Disturbance -- ACM which ranks "moderate" in any one potential for contact, Influence of vibration, or potential for air erosion.

Examples are ACM on corridor walls, on a ceiling underneath a gymnasium, or in an elevator shaft.

Low Disturbance -- ACM which ranks "low" in all three of potential for contact, Influence of vibration, or potential for air erosion.

5.2.6 Response Action Category Determination

The following decision tree was used to determine the Response Action Category.....

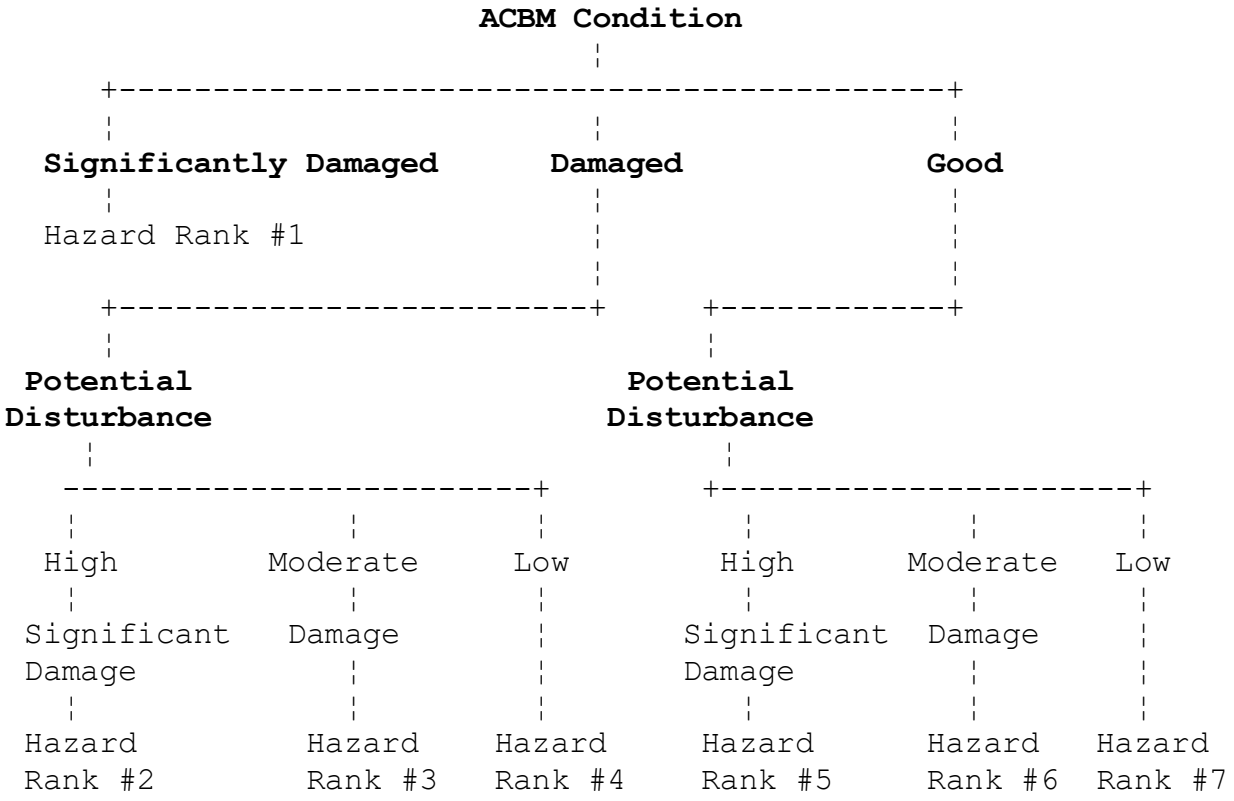

Response Actions Based On Hazard Ranking

Hazard Rank	Response Action Categories	Response Action Required By AHERA
1	Significantly Damaged	Evacuate or isolate the area if needed. Remove the ACBM (or encapsulate if sufficient to contain fibers). Repair of thermal system insulation is allowed if feasible and safe. O&M required for all friable ACBM.
2	Damaged + High Potential For Significant Damage	Evacuate or isolate the area if needed. Remove, enclose, encapsulate, or repair to correct damage. Take steps to reduce potential for disturbance. O&M required for all friable ACBM.
3	Damaged + Moderate Potential For Damage	Remove, enclose, encapsulate, or repair to correct damage. O&M required for all friable ACBM.
4	Damaged	Same as Hazard Rank 3.
5	Good + High Potential For Significant Damage	Evacuate or isolate the area if needed. Take steps to reduce potential for disturbance. O&M required for all friable ACBM and TSI.
6	Good + Moderate Potential For Damage	O&M required for all friable ACBM and TSI.
7	All	O&M required for all ACBM,

Remaining	but measures need not be as extensive as above.

5.3 ACBM Descriptive Log & Summary Of Areas

The areas are organized by functional space within the building. The Homogeneous Area, Hazard Assessment Rank and Response Action have been identified.

Pages 12 through 17 list the homogeneous areas in the order they appear in this report and as detailed on the blue print for this building. Also shown are the type of material, the description of the area, and the square footage of the area.

Homogeneous Area Acronyms		**Autosketch File Name**
ACM-	Asbestos Containing Material	Misc.
BC-	Base Cove	Misc.
CB-	Chalk Boards	Misc.
CT-	Ceiling Tile	CT
CTW-	Ceiling Tile Walls	Wall
CMS-	Ceiling Material Sprayed On	CT
CMU-	Concrete Masonry Unit	Misc.
DWC-	Drywall Ceiling	CT
DWW-	Drywall Wall	Wall
DWWC-	Drywall Wall & Ceiling	Wall
FD-	Fire Doors	Misc.
FT-	Floor Tile	FT
FTM-	Floor Tile Mastic	FT
LN-	Linoleum	FT
PC-	Plaster Ceiling	CT
PW-	Plaster Wall	Wall
PWC-	Plaster Wall & Ceiling	Wall
STM-	Stair Tread Mastic	Misc.
TSI-	Thermal System Insulation	Misc.
WES-	White End Sealant	Misc.
WP-	Window Putty	Misc.

Changes In Homogeneous Area Titles From 1991 ATC Report

Homogeneous Area Ceiling Tile CT-1 was Homogeneous Area 1.
Homogeneous Area Ceiling Tile CT-2 was Homogeneous Area 2.
Homogeneous Area Ceiling Tile CT-3 was Homogeneous Area 3.
Homogeneous Area Ceiling Tile CT-4 was Homogeneous Area 4.
Homogeneous Area Drywall Wall & Ceiling DWWC-5 was Homogeneous Area 5.
Homogeneous Area Ceiling Tile CT-6 was Homogeneous Area 6.
Homogeneous Area Plaster Ceiling PC-7 was Homogeneous Area 7.
Created Homogeneous Area FT-8 in the 1991 Report.

Changes In Homogeneous Area Titles From 1994 ATC Report

Homogeneous Area FD-2 was created.

Changes In Homogeneous Area Titles From 1996 ATC Report.

Homogeneous Area FT-01 through FT-05 have been created.
Homogeneous Area CT-01 through CT-03 have been created.
Homogeneous Area BC-01 has been created.
Homogeneous Area DWW-01 has been created.
Homogeneous Area STM-01 has been created.
Homogeneous Area PC-01 has been created.

Changes In Homogeneous Area Titles From 1996 ATC Report.

Homogeneous Area CT-3 & CT-02A incorporated into CT-2.
Homogeneous Area CT-03 incorporated into CT-4.

Changes In Homogeneous Area Titles From The 2006 Update.

Homogeneous Area FT-7 incorporated into FT-01.

Changes In Homogeneous Area Titles From The 2008 Update.

Homogeneous Area CMU-1 has been created. (Concrete Masonry Unit)
Homogeneous Area WES-1 has been created. (White End Sealant)

According to the Higgins & Associates Air Monitoring Report Dated June 2004, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile/Mastic	Hallway, Classrooms #1,2,7,8,9, & 11, All Purpose Room, Nurse Room, Workroom, Lounge (#10), Restrooms, Social Room, Gymnasium, P.E. Office, & East Entryways-Both Sides.	14,045 Square Feet
Stair Treads & Mastic	Front Entrance & SE Corner of Gymnasium	90 Square Feet
Thermal System Insulation	North Custodial Storage Room	5-Fittings

According to the Blue Mesa Environmental Project Surveillance & Air Monitoring Report, Dated May 2008, the following Asbestos Containing Material was removed:

MATERIAL	LOCATION	APPROX. QUANTITY
Thermal System Insulation	Storeroom Located At Front Entrance Hallway	6 Fittings

According to the Blue Mesa Environmental Project Surveillance & Air Monitoring Report, Dated June 2011, the following Asbestos Containing Material was removed:

MATERIAL	LOCATION	APPROX. QUANTITY
9” x 9” Floor Tile & Mastic Covered By Carpet	Main Office & Principal Office	424 Square Feet

According to the Blue Mesa Environmental Project Surveillance & Air Monitoring Report, Dated June 2017, the following Asbestos Containing Material was removed:

MATERIAL	LOCATION	APPROX. QUANTITY
9" x 9" Floor Tile & Mastic Covered By Carpet	Lounge	667 Square Feet

According to the Blue Mesa Environmental Project Surveillance & Air Monitoring Report, Dated June 22, the following Asbestos Containing Material was removed:

MATERIAL	LOCATION	APPROX. QUANTITY
9" x 9" Floor Tile & Mastic	Kitchen	710 Square Feet

According to the Blue Mesa Environmental Project Surveillance & Air Monitoring Report, Dated June 2025, the following Asbestos Containing Material was removed:

MATERIAL	LOCATION	APPROX. QUANTITY
9" x 9" Floor Tile & Mastic Covered By Carpet	remainder of the classrooms	667 Square Feet

The Homogeneous Areas Are In Consecutive Order As In The Following Report.

FT-1 **(LOCATED ON PAGE 18)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
ADMINISTRATIVE AREA
793 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-2 **(LOCATED ON PAGE 20)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET

ADMINISTRATIVE AREA
424 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC – ABATED SUMMER 2011)

FT-3 **(LOCATED ON PAGE 23)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
ALL PURPOSE ROOM #10
850 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ALL PURPOSE ROOM #10 - ABATED 2004)

FT-4 **(LOCATED ON PAGE 26)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET
CLASSROOMS
9,694 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC - CLASSROOMS #1, #2, #7, #8, #9, & #11 - ABATED SUMMER 2004)(FLOOR TILE/MASTIC – CLASSROOM #107 – ABATED SUMMER 2017)
ALL REMAINING FLOORS ABATED 2025

FT-5 **(LOCATED ON PAGE 28)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
CORRIDORS
2,567 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-8 **(LOCATED ON PAGE 31)**
HOMOGENEOUS AREA – CARPET W/ADHESIVE OVER CONCRETE
CLASSROOMS #13-#19 & CORRIDORS
(EAST ADDITION TO ORIGINAL BUILDING)
8,260 SQUARE FEET
TESTED-NEGITIVE

FT-01 **(LOCATED ON PAGE 33)**
HOMOGENEOUS AREA - WHITE 9" X 9" FLOOR TILE
W/COLORED STREAKS & BLACK MASTIC
GYMNASIUM, OFFICE, STORAGE ROOM, & CORRIDORS
6,427 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-02 **(LOCATED ON PAGE 36)**
HOMOGENEOUS AREA - WHITE 12" X 12" MOTTLED FLOOR TILE
W/BLACK MASTIC
KINDERGARTEN RESTROOMS & VESTIBULE
90 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

FT-03 **(LOCATED ON PAGE 38)**
HOMOGENEOUS AREA - LIGHT GREEN 12" X 12" MOTTLED
FLOOR TILE W/TAN ADHESIVE
KITCHEN
330 SQUARE FEET
TESTED-NEGATIVE

FT-04 **(LOCATED ON PAGE 41)**
HOMOGENEOUS AREA - WHITE 12" X 12" FLOOR TILE W/OLIVE
MOTTLES & BLACK ADHESIVE
CLASSROOMS & EAST ENTRYWAYS
(EAST ADDITION TO ORIGINAL BUILDING)
1,200 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - EAST HALL ENTRYWAYS - ABATED 2004)

FT-05 **(LOCATED ON PAGE 44)**
HOMOGENEOUS AREA - WHITE FLOOR TILE W/BLACK MASTIC
(UNDER CARPET)
MUSIC ROOM
800 SQUARE FEET

TESTED-POSITIVE

FT-06 **(LOCATED ON PAGE 45)**
HOMOGENEOUS AREA - LIGHT GREEN 9" X 9" MOTTLED
FLOOR TILE W/BLACK ADHESIVE
KITCHEN UNDER COUNTER AND STOVE AREA ONLY
24 SQUARE FEET
TESTED-POSITIVE

STM-01 **(LOCATED ON PAGE 46)**
HOMOGENEOUS AREA - BROWN STAIR TREAD & BLACK MASTIC
CORRIDOR & GYMNASIUM
220 SQUARE FEET
TESTED-POSITIVE
(STAIR TREADS/MASTIC – ABATED SUMMER 2004)

CT-1 **(LOCATED ON PAGE 48)**
HOMOGENEOUS AREA - 2.5' WIDE ROUGH CEILING STRIPS
GYMNASIUM, OFFICES, CLASSROOMS,
& SECONDARY HALLWAY CEILING
20,000 SQUARE FEET
TESTED-NEGATIVE

CT-2 **(LOCATED ON PAGE 52)**
HOMOGENEOUS AREA - 2' x 4' PERFORATED & SCRATCHED TILE
BASEMENT BAND ROOM, MUSIC ROOM, & HALLWAYS
1,850 SQUARE FEET
TESTED-NEGATIVE

CT-4 **(LOCATED ON PAGE 56)**
HOMOGENEOUS AREA - 2' x 4' PERFORATED CEILING TILE
CLASSROOMS 13-19 & CORRIDORS
(EAST ADDITION TO ORIGINAL BUILDING)
8,060 SQUARE FEET
TESTED-TRACE

CT-6 **(LOCATED ON PAGE 60)**
HOMOGENEOUS AREA - 2.5' WIDE SMOOTH CEILING STRIPS

STAIRWAY TO BOILER ROOM
85 SQUARE FEET
TESTED-NEGATIVE

CT-01 **(LOCATED ON PAGE 63)**
HOMOGENEOUS AREA - WHITE 2' x 4' SMALL PERFORATED CROSS FISSURED CEILING PANEL
BASEMENT, BAND ROOM, MUSIC ROOM, & HALLWAYS
2,900 SQUARE FEET
TESTED-NEGATIVE

PC-7 **(LOCATED ON PAGE 66)**
HOMOGENEOUS AREA - PLASTER CEILING
KITCHEN
510 SQUARE FEET
TESTED-NEGATIVE

PC-01 **(LOCATED ON PAGE 70)**
HOMOGENEOUS AREA - WHITE PLASTER SKIM COAT WITH GRAY SUBSTRATE
KITCHEN
510 SQUARE FEET
TESTED-NEGATIVE

DWWC-5 **(LOCATED ON PAGE 73)**
HOMOGENEOUS AREA - DRYWALL WALL & CEILING W/JOINT COMPOUND
RESTROOMS & INTERNAL WALLS
(EAST ADDITION TO ORIGINAL BUILDING)
40,000 SQUARE FEET
TESTED-NEGATIVE

DWW-01 **(LOCATED ON PAGE 78)**
HOMOGENEOUS AREA - WHITE DRYWALL W/JOINT COMPOUND
THROUGHOUT BUILDING (WEST ORIGINAL BUILDING)
2,000 SQUARE FEET
TESTED-POSITIVE

TSI-1 **(LOCATED ON PAGE 82)**
HOMOGENEOUS AREA - THERMAL SYSTEM INSULATION
CRAWL SPACE, STORAGE ROOMS & ABOVE STAGE CEILING
QUANTITY UNKNOWN
TESTED-POSITIVE
(15 FITTINGS - ABOVE STAGE CEILING - ABATED 1999)
(5 FITTINGS - NORTH CUSTODIAL STOREROOM - ABATED 2004)
(6 FITTINGS - STOREROOM - FRONT ENTRANCE - ABATED 2008)

WES-1 **(LOCATED ON PAGE 86)**
HOMOGENEOUS AREA – WHITE END SEALANT ON PIPING
THROUGHOUT BUILDING
QUANTITY UNKNOWN
TESTED-NEGATIVE

CB-1 **(LOCATED ON PAGE 89)**
HOMOGENEOUS AREA - CHALKBOARDS
CLASSROOMS
2,048 SQUARE FEET
(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

BC-1 **(LOCATED ON PAGE 91)**
HOMOGENEOUS AREA – COVE BASE WITH MASTIC
THROUGHOUT BUILDING
500 SQUARE FEET
TESTED-TRACE

BC-01 **(LOCATED ON PAGE 94)**
HOMOGENEOUS AREA - BROWN COVE BASE W/TAN ADHESIVE
THROUGHOUT BUILDING
500 SQUARE FEET
TESTED-TRACE

FD-1 **(LOCATED ON PAGE 97)**
HOMOGENEOUS AREA - MATERIAL WITH-IN FIRE RATED DOOR
BOILER ROOM
1 DOOR
(NO SUSPECT MATERIAL WITH-IN DOOR)

FD-2 **(LOCATED ON PAGE 99)**
HOMOGENEOUS AREA - EXTERIOR FIRE DOORS
THROUGHOUT BUILDING
18 DOORS
(NO SUSPECT MATERIAL WITH-IN DOORS)

CMU-1 **(LOCATED ON PAGE 101)**
HOMOGENEOUS AREA – CONCRETE MASONRY UNIT
THROUGHOUT BUILDING
150,000 SQUARE FEET
TESTED-TRACE

Tennyson Knolls Elementary

Homogeneous Area ID: FT-1

(FLOOR TILE/MASTIC – ABATED SUMMER 2004)

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Administrative Area
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	793 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High

Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	793 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	4,320
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2004)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-2

(FLOOR TILE/MASTIC – ABATED SUMMER 2011)

Description: Floor Tile Covered By Carpet
Functional Space: Administrative Area
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 424 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 04-13-2011

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**16-11-B001**
Location:	Main Office South Wall Area
Date Sampled:	04-07-2011
Asbestos Content:	**5.0% Total (Floor Tile)** **6.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-11-B002**
Location:	Principal Office East Wall Area
Date Sampled:	04-07-2011
Asbestos Content:	**7.0% Total (Floor Tile)** **8.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-11-B003**
Location:	Principal Office North Wall Area
Date Sampled:	04-07-2011
Asbestos Content:	**4.0% Total (Floor Tile)** **8.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	424 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

(Floor Tile/Mastic – Abated 2011)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-3

(FLOOR TILE/MASTIC – ALL PURPOSE ROOM #10 - ABATED SUMMER 2004)

Description: 9” X 9” Floor Tile W/Black Mastic
Functional Space: All Purpose Room #10
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 850 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling: None

3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-02-01**
Location:	Corridor, Outside PC Classroom #2
Date Sampled:	04-23-1996
Asbestos Content:	**8.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-02-02**
Location:	Northeast Corner All Purpose Room
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-02-03**
Location:	Southeast, Center Classroom #6
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	850 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

(Floor Tile/Mastic - All Purpose Room #10 - Abated 2004)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-4

(FLOOR TILE/MASTIC - CLASSROOMS #1, #2, #7, #8, #9, & #11 - ABATED 2004)

Description: Floor Tile Covered By Carpet
Functional Space: Classrooms
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 9,694 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	9,694 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - Classrooms #1, #2, #7, #8, #9, & #11 - Abated 2004)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-5

(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Corridors
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 2,567 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- DCM Report Dated: 08-26-1988

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**#1, Part B**
Location:	Corridors
Date Sampled:	07-26-1988
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-26-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place
	Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**#1, Part A**
Location:	Corridors
Date Sampled:	07-26-1988
Asbestos Content:	**17.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-26-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place
	Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,567 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2004)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-8

Description: Carpet Over Concrete
Functional Space: Classrooms #13-#19 & Corridors (East Addition To Original Building)
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	8,260 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	No
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	8,260 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-01

(FLOOR TILE/MASTIC - ABATED SUMMER 2004)

Description:	White 9” x 9” Floor Tile W/Colored Streaks & Black Mastic
Functional Space:	Gymnasium, Office, Storage Room, & Corridors
Date Inspected:	04-17-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	16.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	6,427 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-01-01**
Location:	Vestibule, Outside A-26 General Office
Date Sampled:	04-23-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-02**
Location:	South Entry, Storage North Of Classroom #2
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	none
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred:	102031

Sample Number:	**FT-01-03**
Location:	Northeast Corner Social Worker Office
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939

EPA/NBS Accred: 102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	6,427 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2004)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-02

(FLOOR TILE/MASTIC – ABATED SUMMER 2004)

Description:	White 12” x 12” Mottled Floor Tile W/Black Mastic
Functional Space:	Kindergarten Restrooms & Vestibule
Date Inspected:	04-17-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	16.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	90 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-03-01**
Location:	Entry, TLT North Of Classroom #2
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total Tile **10.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	90 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2004)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-03

Description: Light Green 12” x 12” Mottled Floor Tile W/Tan Adhesive
Functional Space: Kitchen
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 330 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-04-01**
Location:	Northwest Corner Kitchen
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total (Floor Tile) 0.0% Total (Mastic)
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-04-02**
Location:	Southeast Corner Kitchen
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total (Floor Tile) 0.0% Total (Mastic)
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	330 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-04

(FLOOR TILE/MASTIC - EAST HALL ENTRYWAYS - ABATED SUMMER 2004)

Description:	White 12” x 12” Floor Tile W/Olive Mottles & Black Adhesive (In Newer East Portion Of School)
Functional Space:	Classrooms & East Entryways
Date Inspected:	04-17-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	16.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	1,200 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-05-01**
Location:	North Exit Classroom #13
Date Sampled:	04-23-1996
Asbestos Content:	**2.0% Total (Floor Tile)** 0.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-05-02**
Location:	East Entry Classroom #14
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total (Floor Tile) **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-05-03**
Location:	West Wall, Storage North Of Facility Workroom #19
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237

Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank: 7
Quantity: 9,200 Square Feet
Average People/Hr: 4
Population: Administrative
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 2,880
Preventive Measures: **Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - East Hall Entryways - Abated 2004)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-05

Description: White Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Music Room
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 800 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 04-23-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-06-01**
Location:	Northwest, Center Music Room #20
Date Sampled:	04-23-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	800 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0
Homogeneous Area ID: FT-9

(FLOOR TILE/MASTIC – ABATED SUMMER 2022)

Description: Floor Tile
Functional Space: Kitchen under counters
Date Inspected: 10-5-2018
Inspector Name: Darren Trujillo
Inspector Accred: 22590
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 50 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- Reservoirs Report Dated: 10-06-2018

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**16-18-B006**
Location:	Main Office South Wall Area
Date Sampled:	10-05-2018
Asbestos Content:	**3.0% Total (Floor Tile)** **12.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	10-06-2018
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	424 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

(Floor Tile/Mastic – Abated 2022)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: STM-01

(STAIR TREADS/MASTIC – ABATED SUMMER 2004)

Description: Brown Stair Tread & Black Mastic
Functional Space: Corridors & Gymnasium
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 220 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**STM-01-01**
Location:	Corridor Outside Library
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total (Stair Tread) **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	220 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,880
Preventive Measures:	**None Required**

(Stair Treads/Mastic - Abated 2004)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-1

Description: 2.5' Wide Rough Ceiling Strips
Functional Space: Gymnasium, Offices, Classrooms, & Secondary Hallway Ceiling
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 20,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-2-3**
Location:	Southeast Corner, Classroom Northwest Of Gymnasium
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE1-1**
Location:	Southeast Corner Classroom #2
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE1-2**
Location:	Southwest Corner Classroom #3
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE1-3**
Location:	Northwest Corner Classroom #12
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-04**
Location:	Gymnasium
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-05**
Location:	Gymnasium
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-06**
Location:	Gymnasium
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	20,000 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-2

Description: 2' x 4' Perforated & Scratched Tile
Functional Space: Basement Band Room, Music Room, & Hallways
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 1,850 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TNE-2-1**
Location:	Above Door, Outside Classroom #2
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE-2-2**
Location:	Above Door, Outside Speech Therapy Room
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE-2-3**
Location:	Above Door, Outside Classroom #4
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-01**
Location:	Basement Room
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-02**
Location:	Basement Room
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-03**
Location:	Basement Room
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,850 Square Feet
Average People/Hr:	45
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	48,600
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-4

Description: 2' x 4' Perforated Ceiling Tile
Functional Space: Classrooms #13-#19 & Corridors (In Newer East Portion Of School)
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 8,060 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992
1 Sample Taken --- ATC Report Dated: 05-14-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TNE4-1**
Location:	Northeast Corner Classroom #14
Date Sampled:	06-21-1990
Asbestos Content:	**Trace**
Asbestos Type:	**Amosite**
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE4-2**
Location:	Southeast Corner Classroom #17
Date Sampled:	06-21-1990
Asbestos Content:	**Trace**
Asbestos Type:	**Amosite**
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE4-3**
Location:	Northwest Corner Classroom #15
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-07**
Location:	New Portion Of School
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-08**
Location:	New Portion Of School
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-09**
Location:	New Portion Of School
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**CT-03-01**
Location:	Hallway Outside Classroom #16
Date Sampled:	05-10-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-14-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	8,060 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-6

Description: 2.5' Wide Smooth Ceiling Strips
Functional Space: Stairway To Boiler Room
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	85 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	No

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TNE-6-1**
Location:	Entrance, Stairway Boiler Room
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-19**
Location:	Boiler Room Stairs
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-20**
Location:	Boiler Room Stairs
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-21**
Location:	Boiler Room Stairs
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	85 Square Feet
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-01

Description: White 2’ x 4’ Small Perforated Cross Fissured Ceiling Panel
Functional Space: Basement, Band Room, Music Room, & Hallways
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 2,900 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**CT-01-01**
Location:	Center Music Room #20
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-01-02**
Location:	North Center Music Room #20
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-02-01**
Location:	North Center Music Room #20
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,900 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: PC-7

Description: Plaster Ceiling
Functional Space: Kitchen
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 510 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TNE7-1**
Location:	Northwest Corner Kitchen
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE7-2**
Location:	Northwest Corner Kitchen Storage
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-10**
Location:	Kitchen
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-11**
Location:	Kitchen
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-12**
Location:	Kitchen
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	510 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	4,320
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: PC-01

Description: White Plaster Skim Coat
With Gray Substrate
Functional Space: Kitchen
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	510 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Surfacing Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**PC-01-01**
Location:	North Center Kitchen
Date Sampled:	4-23-196
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**PC-01-02**
Location:	South Center Kitchen
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**PC-01-03**
Location:	Southeast Kitchen
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	510 Square Feet
Average People/Hr:	4
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	4,320
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWWC-5

Description: Drywall Wall & Ceiling W/Joint Compound
Functional Space: Restrooms & Internal Walls
(East Add On Addition)
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 40,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 07-10-1990
3 Samples Taken --- ATC Report Dated: 10-20-1992
1 Sample Taken --- ATC Report Dated: 10-15-1993
3 Samples Taken --- ATC Report Dated: 04-23-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TNE-5-1**
Location:	North Central Wall Classroom #13 (Behind Outlet Cover)
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**TNE-5-2**
Location:	East Central Storage Closet Ceiling (Between Boy's & Girl's Restroom)
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-20-16**
Location:	Restrooms, Northeast Part Of Building
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237

Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-17**
Location:	Restrooms, Northeast Part Of Building
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-18**
Location:	Restrooms, Northeast Part Of Building
Date Sampled:	10-20-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**16-93-B001**
Location:	Ceiling, East Custodial Closet
Date Sampled:	09-23-1993
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-15-1993
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 5147-00090

Sample Number: **DWW-01-02**
Location: East Entry
Classroom #13
Date Sampled: 4-23-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 4-30-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, CO 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

Sample Number: **DWW-01-03**
Location: East Entry
Classroom #14
Date Sampled: 4-23-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 4-30-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, CO 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

Sample Number: **DWW-01-04**
Location: Vestibule, Outside
Classroom #13
Date Sampled: 4-23-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 4-30-1996

Laboratory Name: ATC ENVIRONMENTAL INC.

Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	40,000 Square Feet
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWW-01

Description: White Drywall W/Joint Compound
Functional Space: Throughout Building
(West Original Building)
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 2,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 07-10-1990
1 Sample Taken --- ATC Report Dated: 04-23-1996
3 Samples Taken --- Reservoirs Report Dated: 06-20-2011
2 Samples Taken --- Reservoirs Report Dated: 10-05-2022

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**TNE-5-3**
Location:	Above Restroom Door (Ceiling) Connected To PC Room #2
Date Sampled:	06-21-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-26-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**DWW-01-01**
Location:	West Side Entry Storage, PC Room #2
Date Sampled:	4-23-1996
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Englewood, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**16-11-B005**
Location:	Around Front Vestibule Doors
Date Sampled:	06-20-2011
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-20-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-11-B006**
Location:	Storeroom Front Entrance Area
Date Sampled:	06-20-2011
Asbestos Content:	**4.0% Total** (**Joint Compound)** **0.12% Total (Composite Sample)**
Asbestos Type:	**Chrysotile**
Analysis Date:	06-20-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-11-B007**
Location:	Around Vestibule Doors Classroom #3 Area
Date Sampled:	06-20-2011
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	06-20-2011
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-18-B004**
Location:	Kitchen Fume Hood
Date Sampled:	10-05-2018
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-06-2018
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.

Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	2,000 Square Feet
Average People/Hr:	1
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: TSI-1

(15 FITTINGS - ABOVE STAGE CEILING - ABATED SUMMER 1999)
(5 FITTINGS - NORTH CUSTODIAL STORAGE ROOM - ABATED SUMMER 2004)
(6 FITTINGS - STOREROOM FRONT ENTRANCE HALLWAY - ABATED 2008)

Description: Thermal System Insulation
Functional Space: Crawl Space, Storage Rooms & Above Stage Ceiling
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Date: 10-20-1992
1 Sample Taken --- ATC Report Dated: 07-13-1992
1 Sample Taken --- ATC Report Dated: 10-15-1993

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 6

**** Bulk Sample Information ****

Sample Number:	**10-20-22**
Location:	Storage Room Next To Office
Date Sampled:	10-20-1992
Asbestos Content:	**2.0% / 3.0% Total**
Asbestos Type:	**Chrysotile / Amosite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-23**
Location:	Storage Room Next To Office
Date Sampled:	10-20-1992
Asbestos Content:	**Trace / 3.0% Total**
Asbestos Type:	**Chrysotile / Amosite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**10-20-24**
Location:	Storage Room Next To Office
Date Sampled:	10-20-1992
Asbestos Content:	**2.0% / 3.0% Total**
Asbestos Type:	**Chrysotile / Amosite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

Sample Number:	**16-92-B001**
Location:	East/West Hallway Custodian Closet
Date Sampled:	07-09-1992
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Amosite**
Analysis Date:	07-10-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-071

Sample Number:	**16-92-B002**
Location:	Above Stage Ceiling
Date Sampled:	09-23-1992
Asbestos Content:	**3.0% / 8.0% Total**
Asbestos Type:	**Chrysotile/Amosite**
Analysis Date:	07-10-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-0090

Sample Number:	**TSI-01-01**
Location:	South Side, Storage Adjacent To Administration
Date Sampled:	4-23-1996
Asbestos Content:	**5.0% Total**
Asbestos Type:	**Amosite**
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	6
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(15 Fittings - Above Stage Ceiling - Abated 1999)
(5 Fittings - North Custodial Storage Room - Abated 2004)
(6 Fittings - Storeroom Front Entrance Hallway – Abated 2008)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: WES-1

Description: White End Sealant On Piping
Functional Space: Throughout Building
Date Inspected: 9-16-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 08-30-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**16-10-B008**
Location:	Boiler Room Northeast Corner
Date Sampled:	08-16-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B009**
Location:	Boiler Room Northeast Corner
Date Sampled:	08-16-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B010**
Location:	Boiler Room Southeast Corner
Date Sampled:	08-16-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CB-1

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description: Chalkboards
Functional Space: Classrooms
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	2,048 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Bulk Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,048 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(No Suspect Material With-In Chalkboards)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-1

Description: Cove Base W/Mastic
Functional Space: Throughout Building
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-20-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-20-25**
Location:	Classroom #3
Date Sampled:	10-20-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055
Sample Number:	**10-20-26**
Location:	Classroom #9
Date Sampled:	10-20-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055
Sample Number:	**10-20-27**
Location:	Storage Room & Band Room
Date Sampled:	10-20-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite**
Analysis Date:	10-23-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-055

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	500 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-01

Description: Brown Cove Base W/Tan Adhesive
Functional Space: Throughout Building
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 04-23-1996
1 Sample Taken --- Reservoirs Report Dated: 10-06-2018

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**BC-01-01**
Location:	Vestibule, Outside General Office
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-01-02**
Location:	North Entry Classroom #2
Date Sampled:	4-23-1996
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-01-03**
Location:	North Wall Social Worker S-27
Date Sampled:	4-23-1996
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-01-04**
Location:	East Entry Classroom #14
Date Sampled:	4-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	4-30-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**16-18-B007**
Location:	Kitchen Under counter
Date Sampled:	10-05-2018
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-06-2018
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	500 Square Feet
Average People/Hr:	30

Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-1

(NO SUSPECT MATERIAL WITH-IN DOOR)

Description: Material With-In Fire Rated Door
Functional Space: Boiler Room
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 1 Door
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: No
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1 Door
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

(No Suspect Material With-In Door)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-2

(NO SUSPECT MATERIAL WITH-IN DOORS)

Description: Exterior Fire Doors
Functional Space: Throughout Building
Date Inspected: 04-17-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 18 Doors
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: No
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	18 Doors
Average People/Hr:	100
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	108,000
Preventive Measures:	**None Required**

(No Suspect Material With-In Doors)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CMU-1

Description: Concrete Masonry Unit
Functional Space: Throughout Building
Date Inspected: 9-16-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 16.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 150,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- Reservoirs Report Dated: 08-30-2010
1 Sample Taken --- Reservoirs Report Dated: 05-03-2011

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**16-10-B001**
Location:	Teacher Workroom East Wall
Date Sampled:	08-16-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B002**
Location:	Computer Lab North Wall
Date Sampled:	08-16-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B003**
Location:	Stage, Wall Northeast Corner
Date Sampled:	08-16-2010
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B004**
Location:	Classroom #4 North Wall
Date Sampled:	08-16-2010
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B005**
Location:	Kitchen Storeroom North Wall
Date Sampled:	08-16-2010
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**16-10-B006**
Location:	Boy’s Restroom Outside, Classroom #12
Date Sampled:	08-16-2010
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-27-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, CO 80216
Telephone:	(303)-964-1986

EPA/NBS Accred Lab: 101533-480

Sample Number: **16-10-B007**
Location: Classroom #10
West Wall
Date Sampled: 08-16-2010
Asbestos Content: **Trace**
Asbestos Type: **Chrysotile**
Analysis Date: 08-27-2010

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, CO 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **16-11-B004**
Location: Office Nurse Room
North Wall
Date Sampled: 05-03-2011
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 08-27-2010

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, CO 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	150,000 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

5.4 Prioritized Listing Of Homogeneous Materials & Salients

Tennyson Knolls Elementary

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
FT-1	Administrative Area	N/A	4,320	$0
FT-2	Administrative Area	N/A	2,880	$0
FT-3	All Purpose Room	N/A	108,000	$0
FT-4	Classrooms	N/A	108,000	$0
FT-5	Corridors	N/A	108,000	$0
FT-8	Classrooms 13-19 & Corridors	N/A	108,000	$0
FT-01	Gymnasium, Office, Storage & Corridors	N/A	2,880	$0
FT-02	Kindergarten Restrooms & Vestibule	N/A	2,880	$0
FT-03	Kitchen	N/A	2,880	$0
FT-04	Classrooms & East Entryways	N/A	2,880	$0
FT-05	Music Room	N/A	2,880	$0
STM-01	Corridor & Gymnasium	N/A	2,880	$0
CT-1	Gym, Offices, Classrooms	N/A	108,000	$0

	2nd Ceiling Hallway			
CT-2	Basement Band Room, Music Room & Hallways	N/A	48,600	$0
CT-4	Classrooms 13-19 & Corridors	N/A	108,000	$0
CT-6	Stairway Boiler Room	N/A	1,080	$0
CT-01	Basement, Band Room, Music Room & Hallway	N/A	108,000	$0
CT-02B	Hallway	N/A	10,800	$0
PC-7	Kitchen	N/A	4,320	$0
PC-01	Kitchen	N/A	4,320	$0
DWWC-5	Restroom & Internal Walls	N/A	108,000	$0

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
DWW-01	Throughout Building	7	10,800	$0
TSI-1	Crawl Space, Storage & Above Stage Ceiling	6	180	$0
WES-1	Throughout Building	N/A	1,080	$0
CB-1	Classrooms	N/A	32,400	$0
BC-1	Throughout Building	N/A	32,400	$0
BC-01	Throughout Building	N/A	32,400	$0
FD-1	Boiler Room	N/A	1,080	$0
FD-2	Throughout Building	N/A	108,000	$0
CMU-1	Throughout Building	7	32,400	$0

Total Cost Of Recommended Actions: $0

5.5 Floor Plans

TENNYSON KNOLLS
TABLE OF CONTENT FOR DRAWINGS

FILE - 16F1

LAYER

1 - 9 OPEN
10 MASTER

FILE - WALL

LAYER

1 – DWW-1
2-9 OPEN
10 MASTER

FILE - MISC

LAYER

1 FD-1
2 TSI-1
3 CB-1
4 BC-1
5 FD-2
6 STM-1
7-9 OPEN
10 MASTER

FILE - CT

LAYER

1 CT-2
2 CT-1
3 CT-4
4 PC-7
5 CT-3
6 DWWC-5
7 CT-6
8 OPEN
9 OPEN
10 MASTER

FILE - FT1-9

LAYER

1 FT-1
2 FT-2
3 FT-3
4 FT-4
5 FT-5
6 FT-7
7 FT-8
8 OPEN
9 OPEN
10 MASTER