5.0 AHERA RE-INSPECTION SUMMARIES & RISK ASSESSMENTS

5.1 AHERA Re-Inspection

5.1.1 Re-Inspection Information & Procedures

The undersigned has completed the inspection for this (or these) building(s) and have met the requirements stated in 40 CFR 763.85 (A), (B), (C), (D), and (E), SUBPART E. The building's identification and date of inspection are mentioned throughout this section (5) of the Asbestos Management Plan.

Inspector's Signature _____
John Van Wazer Accreditation Number: 0915
Eric J. Havelick Accreditation Number: DR090691-02 AM
Brandon Ramer Accreditation Number: 4766
Rick Seiler Accreditation Number: 3481
Darren Trujillo Accreditation Number: 22590

The inspectors conducted a review of the construction records, including available plans and specifications, in an effort to discover any materials specified as asbestos containing. The construction chronology was researched to define areas containing like materials. Different construction areas, which contain like-appearing materials, would require separate sampling to evaluate asbestos content. Common usage room names and numbers were determined for use in this plan.

Schematic drawings were made of the building, which indicates buildings, additions or construction areas, functional spaces/rooms, homogeneous areas, salient, and sample locations. These drawings are attached to this report in Section 5.5.

Every accessible internal space in the buildings was toured and observed during inspections. The Inspectors attempted to discover and record any material suspected of containing asbestos. All suspected material discovered was tested by physical hand pressure to determine whether or not the material was friable. An assessment of the material's condition and potential for disturbance or damage was made based upon the inspector’s experience and judgment.

Inspection procedures were conducted in accordance with the requirements of the AHERA regulations to the best of the contributing inspector's abilities.

5.1.2 AHERA Re-Inspection Report Summaries

Certified Inspectors performed all inspecting and bulk sampling. The work was not delegated in any way to non-certified personnel.

All bulk samples were tested using polarized light microscopy (PLM), EPA interim method using dispersion staining, to determine the asbestos content.

5.2 Classifying The Condition Of Suspect Material

5.2.1 AHERA Category Physical Assessment

AHERA Category	Definitions
1. - - - - -	Damaged or significantly damaged friable thermal system insulation.
2. - - - - -	Damaged friable surfacing ACM.
3. - - - - -	Significantly damaged friable surfacing ACM.
4. - - - - -	Damaged or significantly damaged friable miscellaneous ACM.
5. - - - - -	ACBM with potential for damage.
6. - - - - -	ACBM with potential for significant damage.
7. - - - - -	Any remaining friable ACBM or friable suspected ACBM.

5.2.2 Suspect Asbestos-Containing Surfacing & Miscellaneous Material

Significantly Damaged

Material with one or more of the following characteristics:

The surface crumbing or blistered over at least one tenth of the area if the damage is evenly distributed, or at least one quarter if the damage is localized.

One tenth (one quarter, if localized) of material hanging from the surface, deteriorated, or showing adhesive failure.

Water stains or gouges, or mars over at least one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Damaged

Material with the following characteristics:

The surface blistered, crumbling, water stained, or gouged, marred or otherwise abraded over less than one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.3 Suspect Asbestos-Containing Thermal Insulation Significantly Damaged

Material with one or more of the following characteristics:

Missing jackets on at least one tenth of the piping or equipment.

Crushed or heavily gouged or punctured insulation on at least one tenth of pipe runs/risers, boiler, tank, duct, etc., if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Damaged

Material with one or more of the following characteristics:

A few water stains or less than one tenth of the insulation with missing jackets.

Crushed insulation or water stains, gouges, punctures, or mars on up to one tenth of the insulation if the damage is evenly distributed (or up to one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.4 Factors Used To Determine The Potential For Disturbance

Potential For Contact With The Material: Accessible -- when referring to ACM means that the material is subject to disturbance by school or building occupants or custodial or maintenance personnel in the course of their normal activities.

High:	Service workers work in the vicinity of the material more than once per week, or
	The material is in a public area (e.g., hallway, corridor, auditorium) and accessible to building occupants.
Moderate:	Service workers work in the vicinity of the material once per month to once per week, or
	The material is in a room or office and accessible to the occupants.
Low:	Service workers work in the vicinity of the material less than once per month, or
	The material is visible but not within reach of building occupants.

Influence Of Vibration: Vibration -- means the periodic motion of friable ACM, which may result in the release of asbestos fibers.

High:	Loud motors or engines present (e.g. some fan rooms), or
	Intrusive noises or easily sensed vibrations e.g., major airports, a major highway).
Moderate:	Motors or engines present, not obtrusive (e.g., ducts vibrating but no fan in the area) or Occasional loud sounds.
Low/None	None of the above.

Potential For Air Erosion: Air Erosion -- means the passage of air over friable ACBM, which may result in the release of asbestos Fibers.

High:	High velocity air (e.g., elevator shaft, fan room).
Moderate:	Noticeable movement of air (e.g., air shaft, ventilator air stream).
Low/None	None of the above.

5.2.5 Determination Of Potential For Disturbance

High Disturbance -- ACM which ranks "high" in any one of potential for contact, Influence of vibration, or potential for air erosion.

Examples are (1) acoustical plaster on a low ceiling in a high school band room, (2) thermal system insulation on air ducts connected to ventilation fans and readily accessible to workers conducting maintenance on the ventilation system, and (3) fireproofing on structural members or metal/concrete decks in a return air plenum.


Moderate Disturbance -- ACM which ranks "moderate" in any one potential for contact, Influence of vibration, or potential for air erosion.

Examples are ACM on corridor walls, on a ceiling underneath a gymnasium, or in an elevator shaft.

Low Disturbance -- ACM which ranks "low" in all three of potential for contact, Influence of vibration, or potential for air erosion.

5.2.6 Response Action Category Determination

The following decision tree was used to determine the Response Action Category.....

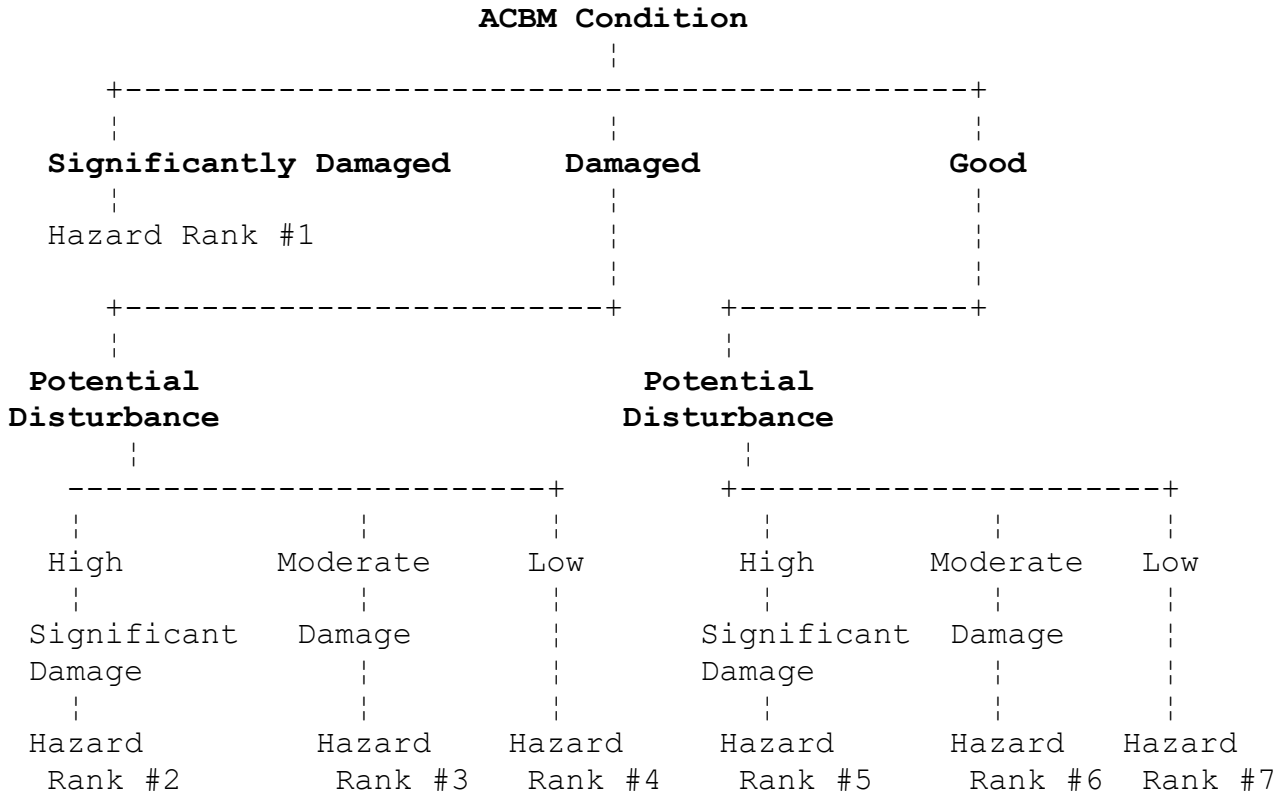

Response Actions Based On Hazard Ranking

Hazard Rank	Response Action Categories	Response Action Required By AHERA
1	Significantly Damaged	Evacuate or isolate the area if needed. Remove the ACBM (or encapsulate if sufficient to contain fibers). Repair of thermal system insulation is allowed if feasible and safe. O&M required for all friable ACBM.
2	Damaged + High Potential For Significant Damage	Evacuate or isolate the area if needed. Remove, enclose, encapsulate, or repair to correct damage. Take steps to reduce potential for disturbance. O&M required for all friable ACBM.
3	Damaged + Moderate Potential For Damage	Remove, enclose, encapsulate, or repair to correct damage. O&M required for all friable ACBM.
4	Damaged	Same as Hazard Rank 3.
5	Good + High Potential For Significant Damage	Evacuate or isolate the area if needed. Take steps to reduce potential for disturbance. O&M required for all friable ACBM and TSI.
6	Good + Moderate Potential For Damage	O&M required for all friable ACBM and TSI.
7	All	O&M required for all ACBM,

Remaining	but measures need not be as extensive as above.

5.3 ACBM Descriptive Log & Summary Of Areas

The areas are organized by functional space within the building. The Homogeneous Area, Hazard Assessment Rank and Response Action have been identified.

Pages 13 through 19, list the homogeneous areas in the order they appear in this report and as detailed on the blue print for this building. Also shown are the type of material, the description of the area, and the square footage of the area.

Homogeneous Area Acronyms		Autosketch File Name
ACM-	Asbestos Containing Material	Misc.
BC-	Base Cove	Misc.
CB-	Chalk Board	Misc.
CM-	Ceiling Mastic	CT
CT-	Ceiling Tile	CT
CMS-	Ceiling Material Sprayed On	CT
CMU-	Concrete Masonry Unit	Misc.
CTDW-	Ceiling Tile Drywall	CT
DWC-	Drywall Ceiling	CT
DWW-	Drywall Wall	Wall
DWWC-	Drywall Wall & Ceiling	Wall
FD-	Fire Door	Misc.
FT-	Floor Tile	FT
FTM-	Floor Tile Mastic	FT
LN-	Linoleum	FT
PC-	Plaster Ceiling	CT
PW-	Plaster Wall	Wall
PWC-	Plaster Wall & Ceiling	Wall
STM-	Stair Tread Mastic	Misc.
TSI-	Thermal Insulation	Misc.
WES-	White End Sealant	Misc.
WP-	Window Putty	Misc.

Changes In Homogeneous Area Titles From 1988 Report

Homogeneous Area C-5 was incorporated into PC-6, which was Homogeneous Area 6.
Homogeneous Area C-6 was incorporated into PC-6, which was Homogeneous Area 6.

Changes In Homogeneous Area Titles From 1990 ATC Report

Homogeneous Area Drywall Wall DWW-1 was Homogeneous Area 1.
Homogeneous Area Ceiling Tile CT-3 was Homogeneous Area 3.
Homogeneous Area Ceiling Tile CT-4 was Homogeneous Area 4.
Homogeneous Area Ceiling Tile CT-5 was Homogeneous Area 5.

Changes In Homogeneous Area Titles From 1994 Report

Homogeneous Area FTM-1 was created.
Homogeneous Area FD-2 was created.

Changes In Homogeneous Area Titles From 1995 Report:

Homogeneous Area FT-2 was incorporated into FTM-1.

Changes In Homogeneous Area Titles From 1996 Report:

Homogeneous Areas FT-01 through FT-15 has been created.
Homogeneous Areas CT-01 through CT-04 has been created.
Homogeneous Area FD-01 has been created.
Homogeneous Area WP-01 has been created.
Homogeneous Area LN-01 has been created.

Changes In Homogeneous Area Titles From 2005 Report:

Homogeneous Area FT-02 was incorporated into FT-01.
Homogeneous Area FT-4 was incorporated into FT-03.
Homogeneous Area FT-05 was incorporated into FT-04.
Homogeneous Area FT-06, FT-07, FT-08 Replacement Tile was incorporated into FT-8.
Homogeneous Area FTM-1 was changed to FT-2.
Homogeneous Area FT-15 was incorporated into FT-14.
Homogeneous Area FD-01 was incorporated into FD-2.
Homogeneous Area FT-14 was incorporated into FT-8.

Changes In Homogeneous Area Titles From 2008 Report:

Homogeneous Area CMU-1 has been created.
Homogeneous Area WES-1 has been created.

Changes In Homogeneous Area Titles From 2012 Update:

Homogeneous Area CT-5 – 2′ x 4′ Pinhole Ceiling Tile was incorporated into CT-3 – 2′ x 4′ Pinhole Ceiling Tile. (Same Homogeneous Material)

Changes In Homogeneous Area Titles From 2015 Update:

Homogeneous Areas DWW-1 & DWC-1 – Drywall with Joint Compound was changed into – DWWC-1 Drywall Wall & Ceiling with Joint Compound (Same material with same sample information)

According to the ATC Project Surveillance Report dated June 1998, the following Asbestos Containing Material has been removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Stage	750 Square Feet

According to the Higgins & Assoc. Project Surveillance Report dated June 2003, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Corridor, Office Area, Storage Room & Gym	8,343 Square Feet

According to the Higgins & Assoc. Project Surveillance Report dated October 2005, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Classrooms #11, #12, #13, & #14	2,668 Square Feet

According to the Blue Mesa Environmental Project Air Monitoring Report dated July 2012, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Carpet Over Floor Tile & Mastic	Teachers Lounge	200 Square Feet

According to the Blue Mesa Environmental Project Air Monitoring Report dated July 2019, the following Asbestos Containing Material was removed:

Material	**Location**	**Approx. Quantity**
Carpet Over Floor Tile & Mastic	Main Office, Principals Office, CR's 1,2,3,7,8,10,15, SPED.	4,857 Square Feet
Carpet over Carpet over Floor Tile Mastic	CR's 4,5,6	2,097 Square Feet
Floor Tile Mastic	Kitchen	415 Square feet
Window Glaze	CR's 1,2,3, Front Entrance Hallway	19 Windows

According to the Blue Mesa Environmental Project Air Monitoring Report dated July 2022, the following Asbestos Containing Material was removed:

Window Glaze	Remaining CR's	9 Window bays

The Homogeneous Areas Are In Consecutive Order As In The Following Report.

FT-1 **(LOCATED ON PAGE 20)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
CLASSROOM #16, NURSE OFFICE, RESTROOMS, WORKROOM, KITCHEN & P. E. OFFICE
1,300 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC IN OFFICE AREA – NURSE ROOM, RESTROOMS, WORKROOM ABATED 2003)
(KITCHEN, ALL CLASSROOMS – ABATED 2019)

FT-2 **(LOCATED ON PAGE 22)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET
ADMINISTRATION AREA & TEACHER LOUNGE
750 SQUARE FEET
TESTED-POSITIVE

(FLOOR TILE - ABATED 1992)
(TEACHER LOUNGE – ABATED 2012)
(ALL ADMIN AND PRINCIPALS OFFICES – ABATED 2019)

FT-5 **(LOCATED ON PAGE 24)**
HOMOGENEOUS AREA – 9″ X 9″ FLOOR TILE W/BLACK MASTIC
CORRIDORS
3,049 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2003)

FT-8 **(LOCATED ON PAGE 27)**
HOMOGENEOUS AREA - FLOOR TILE W/BLACK MASTIC
BOILER ROOM
620 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - BOILER ROOM - ABATED 1999)

FT-01 **(LOCATED ON PAGE 30)**
HOMOGENEOUS AREA - BEIGE 9" X 9" FLOOR TILE
W/BLACK MASTIC
GYMNASIUM & STAGE
4,600 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 1998 & 2003)

FT-03 **(LOCATED ON PAGE 33)**
HOMOGENEOUS AREA - TAN 9" X 9" FLOOR TILE W/BLACK MASTIC
CLASSROOMS (UNDER CARPET)
12,111 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ROOMS #11, 12, 13, & 14 ABATED 2005)

FT-04 **(LOCATED ON PAGE 36)**
HOMOGENEOUS AREA - GRAY 9" X 9" FLOOR TILE

W/WHITE & GRAY STREAKS & BLACK MASTIC
CORRIDOR & VESTIBULE
854 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2003)

FT-09 **(LOCATED ON PAGE 39)**
HOMOGENEOUS AREA - TAN MOTTLED 12" X 12" FLOOR TILE W/BLACK MASTIC
KITCHEN
80 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE MASTIC- ABATED 2019)

FT-10 **(LOCATED ON PAGE 42)**
HOMOGENEOUS AREA - ORANGE & RED FLOOR TILE UNDER CARPET W/TAN ADHESIVE
LIBRARY
1,470 SQUARE FEET
TESTED-POSITIVE
(LIBRARY – ABATED 2019)

FT-11 **(LOCATED ON PAGE 44)**
HOMOGENEOUS AREA - BLUE GREEN 9" X 9" FLOOR TILE W/WHITE & BLACK STREAKS & BLACK MASTIC
CLASSROOM #13 & CLOSET
9 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2005)

FT-13 **(LOCATED ON PAGE 46)**
HOMOGENEOUS AREA - 12" X 12" BROWN FLOOR TILE W/BLACK & WHITE SPECKS & TAN ADHESIVE
GYMNASIUM STORAGE AREA
180 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2003)

CT-1 **(LOCATED ON PAGE 49)**
HOMOGENEOUS AREA - 2.5' X 7.5' CEILING TILE
CLASSROOMS, GYMNASIUM, & BOILER ROOM
15,900 SQUARE FEET
TESTED-NEGATIVE

CT-2 **(LOCATED ON PAGE 54)**
HOMOGENEOUS AREA - 12" x 12" CEILING TILE
STAGE IN GYMNASIUM
600 SQUARE FEET
TESTED-NEGATIVE

CT-3 **(LOCATED ON PAGE 58)**
HOMOGENEOUS AREA - 2' x 4' PINHOLE CEILING TILE
CORRIDORS & ADMINISTRATION OFFICES
4,500 SQUARE FEET
TESTED-NEGATIVE

CT-4 **(LOCATED ON PAGE 64)**
HOMOGENEOUS AREA - 2' x 4' FISSURED CEILING TILE
STORAGE ROOM, CORRIDOR, & VESTIBULES
1,005 SQUARE FEET
TESTED-NEGATIVE

CT-01 **(LOCATED ON PAGE 68)**
HOMOGENEOUS AREA - WHITE 2' x 4' RANDOM FISSURE
LARGE/SMALL PERFORATED CEILING PANELS
GYMNASIUM
3,840 SQUARE FEET
TESTED-NEGATIVE

CT-02 **(LOCATED ON PAGE 70)**
HOMOGENEOUS AREA - WHITE 2' x 4' RANDOM FISSURE
LARGE/SMALL PERFORATED CEILING PANELS
GYMNASIUM, CORRIDOR, & CLASSROOM #16
1,100 SQUARE FEET
TESTED-NEGATIVE

CT-03 **(LOCATED ON PAGE 73)**
HOMOGENEOUS AREA - WHITE 12" x 12" CEILING TILE
W/SMALL & LARGE PERFORATED
CORRIDOR & CLASSROOM #16
1,100 SQUARE FEET
TESTED-NEGATIVE

CT-04 **(LOCATED ON PAGE 76)**
HOMOGENEOUS AREA - WHITE 12" x 12" CEILING TILE
W/SMALL & LARGE PERFORATED
STAGE
REPLACEMENT TILE
TESTED-NEGATIVE

TSI-1 **(LOCATED ON PAGE 78)**
HOMOGENEOUS AREA - THERMAL INSULATION ON ELBOWS
BOILER ROOM
10 LINEAR FEET
TESTED-POSITIVE
(TSI - ABATED 1998)

TSI-2 **(LOCATED ON PAGE 81)**
HOMOGENEOUS AREA - THERMAL SYSTEM INSULATION
BOILER ROOM
80 LINEAR FEET
TESTED-POSITIVE
(TSI - ABATED 1998)

TSI-1T **(LOCATED ON PAGE 84)**
HOMOGENEOUS AREA - THERMAL INSULATION ON HEAT PIPING
PIPE TUNNEL
50 LINEAR FEET

TESTED-NEGATIVE

WES-1 **(LOCATED ON PAGE 87)**
HOMOGENEOUS AREA – WHITE END SEALANT ON PIPING
THROUGHOUT BUILDING
QUANTITY UNKNOWN
TESTED-NEGATIVE

FD-1 **(LOCATED ON PAGE 90)**
HOMOGENEOUS AREA - MATERIAL WITHIN FIRE RATED DOOR
BOILER ROOM
1 DOOR
TESTED-POSITIVE
(DOOR - ABATED 1995)

FD-2 **(LOCATED ON PAGE 92)**
HOMOGENEOUS AREA – EXTERIOR FIRE DOORS
THROUGHOUT BUILDING
9 DOORS
NO SUSPECT MATERIAL WITH-IN DOORS

DWWC-1 **(LOCATED ON PAGE 94)**
HOMOGENEOUS AREA – DRYWALL WALL & CEILING W/JOINT COMPOUND
STAGE, STORAGE, & VESTIBULES
1,500 SQUARE FEET
TESTED-NEGATIVE

PC-6 **(LOCATED ON PAGE 98)**
HOMOGENEOUS AREA - PLASTER CEILING
RESTROOMS, ELECTRICAL ROOM, & KITCHEN
2,500 SQUARE FEET
TESTED-TRACE

CB-1 **(LOCATED ON PAGE 103)**
HOMOGENEOUS AREA - CHALKBOARD
CLASSROOMS
1,536 SQUARE FEET

NO SUSPECT MATERIAL WITH-IN CHALKBOARDS

BC-1 **(LOCATED ON PAGE 105)**
HOMOGENEOUS AREA – COVE BASE W/ADHESIVE
THROUGHOUT BUILDING
500 SQUARE FEET
TESTED-POSITIVE (ADHESIVE ONLY)

WP-1 **(LOCATED ON PAGE 108)**
HOMOGENEOUS AREA - WINDOW PUTTY
CLASSROOMS
100 SQUARE FEET
TESTED-TRACE
(CLASSROOMS 1,2,3 – ABATED 2019)

WP-01 **(LOCATED ON PAGE 111)**
HOMOGENEOUS AREA - GRAY WINDOW GLAZING
OUTSIDE PRINCIPAL'S OFFICE
10 SQUARE FEET
TESTED-POSITIVE
(WINDOW GLAZING OUTSIDE OFFICE,CR'S 1,2,3 – ABATED 2019)
(All remaining windows Abated 2022)

LN-01 **(LOCATED ON PAGE 114)**
HOMOGENEOUS AREA - BLUE TERRAZZO PATTERN LINOLEUM
W/FIBROUS BACKING
BOYS' RESTROOMS
16 SQUARE FEET
TESTED-NEGATIVE

CMU-1 **(LOCATED ON PAGE 116)**
HOMOGENEOUS AREA – CONCRETE MASONRY UNIT
THROUGHOUT BUILDING
QUANTITY UNKNOWN
TESTED-NEGATIVE

Early Childhood Center

Homogeneous Area ID: FT-1

(FLOOR TILE/MASTIC IN OFFICE AREA – NURSE ROOM, RESTROOMS, WORKROOM ABATED 2003)

(FLOOR TILE/MASTIC IN ½ OF CLASSROOM #16 ABATED 2003 – 9″ X 9″ TILE/MASTIC REMAINS UNDER CARPETED AREA)

Description: 9″ x 9″ Floor Tile W/Black Mastic
Functional Space: Classroom #16, Nurse Office, Restrooms, Workroom, Kitchen & P. E. Office
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	800 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	400 Square Feet
Average People/Hr:	3
Population:	Administration
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	3,240
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic In Office Area – Nurse Room, Restrooms, Workroom Abated 2003)

(Floor Tile/Mastic In ½ Of Classroom #16 Abated 2003 – 9″ X 9″ Tile/Mastic Remains Under Carpeted Area)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-2

(FLOOR TILE - ABATED 1992)
(WEST 1/3 OF OFFICE REMAINS)
(TEACHER LOUNGE – ABATED 2012)
(ALL OFFICE AREA – ABATED – 2019)

Description:	Floor Tile Covered By Carpet
Functional Space:	Administration & Teacher Lounge
Date Inspected:	04-27-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	09.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	750 Square Feet
Assumed ACM:	No Condition: Good
Results From Sample ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category:	N/A
Hazard Rank:	N/A

**** Bulk Sample Information ****

Sample Number:	**FT-12-01**
Location:	Northeast Corner Teacher's Room
Date Sampled:	04-16-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	750 Square Feet
Average People/Hr:	6
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	200
Person-Hours/Year:	9,600
Preventive Measures:	**NONE REQUIRED**

(Floor Tile - Abated 1992 - West 1/3 Of Office Remains)
(Floor Tile/Mastic – Teachers Lounge – Abated 2012)
(ALL OFFICE AREA – ABATED – 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-5

(FLOOR TILE/MASTIC - ABATED 2003)

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Corridors
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	3,049 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-03-01**
Location:	Corridor Outside All Purpose Room #1
Date Sampled:	04-16-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-02**
Location:	Corridor, At Entry To Classroom #4
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	3,049 Square Feet
Average People/Hr:	150
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-8

(FLOOR TILE/MASTIC - BOILER ROOM - ABATED 1999)

Description: Floor Tile W/Black Mastic
Functional Space: Boiler Room
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 620 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: < 10%
Accessible: High
Potential For Contact: High
Influence Of Vibration: High
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- DCM Report Dated: 09-23-1988
1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**-5**
Location:	5-Feet North Of Entrance
Date Sampled:	08-22-1988
Asbestos Content:	**8.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-23-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 West 24th Place Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**SFT-8B**
Location:	5-Feet North Of Entrance
Date Sampled:	07-20-1988
Asbestos Content:	**10.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-23-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 West 24th Place Golden, CO 80401
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**FT-14-01**
Location:	Center, Boiler Room
Date Sampled:	04-16-1996
Asbestos Content:	**3.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	620 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Boiler Room - Abated 1999)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-01

(FLOOR TILE/MASTIC - ABATED 1998 & 2003)

Description: Beige 9” x 9” Floor Tile W/Black Mastic
Functional Space: Gymnasium & Stage
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	4,600 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-01-01**
Location:	Northeast Corner Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-02**
Location:	North, Center Along Wall, Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-03**
Location:	West Side Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	4,000 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 1998 & 2003)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-03

(FLOOR TILE/MASTIC - CLASSROOMS 11, 12, 13, & 14 - ABATED 2005)
(ALL REMAINGING CLASSROOMS –ABATED 2019)

Description: Tan 9” x 9” Floor Tile W/Black Mastic
Functional Space: Classrooms (Under Carpet)
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	12,111 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-03-01**
Location:	Corridor, Outside All Purpose, Room #1
Date Sampled:	04-16-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-02**
Location:	Corridor, At Entry Classroom #4
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-03**
Location:	Closet, Classroom #3
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	12,111 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**NONE REQUIRED**

(Floor Tile/Mastic - Classrooms #11, 12, 13, & 14 - Abated 2005)
(ALL REMAINGING CLASSROOMS –ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-04

(FLOOR TILE/MASTIC - ABATED 2003)

Description:	Gray 9” x 9” Floor Tile W/White & Gray Streaks & Black Mastic
Functional Space:	Corridors & Vestibule
Date Inspected:	04-27-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	09.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	854 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-04-01**
Location:	Corridor, Outside Classroom #4
Date Sampled:	04-16-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-04-02**
Location:	Corridor, Outside Classroom #3
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-04-03**
Location:	Vestibule, Classroom #12
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	854 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-09

(KITCHEN –ABATED 2019)

Description: Tan Mottled 12” x 12” Floor Tile W/Black Mastic
Functional Space: Kitchen
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 80 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-09-01**
Location:	Center, Kitchen Storage
Date Sampled:	04-16-1996
Asbestos Content:	**3.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-09-02**
Location:	Vestibule, Outside Classroom #10
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-09-03**
Location:	Entry, Storage South Of Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	80 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**NONE REQUIRED**

(KITCHEN –ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-10

(LIBRARY –ABATED 2019)

Description:	Orange & Red Floor Tile Under Carpet W/Tan Adhesive
Functional Space:	Library
Date Inspected:	04-27-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	09.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	1,470 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-10-01**
Location:	Center, Library
Date Sampled:	04-16-1996
Asbestos Content:	**3.0% Total - Floor Tile**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,470 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**NONE REQUIRED**

(LIBRARY –ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-11

(FLOOR TILE/MASTIC - ABATED 2005)

Description:	Blue-Green 9” x 9” Floor Tile W/White & Black Streaks & Black Mastic
Functional Space:	Classroom #13 & Closet
Date Inspected:	04-27-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	09.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	9 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-11-01**
Location:	Closet, Classroom #13
Date Sampled:	04-16-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	9 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2005)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-13

(FLOOR TILE/MASTIC - ABATED 2003)

Description: 12” x 12” Brown Floor Tile W/Black & White Specks & Tan Adhesive
Functional Space: Gymnasium Storage Area
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	180 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-13-01**
Location:	North Center, Storage South Of Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	**2.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-13-02**
Location:	South Center, Storage South Of Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	180 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-1

Description: 2.5’ x 7.5’ Ceiling Tile
Functional Space: Classrooms, Gymnasium & Boiler Room
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	15,900 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

7 Samples Taken --- ATC Report Dated: 04-25-1990
2 Samples Taken --- DCM Report Dated: 08-26-1988

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**GHE-3-1**
Location:	Center, Boiler Room
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-2**
Location:	Northwest Corner Classroom #14
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-80-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-3**
Location:	Center, Over Window Classroom #12
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-4**
Location:	Southeast Corner Classroom #4
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-5**
Location:	Northeast Corner Classroom #2
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-6**
Location:	Southeast Corner Gymnasium
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-3-7**
Location:	Northwest Corner Gymnasium
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**-1**
Location:	Boiler Room, Ceiling
Date Sampled:	08-01-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-01-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**6 A & B**
Location:	Boiler Room, Ceiling
Date Sampled:	08-01-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-01-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	15,900 Square Feet
Average People/Hr:	440
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	475,200
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-2

Description: 12" x 12" Ceiling Tile
Functional Space: Stage In Gymnasium
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	600 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 04-1990
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**GHE-2-1**
Location:	Center, Stage
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-2-2**
Location:	Closet, Northeast Corner Stage
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-2-3**
Location:	Southwest Corner, Stage Above Breaker Box
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-23-13**
Location:	Gymnasium Stage
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-14**
Location:	Gymnasium Stage
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-15**
Location:	Gymnasium Stage
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	600 Square Feet
Average People/Hr:	10
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	10,800
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-3

Description: 2' x 4' Pinhole Ceiling Tile
Functional Space: Corridors & Administration Offices
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	4,500 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-26-1988
1 Sample Taken --- DCM Report Dated: 09-12-1989
7 Samples Taken --- ATC Report Dated: 04-25-1990
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SCT-3**
Location:	Corridors
Date Sampled:	08-1-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-1-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**-5R**
Location:	Office Ceiling Tile
Date Sampled:	09-11-1989
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-12-1989
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**GHE-5-1**
Location:	West Central Wall Outside, Main Office
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, Colorado 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-5-2**
Location:	Above Door, South Entrance, Main Office
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-5-3**
Location:	Northwest Corner Teacher's Workroom
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-5-4**
Location:	Hallway East Central Entrance
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, Colorado 80211
Telephone:	303-480-0209

EPA/NBS Accred Lab: 1081-01

Sample Number:	**GHE-5-5**
Location:	Southeast, Entrance Hallway
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, Colorado 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-5-6**
Location:	Center, Hallway Outside Kitchen
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, Colorado 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-5-7**
Location:	Southwest Entrance
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Avenue Denver, Colorado 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-23-16**
Location:	Corridors
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-17**
Location:	Corridors
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-18**
Location:	Corridors
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	4,500 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-4

Description: 2' x 4' Fissured Ceiling Tile
Functional Space: Storage Room, Corridor & Vestibules
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	1,005 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Yes
Potential For Contact:	Moderate
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes

Manner Of Sampling:

5 Random Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**GHE-4-1**
Location:	Above Door, Storage Area South Of Stage
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-4-2**
Location:	Above Door East Central Entrance
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-4-3**
Location:	West Central Entrance
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-4-4**
Location:	Above Door Outside Main Office
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-4-5**
Location:	Above Door, Outside Gymnasium, West Entrance
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,005 Square Feet
Average People/Hr:	25
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-01

Description: White 2’ x 4’ Random Fissure Large/Small Perforated Ceiling Panel
Functional Space: Gymnasium
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	3,840 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**CT-01-01**
Location:	Center Of Storage South Of Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	3,840 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-02

Description: White 2’ x 4’ Random Fissure Large/Small Perforated Ceiling Panels
Functional Space: Gymnasium, Corridor & Classroom #16
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	1,100 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**CT-02-01**
Location:	Center, Storage South Of Gymnasium
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-02-02**
Location:	Corridor, Outside Boy's Restroom, East Side
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-02-03**
Location:	Corridor, Outside Classroom #16
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,100 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-03

Description: White 12" x 12" Ceiling Tile
With Small And Large Perforated
Functional Space: Corridor & Classroom #16
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	1,100 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**CT-03-01**
Location:	Center, Platform Area
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**CT-03-02**
Location:	Center, North Platform Area
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	880 Square Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-04

Description: White 12” x 12” Ceiling Tile With Small & Large Perforated
Functional Space: Stage
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	Replacement Tile
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**CT-04-01**
Location:	Center, Platform Area
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	Replacement Tile
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-1

(TSI - ABATED 1998)

Description: Thermal Insulation On Elbows
Functional Space: Boiler Room
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 10 Linear Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: High
Potential For Air Erosion: Moderate
Disturbance Potential: Moderate
Air Flow In Area: No
Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-01-1988
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**STSI-1 Number #7**
Location:	Boiler Room
Date Sampled:	07-20-1988
Asbestos Content:	**5.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-01-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place
	Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**10-23-01**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-02**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-03**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	10 Linear Feet
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

(TSI - Abated 1998)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-2

(TSI - ABATED 1998)

Description: Thermal System Insulation
Functional Space: Boiler Room
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 4381
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 80 Linear Feet
Assumed ACM: No Condition: Significantly Damaged
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: Low
Accessible: High
Potential For Contact: Moderate
Influence Of Vibration: High
Potential For Air Erosion: High
Disturbance Potential: Moderate
Air Flow In Area: No
Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-1988
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**STSI-2, Number #4**
Location:	Tunnel Piping
Date Sampled:	08-01-1988
Asbestos Content:	**70.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-01-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place
	Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**10-23-04**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-05**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-06**
Location:	Main Boiler Room
Date Sampled:	10-23-1992
Asbestos content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	80 Linear Feet
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**None Required**

(TSI - Abated 1998)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-1T

Description: Thermal Insulation On Heat Piping
Functional Space: Pipe Tunnel
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	50 Linear Feet
Assumed ACM:	No Condition: Damaged
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Thermal System Insulation
Extent Of Damage:	Low
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	No

Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-26-1988
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**STSI-2**
Location:	Tunnel Piping
Date Sampled:	08-01-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-01-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305

Sample Number:	**10-23-07**
Location:	Main Boiler Room Pipe Fittings
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-08**
Location:	Main Boiler Room Pipe Fittings
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-09**
Location:	Main Boiler Room Pipe Fittings
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	80 Linear Feet
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	1
Average Days/Year:	1
Person-Hours/Year:	8
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: WES-1

Description: White End Sealant On Piping
Functional Space: Throughout Building
Date Inspected: 07-28-2010
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 07-28-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**09-10-B008**
Location:	Boiler Room East Side
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B009**
Location:	Boiler Room Northeast Side
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B010**
Location:	Boiler Room West Side
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-1

(DOOR - ABATED 1995)

Description: Material With-In Fire Rated Door
Functional Space: Boiler Room
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 1 Door
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: No
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 01-30-1995

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**09-95-B001**
Location:	Interior Boiler Room Door
Date Sampled:	01-30-1995
Asbestos Content:	**45.0% Total**
Asbestos Type:	**Chrysotile/Amosite**
Analysis Date:	02-07-1995
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	05147-0128

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1 Door
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

(Door - Abated 1995)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-2

(NO SUSPECT MATERIAL WITH-IN DOORS)

Description: Exterior Fire Doors
Functional Space: Throughout Building
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	9 Doors
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Moderate
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	No
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	9 Doors
Average People/Hr:	150
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	27,000
Preventive Measures:	**None Required**

(No Suspect Material With-In Doors)

----- Recommended Response ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: DWWC-1

Description: Drywall Wall & Ceiling W/Joint Compound
Functional Space: Stage, Storage & Vestibules
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	1,500 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**GHE-1-1**
Location:	West Hallway, Inside Door South Side, Above Door
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-1-2**
Location:	East Central Hallway, Breezeway Wall South Side, Above Drop Ceiling
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-1-3**
Location:	Storage Room, Behind PE Office Center, Top Of Wall
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209

EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-1-4**
Location:	Center, Stage Above, Ceiling Tiles
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-1-5**
Location:	Northeast Corner Closet Stage, Above Ceiling Tile
Date Sampled:	04-05-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-05-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,500 Square Feet
Average People/hr:	50
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	54,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: PC-6

Description: Plaster Ceiling
Functional Space: Restrooms, Electrical Room, & Kitchen
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	2,500 Square Feet
Assumed ACM:	No Condition: Damaged
Results From Sampled ACM:	**Trace**
Friable:	No
Material:	Surfacing Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-1-1988
4 Samples Taken --- ATC Report Dated: 09-1990
3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SC-5, 2 A & B**
Location:	Kitchen & Restroom
Date Sampled:	08-1-1988
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-26-1988
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	12975 W. 24th Place Golden, CO 80401
Telephone:	303-237-0110
EPA/NBS Accred Lab:	305
Sample Number:	**GHE-6-1**
Location:	Kitchen, Southeast Of Fan Hood
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01
Sample Number:	**GHE-6-2**
Location:	North Corner Janitor's Closet
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-6-3**
Location:	Above Door, Northwest Girls Restroom
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**GHE-6-4**
Location:	East, Teacher Restroom
Date Sampled:	04-25-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-25-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	303-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**10-23-10**
Location:	Kitchen
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-11**
Location:	Boys' Restroom
Date Sampled:	10-23-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Chrysotile**
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-12**
Location:	Girls' Restroom
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	2,500 Square Feet
Average People/Hr:	10
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	8,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CB-1

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description: Chalkboard
Functional Space: Classrooms
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	1,536 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,536 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(No Suspect Material With-In Chalkboards)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-1

Description: Cove Base W/Adhesive
Functional Space: Throughout Building
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive (Adhesive)**
Friable: No
Material: Miscellaneous
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**10-23-19**
Location:	Throughout Building
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-20**
Location:	Throughout Building
Date Sampled:	10-23-1992
Asbestos Content:	**Trace / 3.0%**
Asbestos Type:	**Chrysotile/Chrysotile (Adhesive)**
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-21**
Location:	Throughout Building
Date Sampled:	10-23-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	500 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance (Adhesive Only)**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: WP-1

(WINDOWS IN CLASSROOMS 1, 2, 3 AND FRONT ENTRANCE– ABATED 2019)
(All Remaining INDOWS IN CLASSROOMS-ABATED 2022)

Description: Window Putty
Functional Space: Classrooms
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 100 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-23-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-23-22**
Location:	Classroom #13
Date Sampled:	10-23-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-23**
Location:	Classroom #10
Date Sampled:	10-23-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

Sample Number:	**10-23-24**
Location:	Computer Room
Date Sampled:	10-23-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite/Actinolite**
Analysis Date:	10-29-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	5147-056

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	100 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(WINDOWS IN CLASSROOMS 1, 2, 3 AND FRONT ENTRANCE– ABATED 2019)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: WP-01

(WINDOWS IN CLASSROOMS 1, 2, 3 AND FRONT ENTRANCE– ABATED 2019)

Description: Gray Window Glazing
Functional Space: Outside Principal's Office
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 10 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Miscellaneous
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**WP-01-01**
Location:	Window, Outside Principal's Office
Date Sampled:	04-16-1996
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-02**
Location:	East Window Classroom #3
Date Sampled:	04-16-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-03**
Location:	East Window Classroom #3
Date Sampled:	04-16-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	10 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(WINDOWS IN CLASSROOMS 1, 2, 3 AND FRONT ENTRANCE– ABATED 2019)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: LN-01

Description: Blue Terrazzo Pattern Linoleum With Fibrous Backing
Functional Space: Boy's Restroom
Date Inspected: 04-27-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	16 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**LN-01-01**
Location:	Urinal Stage, Boy's Restroom
Date Sampled:	04-16-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-22-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	303-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	16 Square Feet
Average People/Hr:	6
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	6,480
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CMU-1

Description: Concrete Masonry Unit
Functional Space: Throughout Building
Date Inspected: 07-28-2010
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 09.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 150,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Surfacing Material
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- Reservoirs Report Dated: 07-28-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**09-10-B001**
Location:	South Doorway, Stage
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B002**
Location:	Northeast Vestibule
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B003**
Location:	Classroom 15 Southeast Corner
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B004**
Location:	Classroom 12 Southeast Corner
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B005**
Location:	Classroom 7 Southeast Corner
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**09-10-B006**
Location:	Classroom 4 Southwest Corner
Date Sampled:	07-19-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street, Suite 100 Denver, CO 80216
Telephone:	303-964-1986

EPA/NBS Accred Lab: 101533-480

Sample Number: **09-10-B007**
Location: West Boy's Restroom
Northeast Corner
Date Sampled: 07-19-2010
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 07-28-2010

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street, Suite 100
Denver, CO 80216
Telephone: 303-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank: N/A
Quantity: 150,000 Square Feet
Average People/Hr: 30
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

5.4 Prioritized Listing Of Homogeneous Materials & Salients

Early Childhood Center

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
FT-1	Room #16, Nurse, Restrooms, Workroom Kitchen & P. E. Office	N/A	3,240	$0
FT-2	Administration & Teacher Lounge	N/A	9,600	$0
FT-5	Corridors	N/A	27,000	$0
FT-8	Boiler Room	N/A	2,160	$0
FT-01	Gym & Stage	N/A	2,160	$0
FT-03	Classrooms	N/A	2,160	$0
FT-04	Corridors & Vestibules	N/A	2,160	$0
FT-09	Kitchen	N/A	2,160	$0
FT-10	Library	N/A	2,160	$0
FT-11	Classroom (#13) & Closet	N/A	2,160	$0
FT-13	Gym Storage Area	N/A	2,160	$0
CT-1	Classrooms, Gym, Boiler Room	N/A	475,200	$0
CT-2	Stage In Gym	N/A	10,800	$0
CT-3	Corridors	N/A	27,000	$0

CT-4	Storage Room, Corridor, & Vestibules	N/A	27,000	$0
CT-01	Gymnasium	N/A	2,160	$0
CT-02	Gymnasium, Corridor & Room #16	N/A	2,160	$0
CT-03	Corridor & Room #16	N/A	2,160	$0
CT-04	Stage	N/A	2,160	$0
TSI-1	Boiler Room	N/A	180	$0
TSI-2	Boiler Room	N/A	180	$0
TSI-1T	Pipe Tunnel	N/A	8	$0

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
WES-1	Throughout Building	N/A	1,080	$0
FD-1	Boiler Room	N/A	1,080	$0
FD-2	Throughout Building	N/A	27,000	$0
DWWC-1	Stage, Storage, & Vestibules	N/A	54,000	$0
PC-6	Restrooms, Electrical & Kitchen	N/A	32,400	$0
CB-1	Classrooms	N/A	32,400	$0
BC-1	Throughout Building	7	32,400	$0
WP-1	Classrooms	N/A	32,400	$0
WP-01	Principal's Office	N/A	32,400	$0
LN-01	Boy's Restroom	N/A	6,480	$0
CMU-1	Throughout Building	N/A	32,400	$0

Total Cost Of Recommended Actions: $0

5.5 Floor Plans

EARLY CHILDHOOD CENTER
TABLE OF CONTENT FOR DRAWINGS

FILE - 09F1

LAYER
1 MASTER
2 - 10 OPEN

FILE - WALL
LAYER
1 DWW-1
2 - 9 OPEN
10 MASTER

FILE - CT

LAYER
1 CT-2
2 CT-3
3 PC-6
4 OPEN
5 CT-1
6 CT-4
8 OPEN
9 OPEN
10 MASTER
10 MASTER

FILE - FT1-9
LAYER
1 FT-4
2 OPEN
3 FT-7
4 FT-8
5 FT-5
6 LN-1
7 FT-1
8 FTM-1
9 OPEN
10 MASTER

FILE - MISC
LAYER
1 TSI-1
2 TSI-2
3 TSI-1T
4 FD-1
5 CB-1
6 BC-1
7 WP-1
8 FD-2
9 OPEN
10 MASTER