5.0 AHERA RE-INSPECTION SUMMARIES & RISK ASSESSMENTS

5.1 AHERA Re-Inspection

5.1.1 Re-Inspection Information & Procedures

The undersigned has completed the inspection for this (or these) building(s) and have met the requirements stated in 40 CFR 763.85 (A), (B), (C), (D), and (E), SUBPART E. The building's identification and date of inspection are mentioned throughout this section (5) of the Asbestos Management Plan.

Inspectors Signature _____
Kyle C. Baber Accreditation Number: 0910
Eric J. Havelick Accreditation Number: DR090691-02 AM
Brandon Ramer Accreditation Number: 4766
Rick Seiler Accreditation Number: 3481
Darren Trujillo Accreditation Number: 22590

The inspectors conducted a review of the construction records, including available plans and specifications, in an effort to discover any materials specified as asbestos containing. The construction chronology was researched to define areas containing like materials. Different construction areas, which contain like-appearing materials, would require separate sampling to evaluate asbestos content. Common usage room names and numbers were determined for use in this plan.

Schematic drawings were made of the building, which indicates buildings, additions or construction areas, functional spaces/rooms, homogeneous areas, salient, and sample locations. These drawings are attached to this report in Section 5.5.

Every accessible internal space in the buildings was toured and observed during inspections. The Inspectors attempted to discover and record any material suspected of containing asbestos. All suspected material discovered was tested by physical hand pressure to determine whether or not the material was friable. An assessment of the material's condition and potential for disturbance or damage was made based upon the inspector’s experience and judgment.

Inspection procedures were conducted in accordance with the requirements of the AHERA regulations to the best of the contributing inspector's abilities.

5.1.2 AHERA Re-Inspection Report Summaries

Certified Inspectors performed all inspecting and bulk sampling. The work was not delegated in any way to non-certified personnel.

All bulk samples were tested using polarized light microscopy (PLM), EPA interim method using dispersion staining, to determine the asbestos content.

5.2 Classifying The Condition Of Suspect Material

5.2.1 AHERA Category Physical Assessment

AHERA Category	Definition
1. - - - - -	Damaged or significantly damaged friable thermal system insulation.
2. - - - - -	Damaged friable surfacing ACM.
3. - - - - -	Significantly damaged friable surfacing ACM.
4. - - - - -	Damaged or significantly damaged friable miscellaneous ACM.
5. - - - - -	ACBM with potential for damage.
6. - - - - -	ACBM with potential for significant damage.
7. - - - - -	Any remaining friable ACBM or friable suspected ACBM.

5.2.2 Suspect Asbestos-Containing Surfacing & Miscellaneous Material

Significantly Damaged

Material with one or more of the following characteristics:

The surface crumbing or blistered over at least one tenth of the area if the damage is evenly distributed, or at least one quarter if the damage is localized.

One tenth (one quarter, if localized) of material hanging from the surface, deteriorated, or showing adhesive failure.

Water stains or gouges, or mars over at least one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Damaged

Material with the following characteristics:

The surface blistered, crumbling, water stained, or gouged, marred or otherwise abraded over less than one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.3 Suspect Asbestos-Containing Thermal Insulation

Significantly Damaged

Material with one or more of the following characteristics:

Missing jackets on at least one tenth of the piping or equipment.

Crushed or heavily gouged or punctured insulation on at least one tenth of pipe runs/risers, boiler, tank, duct, etc., if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Damaged

Material with one or more of the following characteristics:

A few water stains or less than one tenth of the insulation with missing jackets.

Crushed insulation or water stains, gouges, punctures, or mars on up to one tenth of the insulation if the damage is evenly distributed (or up to one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.4 Factors Used To Determine The Potential For Disturbance

Potential For Contact With The Material: Accessible -- when referring to ACM means that the material is subject to disturbance by school or building occupants or custodial or maintenance personnel in the course of their normal activities.

High:	Service workers work in the vicinity of the material more than once per week, or
	The material is in a public area (e.g., hallway, corridor, auditorium) and accessible to building occupants.
Moderate:	Service workers work in the vicinity of the material once per month to once per week, or
	The material is in a room or office and accessible to the occupants.
Low:	Service workers work in the vicinity of the material less than once per month, or
	The material is visible but not within reach of building occupants.

Influence Of Vibration: Vibration -- means the periodic motion of friable ACM, which may result in the release of asbestos fibers.

High:	Loud motors or engines present (e.g. some fan rooms), or
	Intrusive noises or easily sensed vibrations e.g., major airports, a major highway).
Moderate:	Motors or engines present, not obtrusive e.g., ducts vibrating but no fan in the area) or Occasional loud sounds.

Low/None	None of the above.

Potential For Air Erosion: Air Erosion -- means the passage of air over friable ACBM which may result in the release of asbestos fibers.

High:	High velocity air (e.g., elevator shaft, fan room).
Moderate:	Noticeable movement of air (e.g., air shaft, ventilator air stream).
Low/None	None of the above.

5.2.5 Determination Of Potential For Disturbance

High Disturbance -- ACM which ranks "high" in any one of potential for contact, Influence of vibration, or potential for air erosion.

Examples are (1) acoustical plaster on a low ceiling in a high school band room, (2) thermal system insulation on air ducts connected to ventilation fans and readily accessible to workers conducting maintenance on the ventilation system, and (3) fireproofing on structural members or metal/concrete decks in a return air plenum.


Moderate Disturbance -- ACM which ranks "moderate" in any one potential for contact, Influence of vibration, or potential for air erosion.

Examples are ACM on corridor walls, on a ceiling underneath a gymnasium, or in an elevator shaft.

Low Disturbance -- ACM which ranks "low" in all three of potential for contact, Influence of vibration, or potential for air erosion.

5.2.6 Response Action Category Determination

The following decision tree was used to determine the Response Action Category.....

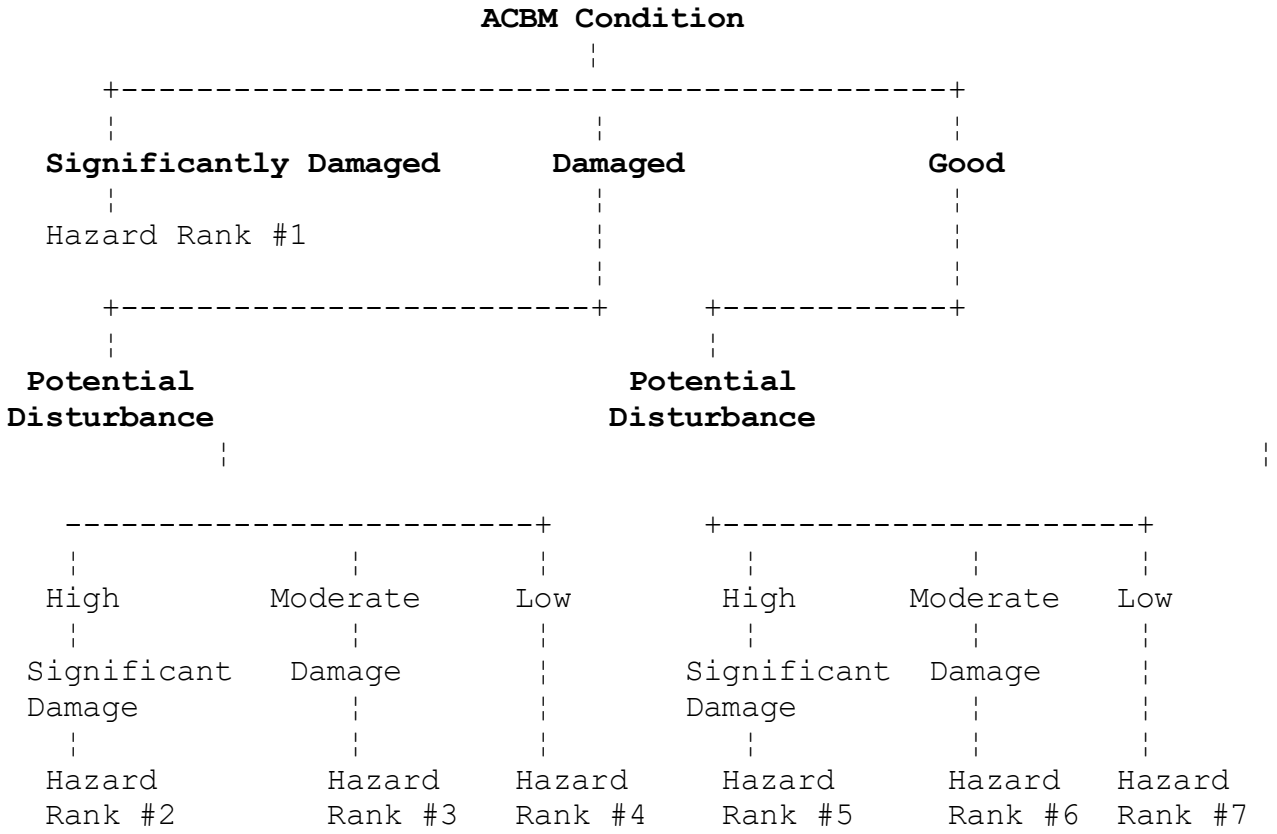

Response Actions Based On Hazard Ranking

Hazard Rank	Response Action Categories	Response Action Required By AHERA
1	Significantly Damaged	Evacuate or isolate the area if needed. Remove the ACBM (or encapsulate if sufficient to contain fibers). Repair of thermal system insulation is allowed if feasible and safe. O&M required for all friable ACBM.
2	Damaged + High Potential For Significant Damage	Evacuate or isolate the area if needed. Remove, enclose, encapsulate, or repair to correct damage. Take steps to reduce potential for disturbance. O&M required for all friable ACBM.
3	Damaged + Moderate Potential For Damage	Remove, enclose, encapsulate, or repair to correct damage. O&M required for all friable ACBM.
4	Damaged	Same as Hazard Rank 3.
5	Good + High Potential For Significant Damage	Evacuate or isolate the area if needed. Take steps to reduce potential for disturbance. O&M required for all friable ACBM and TSI.
6	Good + Moderate Potential For Damage	O&M required for all friable ACBM and TSI.
7	All	O&M required for all ACBM,

Remaining	but measures need not be as extensive as above.

5.3 ACBM Descriptive Log & Summary Of Areas

The areas are organized by functional space within the building. The Homogeneous Area, Hazard Assessment Rank and Response Action have been identified.

Pages 14 through 22 list the homogeneous areas in the order they appear in this report and as detailed on the blue print for this building. Also shown are the type of material, the description of the area, and the square footage of the area.

Homogeneous Area Acronyms		**Autosketch File Name**
ACM-	Asbestos Containing Material	Misc.
BC-	Base Cove	Misc.
CB-	Chalk Boards	Misc.
CBM-	Chalk Board Mastic	Misc.
CBP-	Cinder Block Patch	Misc.
CM-	Ceiling Mastic	CT
CMS-	Ceiling Material Sprayed On	CT
CMU-	Concrete Masonry Unit	Misc.
CORK-	Cork Tile	Misc.
CT-	Ceiling Tile	CT
CTDW-	Ceiling Tile Drywall	CT
CTW-	Ceiling Tile Walls	Wall
DWC-	Drywall Ceiling	CT
DWW-	Drywall Wall	Wall
DWWC-	Drywall Wall & Ceiling	Wall
FD-	Fire Doors	Misc.
FT-	Floor Tile	FT
FTM-	Floor Tile Mastic	FT
GVW-	Grey Vinyl Window Replacement	Misc.
LN-	Linoleum	FT
PC-	Plaster Ceiling	CT
PW-	Plaster Wall	Wall
PWC-	Plaster Wall & Ceiling	Wall
RS-	Shingle Roof	Misc.
STM-	Stair Tread Mastic	Misc.
TM-	Transite Material	Misc.
TSI-	Thermal System Insulation	Misc.

WES-	White End Sealant	Misc.
WP-	Window Putty	Misc.
BRR-	Black Rolled Roofing	Misc.

Additional Homogeneous Area Titles Created In 1991:

Homogeneous Area Floor Tile FT-1A.
Homogeneous Area Floor Tile FT-3A.
Homogeneous Area Floor Tile FT-4A.
Homogeneous Area Floor Tile FT-5A.
Homogeneous Area Fire Door FD-1A.

Changes In Homogeneous Area Titles From 1990 ATC Report:

Homogeneous Area Ceiling Tile CT-5 was Homogeneous Area 5.
Homogeneous Area Ceiling Tile CT-7 was Homogeneous Area 7.
Homogeneous Area Ceiling Tile CT-2 was Homogeneous Area 2.
Homogeneous Area Ceiling Tile CT-3 was Homogeneous Area 3.
Homogeneous Area Ceiling Tile CT-1 was Homogeneous Area 1.
Homogeneous Area Drywall Ceiling DWC-6 was Homogeneous Area 6.
Homogeneous Area Plaster Ceiling PC-4 was Homogeneous Area 4.
Homogeneous Area Drywall Wall DWW-8 was Homogeneous Area 8.

Changes In Homogeneous Area Titles From 1994 Report:

Homogeneous Area DWWC-8 was Homogeneous Area DWW-8.
Homogeneous Area FD-2 was created.
Homogeneous Area FD-2A was created.
Homogeneous Area FT-3A was incorporated into FT-4A.

Changes In Homogeneous Area Titles From 1996 Report:

Homogeneous Area TSI-01 through TSI-03 has been created.
Homogeneous Area VD-01 has been created.
Homogeneous Areas FT-01 through FT-08 has been created.
Homogeneous Areas FT-1A and FT-4A have been changed to FT-15 & FT-10.
Homogeneous Areas FT-09 through FT-16 has been created.
Homogeneous Area WD-01 has been created.
Homogeneous DWC-01 has been created.
Homogeneous Area FD-1 has been changed to FD-01.
Homogeneous Areas BC-01 through BC-05 has been created.
Homogeneous Areas WP-02 and WP-03 have been created.
Homogeneous Area CTA-01 has been created.

Changes In Homogeneous Area Titles From 2005 Update:

Homogeneous Area FT-1 incorporated into FT-2.
Homogeneous Area FT-8 incorporated into FT-12.
Homogeneous Area FT-4A incorporated into FT-16.
Homogeneous Area FT-13A incorporated into FT-03.
Homogeneous Area FT-15 incorporated into FT-13.
Homogeneous Area FT-5A incorporated into FT-13.
Homogeneous Area BC-03 incorporated into BC-1.
Homogeneous Area FT-07 incorporated into FT-03.

Changes In Homogeneous Area Titles From 2008 Update:

Homogeneous Area CMU-1 has been created.
Homogeneous Area WES-1 has been created.

Changes In Homogeneous Area Titles From 2012 Update:

Homogeneous Area FT-3 - Classroom 9" X 9" Floor Tile & Black Mastic incorporated into FT-01.
Homogeneous Area FT-4 - Classroom Floor Tile Covered by Carpet incorporated into FT-01.
Homogeneous Area DWC-01 – Annex Building White Drywall W/Joint Compound incorporated into DWC-6.
Homogeneous Area PC-4 – Plaster Ceiling incorporated into DWWC-8.

Changes In Homogeneous Area Titles From 2013 Update:

Homogeneous Area BC-01 incorporated into BC-1. (Both Homogeneous Areas were Brown Cove Base W/Tan Adhesive in the Main building, built in the same time frame)
Homogeneous Area TSI-04 has been created. (Brown Boiler Block)
Homogeneous Area TSI-05 has been created. (White Boiler Block)

Changes In Homogeneous Area Titles From 2014 Update:

Homogeneous Area BRR-1 has been created. (Black Rolled Roofing)
Homogeneous Area CBM-2 has been created. (Chalkboard Mastic - Brown)

Homogeneous Area CBM-3 has been created. (Chalkboard Mastic - Gray) Homogeneous Area FT-06 Remedial Reading that is now Teacher's Lounge on school map was incorporated into FT-03.

According to the ATC Project Surveillance Report dated August 1991, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Classrooms 15 & 16	1,500 Square Feet

According to the ATC Project Surveillance Report dated August 1997, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Hallway Outside Classrooms 3 & 4	120 Square Feet
Boiler Seam Caulk	Boiler Room	750 Linear Feet

According to the Higgins & Assoc Project Surveillance Report dated August 2001, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Gymnasium	4,000 Square Feet

According to the Higgins & Assoc Project Surveillance Report dated July 2003, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Main Building	3,070 Square Feet

	Corridors & Annex Corridors	

According to the Blue Mesa Environmental Air Monitoring Report dated June 2013, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Carpet Over Floor Tile & Mastic	Classrooms #7 & #8	1,358 Square Feet

Complete Abatement Services LLC. Removed the following Asbestos Containing Materials on June 3, 2014:

Material	Location	Approx. Quantity
2-Vibration Dampeners	Classrooms #10 (Stage)	2" x 24'
Carpet Over Floor Tile & Mastic	Annex Building Kitchen Storeroom	100 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report dated June 2019, the following Asbestos Containing Materials have been removed:

Material	Location	Approx. Quantity
Carpet Over Floor Tile & Mastic	All Office Area	623 Square Feet
Carpet Over carpet Floor Tile & Mastic	All Office Area	464 Square Feet
Window Glazing	All Office Windows	3 banks

According to the Blue Mesa Environmental Air Monitoring Report dated January 2020, the following Asbestos Containing Materials have been removed:

Material	**Location**	**Approx. Quantity**
Floor Tile Mastic	Kitchen	475 Square Feet
Carpet Over carpet Floor Tile & Mastic	Library	1083 Square Feet
CMU	All internal office walls and Office South wall	1098 Square feet

The Homogeneous Areas Are In Consecutive Order As In The Following Report.

CT-1 (**LOCATED ON PAGE 23)**
HOMOGENEOUS AREA - 12" x 12" PERFORATED CEILING TILE
HALLWAYS & OFFICE
4,875 SQUARE FEET
TESTED-NEGATIVE

CT-2 (**LOCATED ON PAGE 27)**
HOMOGENEOUS AREA - 2' x 4' CEILING TILE
FOYER SOUTHEAST OF GYMNASIUM & CLASSROOM WEST OF GYMNASIUM
1,200 SQUARE FEET
TESTED-NEGATIVE

CT-3 (**LOCATED ON PAGE 31)**
HOMOGENEOUS AREA - 2.5' x 7.5' LAYERED TECTUM CEILING
GYMNASIUM & CLASSROOMS
11,650 SQUARE FEET
TESTED-NEGATIVE

CT-5 (**LOCATED ON PAGE 36)**
HOMOGENEOUS AREA -12" x 12" SOLID CEILING TILE W/ADHESIVE
ANNEX BUILDING
6,300 SQUARE FEET
TESTED-NEGATIVE

CT-7 (**LOCATED ON PAGE 41)**
HOMOGENEOUS AREA - 12" x 12" FIBERGLASS CEILING TILE
ANNEX KITCHEN
150 SQUARE FEET
TESTED-NEGATIVE

CTA-01 (**LOCATED ON PAGE 44)**
HOMOGENEOUS AREA - BROWN CEILING TILE ADHESIVE
MAIN BUILDING CORRIDOR
WHERE PRESENT ON CEILING
TESTED-NEGATIVE

FT-01 (**LOCATED ON PAGE 47)**

HOMOGENEOUS AREA - BEIGE 9" X 9" FLOOR TILE W/GREEN & RED STREAKS & BLACK MASTIC (UNDER CARPET IN CLASSROOMS)
CLASSROOMS - #2, #6, #10, #11, #12, #13, & #14
5,250 SQUARE FEET
TESTED-POSITIVE

FT-02 (**LOCATED ON PAGE 50)**
HOMOGENEOUS AREA - ORANGE 9" X 9" FLOOR TILE W/BROWN STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOM #15
660 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 1991)

FT-2 (**LOCATED ON PAGE 53)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET
ADMINISTRATIVE AREA
768 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC - ABATED 2019)

FT-03 (**LOCATED ON PAGE 55)**
HOMOGENEOUS AREA - WHITE 9" X 9" FLOOR TILE W/GREEN STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOM #3 & TEACHERS LOUNGE
900 SQUARE FEET
TESTED-POSITIVE
(Lounge FLOOR TILE/MASTIC - ABATED 2019)

FT-04 (**LOCATED ON PAGE 58)**
HOMOGENEOUS AREA - WHITE 9" X 9" FLOOR TILE W/GRAY MOTTLES & BLACK MASTIC (UNDER CARPET)
CLASSROOM #10
750 SQUARE FEET
TESTED-POSITIVE

FT-05 (**LOCATED ON PAGE 61)**
HOMOGENEOUS AREA - BEIGE 9" X 9" FLOOR TILE W/TAN MOTTLES & BLACK MASTIC (UNDER CARPET)
CLASSROOM #16
660 SQUARE FEET
TESTED-POSITIVE

(FLOOR TILE/MASTIC – ABATED 1991)

FT-5 (**LOCATED ON PAGE 63)**
HOMOGENEOUS AREA – 9″ X 9″ FLOOR TILE & BLACK MASTIC
CORRIDORS
2,150 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC - ABATED 2003)

FT-7 (**LOCATED ON PAGE 65)**
HOMOGENEOUS AREA – 9″ X 9″ FLOOR TILE & BLACK MASTIC
GYMNASIUM
3,666 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC - ABATED 2001)

FT-08 (**LOCATED ON PAGE 67)**
HOMOGENEOUS AREA - GRAY 9" X 9" FLOOR TILE W/BLACK
& WHITE STREAKS & BLACK MASTIC (UNDER CARPET)
WORK ROOM
180 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2019)

FT-09 (**LOCATED ON PAGE 70)**
HOMOGENEOUS AREA - TAN MOTTLED FLOOR TILE W/TAN
ADHESIVE & BLACK MASTIC (UNDER CARPET)
LIBRARY #1
1,080 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2019)

FT-10 (**LOCATED ON PAGE 72)**
HOMOGENEOUS AREA - TAN 9" X 9" FLOOR TILE W/BLACK
MASTIC (UNDER CARPET)
CLASSROOMS #7 & #8
1,320 SQUARE FEET
TESTED-POSITIVE

(FLOOR TILE/MASTIC – ABATED 2013)

FT-11 (**LOCATED ON PAGE 74)**
HOMOGENEOUS AREA - LIGHT BROWN 9" X 9" FLOOR TILE W/BLACK & BEIGE STREAKS & BLACK MASTIC
STORE ROOM
96 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2001)

FT-12 (**LOCATED ON PAGE 77)**
HOMOGENEOUS AREA - WHITE 9" X 9" FLOOR TILE W/GRAY STREAKS & BLACK MASTIC
KITCHEN & STORAGE ROOM
464 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2019)

FT-13 (**LOCATED ON PAGE 80)**
HOMOGENEOUS AREA - LIGHT BROWN 9" X 9" FLOOR TILE W/DARK BROWN & BEIGE STREAKS & TAN ADHESIVE
ANNEX BUILDING (CORRIDOR)
620 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2003)

FT-14 (**LOCATED ON PAGE 83)**
HOMOGENEOUS AREA - DARK BROWN 9" X 9" FLOOR TILE W/BEIGE STREAKS & BLACK MASTIC
ANNEX BUILDING (TRIM ALONG EDGE OF CORRIDOR)
96 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC - ABATED 2003)

FT-16 (**LOCATED ON PAGE 86)**
HOMOGENEOUS AREA - GRAY FLOOR TILE UNDER CARPET W/BLACK MASTIC & TAN ADHESIVE
ANNEX BUILDING CLASSROOMS, WORK ROOM & KITCHEN
4,500 SQUARE FEET

TESTED-POSITIVE
(KITCHEN STOREROOM – ABATED 2014)

FD-1 (**LOCATED ON PAGE 88)**
HOMOGENEOUS AREA - MATERIAL WITH-IN FIRE RATED DOOR
BOILER ROOM
1 DOOR
ASSUMED-ACM
(DOOR - ABATED 1996)

FD-1A (**LOCATED ON PAGE 90)**
HOMOGENEOUS AREA - MATERIAL WITH-IN FIRE RATED DOORS
ANNEX BUILDING & ANNEX BOILER ROOM
10 DOORS
NO SUSPECT MATERIAL WITH-IN DOORS

FD-2 (**LOCATED ON PAGE 92)**
HOMOGENEOUS AREA - EXTERIOR FIRE DOORS
THROUGHOUT BUILDING
12 DOORS
ASSUMED-ACM
(DOORS - ABATED 1996 & 1999)

DWC-6 (**LOCATED ON PAGE 94)**
HOMOGENEOUS AREA - DRYWALL CEILING W/JOINT COMPOUND
ANNEX BUILDING - BOILER ROOM, KITCHEN & JANITOR CLOSET
325 SQUARE FEET
TESTED-POSITIVE
(BOILER ROOM & KITCHEN STOREROOM CEILING REMOVED 2014)

DWWC-8 (**LOCATED ON PAGE 100)**
HOMOGENEOUS AREA - DRYWALL WALL & CEILING
W/JOINT COMPOUND
MAIN BUILDING - KITCHEN, RESTROOMS, JANITORIAL CLOSETS & BOILER ROOM STAIRWELL
2,900 SQUARE FEET
TESTED-NEGATIVE

TCM-1 (**LOCATED ON PAGE 106)**
HOMOGENEOUS AREA - GRAY TRANSITE PANEL ABOVE DROP CEILING
WEST VESTIBULE
50 SQUARE FEET
TESTED-POSITIVE

TSI-01 (**LOCATED ON PAGE 108)**
HOMOGENEOUS AREA - GRAY HARD-PACK FITTING W/WHITE CLOTH
JANITOR'S CLOSET
QUANTITY UNKNOWN
ASSUMED-ACM
(MATERIAL HAS BEEN REMOVED)

TSI-02 (**LOCATED ON PAGE 110)**
HOMOGENEOUS AREA - TAN HARD-PACK FITTING W/WHITE CLOTH
KITCHEN STORAGE
QUANTITY UNKNOWN
TESTED-POSITIVE
(MATERIAL HAS BEEN REMOVED)

TSI-03 (**LOCATED ON PAGE 112)**
HOMOGENEOUS AREA - TAN FITTING MATERIAL
MUSIC ROOM (STAGE) & ABOVE CEILINGS
QUANTITY UNKNOWN
TESTED-POSITIVE
(STAGE CEILING - FITTINGS REMOVED)

TSI-04 (**LOCATED ON PAGE 114)**
HOMOGENEOUS AREA – BROWN BOILER BLOCK
BOILER ROOM
30 SQUARE FEET
TESTED-NEGATIVE

TSI-05 (**LOCATED ON PAGE 117)**
HOMOGENEOUS AREA – WHITE BOILER BLOCK
ANNEX BUILDING BOILER ROOM
20 SQUARE FEET
TESTED-NEGATIVE

WES-1 (**LOCATED ON PAGE 120)**
HOMOGENEOUS AREA – WHITE END SEALANT ON PIPING
THROUGHOUT BUILDING
QUANTITY UNKNOWN
TESTED-NEGATIVE

BC-1 (**LOCATED ON PAGE 123)**
HOMOGENEOUS AREA – COVE BASE W/TAN ADHESIVE
THROUGHOUT BUILDING
350 SQUARE FEET
TESTED-NEGATIVE

BC-02 (**LOCATED ON PAGE 127)**
HOMOGENEOUS AREA - BROWN COVE BASE W/TAN ADHESIVE
ANNEX BUILDING
100 SQUARE FEET
TESTED-POSITIVE (ADHESIVE)

WP-01 (**LOCATED ON PAGE 130)**
HOMOGENEOUS AREA – WHITE & GRAY HARD, CRUMBLY WINDOW GLAZING
WINDOWS
WHERE PRESENT AROUND WINDOWS
TESTED-POSITIVE
(OFFICE WINDOW GLAZING - ABATED 2019)

WP-1 (**LOCATED ON PAGE 133)**
HOMOGENEOUS AREA - WINDOW PUTTY
CLASSROOMS
250 SQUARE FEET
TESTED-TRACE

WP-02 (**LOCATED ON PAGE 136)**
HOMOGENEOUS AREA - GRAY WINDOW GLAZING
ANNEX BUILDING WINDOWS
WHERE PRESENT AROUND WINDOWS
TESTED-NEGATIVE

WP-03 (**LOCATED ON PAGE 139)**
HOMOGENEOUS AREA - WHITE WINDOW GLAZING
ANNEX BUILDING WINDOWS
WHERE PRESENT AROUND WINDOWS
TESTED-TRACE

VD-01 (**LOCATED ON PAGE 142)**
HOMOGENEOUS AREA - WHITE CLOTH VIBRATION DAMPENER
MUSIC ROOM #10
2-VIBRATION DAMPENERS
TESTED-POSITIVE
(VIBRATION DAMPENERS ABATED 2014)

CB-1 (**LOCATED ON PAGE 144)**
HOMOGENEOUS AREA - CHALKBOARDS
MAIN BUILDING CLASSROOMS
2,048 SQUARE FEET
NO SUSPECT MATERIAL WITH-IN CHALKBOARDS

CBM-2 (**LOCATED ON PAGE 146)**
HOMOGENEOUS AREA – CHALKBOARDS W/BROWN MASTIC (PUCKS)
ANNEX BUILDING CLASSROOMS #20, #3, #6, #7
320 SQUARE FEET
TESTED-NEGATIVE (MASTIC)
NO SUSPECT MATERIAL WITH-IN CHALKBOARDS

CBM-3 (**LOCATED ON PAGE 149)**
HOMOGENEOUS AREA – CHALKBOARDS W/GRAY MASTIC (PUCKS)
ANNEX BUILDING CLASSROOMS
320 SQUARE FEET
TESTED-POSITIVE (MASTIC)
NO SUSPECT MATERIAL WITH-IN CHALKBOARDS
(MASTIC REMOVED – CLASSROOMS #17, #18, #19 & #21 IN 2014)

CMU-1 (**LOCATED ON PAGE 152)**
HOMOGENEOUS AREA – CONCRETE MASONRY UNIT

THROUGHOUT BUILDING
150,000 SQUARE FEET
TESTED-POSITIVE
(OFFICE WALLS CMU - ABATED 2020)

BRR-1 (**LOCATED ON PAGE 156)**
HOMOGENEOUS AREA – BLACK ROLLED ROOFING W/SEALANT
ROOF TOP
28,000 SQUARE FEET
TESTED-NEGATIVE

Fairview Elementary

Homogeneous Area ID: CT-1

Description: 12" x 12" Perforated Ceiling Tile
Functional Space: Hallways & Office
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 4,875 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: No
Manner Of Sampling:

5 Samples Taken --- Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-1-1**
Location:	North End, North Corridor Outside, Classroom #10
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-1-2**
Location:	Main Corridor, Outside Entrance, Nurse's Office
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-1-3**
Location:	Above Main Entrance East Side
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-1-4**
Location:	Main Hallway, Above Entrance, Classroom #2
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-1-5**
Location:	Main Hallway South Entrance
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	4,875 Square Feet
Average People/Hr:	215
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	309,600
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-2

Description: 2' x 4' Ceiling Tile
Functional Space: Foyer Southeast Of Gymnasium & Classroom West Of Gymnasium
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	1,200 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

5 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-2-1**
Location:	Foyer, Southeast Gymnasium
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-2-2**
Location:	Ceiling, Northeast Corner Classroom #23
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-2-3**
Location:	Ceiling, Southeast Corner Classroom #23
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-2-4**
Location:	Center, South Ceiling Classroom Southwest, Of Gymnasium
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-2-5**
Location:	Southeast Corner, Ceiling Classroom Southwest Of Gymnasium
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,200 Square Feet
Average People/Hr:	300
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	324,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-3

Description: 2.5' x 7.5' Layered Tectum Ceiling
Functional Space: Gymnasium & Classrooms
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	11,650 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

7 Samples Taken --- ATC Report Dated: 04-25-1990
3 Samples Taken --- Reservoirs Report Dated: 03-14-2014

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-3-1**
Location:	Northwest Corner Classroom #4, Above Sink
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-2**
Location:	Northeast Corner Classroom #2
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-3**
Location:	Northwest Corner Classroom #6
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-4**
Location:	Northeast Corner Classroom #9
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-5**
Location:	Southwest Corner Classroom #12
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-6**
Location:	Southwest Corner Classroom #11
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-3-7**
Location:	Northeast Corner Classroom #10
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**08-14-B004**
Location:	Classroom #7 Southeast Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total – (White Plaster Layer)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B005**
Location:	Classroom #7 Southeast Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total – (White Plaster Layer)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B006**
Location:	Classroom #7 Southeast Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total – (White Plaster Layer)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	11,650 Square Feet
Average People/Hr:	300
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	324,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-5

Description: 12" x 12" Solid Ceiling Tile W/Adhesive
Functional Space: Annex Building
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	6,300 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner of Sampling:

7 Samples Taken --- ATC Report Dated: 01-25-1990
3 Samples Taken --- Reservoirs Report Dated: 08-01-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-5-1**
Location:	North Side Ceiling, Center Classroom #17
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-2**
Location:	Hallway Ceiling, Above South Entrance, Annex Building
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-3**
Location:	Ceiling, Southwest Corner Classroom #18
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-4**
Location:	Ceiling, Southwest Corner Classroom #19
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-5**
Location:	Ceiling, Southeast Corner Restroom
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-6**
Location:	Ceiling, Northeast Corner Classroom #16
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-5-7**
Location:	Ceiling, Southeast Corner Classroom #15
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**08-13-B004**
Location:	Boy's Restroom Entrance
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total (Adhesive)
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B005**
Location:	Corridor Outside Mechanical Room
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total (Adhesive)
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B006**
Location:	Classroom #21 Center of Room
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total (Adhesive)
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	6,300 Square Feet
Average People/Hr:	56
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	60,480
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-7

Description: 12" x 12" Fiberglass Ceiling Tile
Functional Space: Annex Kitchen
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	150 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner of Sampling:

3 Samples Taken --- ATC Report Dated: 04-25-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-7-1**
Location:	Ceiling, Southeast Corner Annex Building Kitchen
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-7-2**
Location:	Ceiling, Southwest Corner Annex Building Kitchen
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-7-3**
Location:	Ceiling, Northwest Corner Annex Building Kitchen
Date Sampled:	04-24-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-24-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	150 Square Feet
Average People/Hr:	25
Population:	Administrative
Average Hours/Day:	4
Average Days/Year:	180
Person-Hours/Year:	18,000
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CTA-01

Description: Brown Ceiling Tile Adhesive
Functional Space: Main Building Corridor
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: Where Present On Ceiling
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: Impact: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996
2 Samples Taken --- Reservoirs Report Dated: 08-01-2013

AHERA Category: N/A

Hazard Rank: N/A

----- Bulk Sample Information----------

Sample Number:	**CTA-01-01**
Location:	Southeast Corner Main Corridor
Date Sampled:	04-04-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	11-15-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031
Sample Number:	**08-13-B002**
Location:	Corridor Outside Classroom #10
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480
Sample Number:	**08-13-B003**
Location:	Corridor Outside Classroom #11
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216

Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank: N/A
Quantity: Where Present On Ceiling
Average People/Hr: 30
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-01

Description: Beige 9” x 9” Floor Tile W/Green & Red Streaks & Black Mastic (Under Carpet In Classrooms)
Functional Space: Classrooms #2, 6, 7, 10, 11, 12, 13 & 14
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 5,250 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-01-01**
Location:	Northwest Corner Main Corridor
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-02**
Location:	Southwest Corner, Gymnasium
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-01-03**
Location:	West Side, Of Closet Door Above Boiler
Date Sampled:	11-13-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237

Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank: 7
Quantity: 5,250 Square Feet
Average People/Hr: 5
Population: Administrative
Average Hours/Day: 8
Average Days/Year: 180
Person-Hours/Year: 7,200
Preventive Measures: **Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-02

(FLOOR TILE/MASTIC - ABATED 1991 & 2003)

Description: Orange 9” x 9” Floor Tile W/Brown Streaks & Black Mastic (Under Carpet)
Functional Space: Classroom #15
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 660 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-02-01**
Location:	North Side, Entry Classroom #10, In Corridor
Date Sampled:	04-04-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-02-02**
Location:	Southwest Corner Gymnasium
Date Sampled:	04-04-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	660 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 1991)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-2

(FLOOR TILE/MASTIC - ABATED 2019)

Description: Floor Tile Covered By Carpet
Functional Space: Administrative Area
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	768 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	768 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**NONE REQUIRED**

(FLOOR TILE/MASTIC - ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-03

(Lounge FLOOR TILE/MASTIC - ABATED 2019)

Description: White 9” x 9” Floor Tile W/Green Streaks & Black Mastic (Under Carpet)
Functional Space: Classroom #3 & Teacher’s Lounge
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	900 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-03-02**
Location:	East Of Electrical Closet Teacher's Lounge
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-03**
Location:	Southwest Corner Classroom #3
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-06-01**
Location:	Southwest Corner Remedial Reading (Teacher's Lounge)
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237

Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031
Sample Number:	**FT-06-02**
Location:	Northeast Corner Remedial Reading (Teacher's Lounge)
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	900 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(LOUNGE FLOOR TILE/MASTIC - ABATED 2019)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-04

Description: White 9” x 9” Floor Tile W/Gray Mottles & Black Mastic (Under Carpet)
Functional Space: Classroom #10
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	750 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-04-01**
Location:	Southwest Corner Classroom #10
Date Sampled:	04-04-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-01**
Location:	Southwest Corner Classroom #10
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	750 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FT-05

(FLOOR TILE/MASTIC - ABATED 1991)

Description: Beige 9” x 9” Floor Tile W/Tan Mottles & Black Mastic (Under Carpet)
Functional Space: Classroom #16
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	660 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-05-01**
Location:	North Side, Entry Classroom #9, In Corridor
Date Sampled:	04-04-1996
Asbestos Content:	**20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	660 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 1991)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-5

(FLOOR TILE/MASTIC – ABATED 2003)

Description: 9” x 9” Floor Tile & Black Mastic
Functional Space: Corridors
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	2,150 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	2,150 Square Feet
Average People/Hr:	300
Population:	Students
Average Hours/Day:	0
Average Days/Year:	180
Person-Hours/Year:	10,800
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-7

(FLOOR TILE/MASTIC - ABATED 2001)

Description: 9” x 9” Floor Tile & Black Mastic
Functional Space: Gymnasium
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	3,666 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	3,666 Square Feet
Average people/Hr:	300
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	324,000
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2001)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-08

(FLOOR TILE/MASTIC - ABATED 2019)

Description: Gray 9” x 9” Floor Tile W/Black & White Streaks & Black Mastic (Under Carpet)
Functional Space: Work Room
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	180 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-08-01**
Location:	South Wall, East Side Work Room
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-08-02**
Location:	North Entry, East Side Work Room
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	180 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**NONE REQUIRED**

(FLOOR TILE/MASTIC - ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-09

(FLOOR TILE/MASTIC - ABATED 2020)

Description: Tan Mottled Floor Tile W/Tan Adhesive & Black Mastic (Under Carpet)
Functional Space: Library #1
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	1,080 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-09-01**
Location:	Northwest Corner, Library #1 (Mastic & Adhesive Inseparable)
Date Sampled:	04-04-1996
Asbestos Content:	**3.0% Total (Floor Tile)** **5.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	1,080 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**NONE REQUIRED**

(FLOOR TILE/MASTIC - ABATED 2020)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-10

(FLOOR TILE/MASTIC - ABATED 2013)

Description: Tan 9” x 9” Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Classroom’s #7 & #8
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	1,320 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-10-01**
Location:	Southeast Corner Classroom #8
Date Sampled:	04-04-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1,320 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 1991)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-11

(FLOOR TILE/MASTIC - ABATED 2001)

Description: Light Brown 9” x 9” Floor Tile W/Black & Beige Streaks & Black Mastic
Functional Space: Store Room
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	96 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-11-01**
Location:	Southwest Corner, Storeroom West Of Girl's, North Of Gym
Date Sampled:	04-04-1996
Asbestos Content:	**20.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St, Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-11-02**
Location:	Northwest Corner, Storeroom West Of Girl's, North Of Gym
Date Sampled:	04-04-1996
Asbestos Content:	**20.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	96 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2001)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-12

(FLOOR TILE/MASTIC - ABATED 2020)

Description: White 9” x 9” Floor Tile W/Gray Streaks & Black Mastic
Functional Space: Kitchen & Storage Room
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	464 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-12-01**
Location:	North Side, West Entry Storeroom, Kitchen
Date Sampled:	04-04-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-12-02**
Location:	West Side, Entry Walk-In Refrigerator
Date Sampled:	04-04-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	375 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**NONE REQUIRED**

(FLOOR TILE/MASTIC - ABATED 2019)

----- Recommended Response Action ----------

NONE REQUIRED

Approximate Cost: $0

Homogeneous Area ID: FT-13

(FLOOR TILE/MASTIC - ABATED 2003)

Description: Light Brown 9” x 9” Floor Tile W/Dark Brown & Beige Streaks & Tan Adhesive
Functional Space: Annex Building (Corridor)
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	620 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-13-01**
Location:	North End, Under East Cabinet Kitchen, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-13-02**
Location:	West Side, East Entry Classroom #19, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-13-03**
Location:	South End, Under East Cabinet Kitchen, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	620 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-14

(FLOOR TILE/MASTIC - ABATED 2003)

Description: Dark Brown 9” x 9” Floor Tile W/Beige Streaks & Black Mastic
Functional Space: Annex Building (Corridor Trim Along Edge)
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	96 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes

Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FT-14-01**
Location:	West Side, East Entry Classroom #19, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**20.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-14-02**
Location:	North Side, East Door HVAC Closet, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**20.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	96 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2003)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-16

(KITCHEN STOREROOM ABATED 2014)

Description:	Gray Floor Tile Under Carpet W/Black Mastic & Tan Adhesive
Functional Space:	Annex Building Classrooms, Work Room & Kitchen
Date Inspected:	04-18-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	08.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment ----------

Size:	4,500 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-16-01**
Location:	East Side, South Entry Storage, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**15.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	4,500 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Kitchen Storeroom – Abated 2014)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: FD-1

(DOOR - ABATED 1996)

Description: Material With-In Fire Rated Door
Functional Space: Boiler Room
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 1 Door
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1 Door
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

(Door - Abated 1996)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-1A

(NO SUSPECT MATERIAL WITH-IN DOORS)

Description: Material With-in Fire Rated Doors
Functional Space: Annex Building & Annex Boiler Room
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	10 Doors
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Moderate
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	10 Doors
Average People/Hr:	0
Population:	Maintenance Personnel
Average Hours/Day:	0
Average Days/Year:	0
Person-Hours/Year:	0
Preventive Measures:	**None Required**

(No Suspect Material With-In Doors)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-2

(DOORS - ABATED 1996 & 1999)

Description: Exterior Fire Doors
Functional Space: Throughout Building
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment----------

Size:	12 Doors
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Moderate
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Bulk Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	12 Doors
Average People/Hr:	215
Population:	Students
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	309,600
Preventive Measures:	**None Required**

(Doors - Abated 1996 & 1999)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: DWC-6

(BOILER ROOM & KITCHEN STOREROOM CEILING REMOVED 2014)
(COMPOSITE SAMPLED BELOW 1%)

Description:	Drywall Ceiling W/Joint Compound
Functional Space:	Annex Building - Boiler Room, Kitchen & Janitor Closet
Date Inspected:	04-18-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	08.A
Blueprint Location:	Maintenance Records Office

----- Physical Assessment -----

Size:	325 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 04-25-1990
2 Samples Taken --- ATC Report Dated: 09-1996
3 Samples Taken --- Reservoirs Report Dated: 04-25-2014
3 Samples Taken --- Reservoirs Report Dated: 05-19-2014

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FE-6-4**
Location:	Center, Ceiling Annex, Boiler Room
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-6-5**
Location:	Southeast Corner, Ceiling Annex, Storage Room
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-6-6**
Location:	Center, Ceiling Annex, Janitor's Closet
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave.
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**DWC-01-01**
Location:	South Access Hatch, Ceiling Boiler, Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**Trace**
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**DWC-01-02**
Location:	Center, Boiler Annex Building
Date Sampled:	04-04-1996
Asbestos Content:	**Trace**
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**08-14-B007**
Location:	Boiler Room Southwest Corner
Date Sampled:	04-18-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.15% Total (Composite)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-25-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100

	Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B008**
Location:	Boiler Room East Center
Date Sampled:	04-18-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.15% Total (Composite)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-25-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B009**
Location:	Boiler Room Northwest Corner
Date Sampled:	04-18-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.15% Total (Composite)**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-25-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B010**
Location:	Kitchen Storeroom Northwest Corner
Date Sampled:	04-18-2014

Asbestos Content: **3.0% Total (Joint Compound)**
0.3% Total (Composite)
Asbestos Type: **Chrysotile**
Analysis Date: 04-25-2014

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **08-14-B011**
Location: Kitchen Storeroom
Northwest Corner

Date Sampled: 04-18-2014
Asbestos Content: **3.0% Total (Joint Compound)**
0.3% Total (Composite)
Asbestos Type: **Chrysotile**
Analysis Date: 04-25-2014

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **08-14-B012**
Location: Kitchen Storeroom
Northwest Corner

Date Sampled: 04-18-2014
Asbestos Content: **3.0% Total (Joint Compound)**
0.3% Total (Composite)
Asbestos Type: **Chrysotile**
Analysis Date: 04-25-2014

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	325 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: DWWC-8

Description: Drywall Wall & Ceiling W/Joint Compound
Functional Space: Main Building - Kitchen, Restrooms, Janitorial Closets & Boiler Room Stairwell
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 2,900 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

8 Samples Taken --- ATC Report Dated: 04-25-1990
3 Samples Taken --- ATC Report Dated: 10-22-1992

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**FE-4-1**
Location:	Kitchen, Center South Side Ceiling
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-4-2**
Location:	South Boy's Restroom Ceiling, Northwest Corner
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-4-3**
Location:	Kitchen Pantry Center Ceiling
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-6-1**
Location:	Custodial Office, West Of Gymnasium, Center, East Wall
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-6-2**
Location:	Storage Closet, Northeast Of Gym Southwest Corner, Ceiling
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**FE-6-3**
Location:	Ceiling, Storage Closet Northeast Of Gym, East Storage
Date Sampled:	04-17-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-17-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209

EPA/NBS Accred Lab: 1081-01

Sample Number: **FE-6-7**
Location: Ceiling, Top Of Stairway Leading To Boiler Room
Date Sampled: 04-17-1990
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-17-1990

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 2600 West 29th Ave. Denver, Colorado 80327
Telephone: (303)-480-0209
EPA/NBS Accred Lab: 1081-01

Sample Number: **FE-8-1**
Location: South Janitorial Closet, Northeast Wall, Behind Washing Machine
Date Sampled: 04-24-1990
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-24-1990

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 2600 West 29th Ave.
Telephone: (303)-480-0209
EPA/NBS Accred Lab: 1081-01

Sample Number: **10-22-01**
Location: Washer/Dryer, Only On Piece Wall Board 7' x 12'
Date Sampled: 10-22-1992
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 10-22-1992

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100

	Denver, CO 80327
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

Sample Number:	**10-22-02**
Location:	Washer/Dryer, Only One Piece, Wall Board
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

Sample Number:	**10-22-03**
Location:	Washer/Dryer, Only On Piece Wall Board 7' x 12'
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80327
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,900 Square Feet
Average People/Hr:	5
Population:	Maintenance Personnel
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: **TCM-1**

Description: Gray Transite Panel (Above Drop Ceiling)
Functional Space: West Vestibule
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	50 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	No
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 07-26-1991

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FV0726-1**
Location:	Above Drop Ceiling West Vestibule
Date Sampled:	07-26-1991
Asbestos Content:	**65.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-26-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, Colorado 80327
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	50
Average People/Hr:	30
Population:	Maintenance Personnel
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: TSI-01

(MATERIAL HAS BEEN REMOVED)

Description: Gray Hard-Pack Fittings W/White Cloth
Functional Space: Janitor's Closet
Date Inspected: 04—18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	Quantity Unknown
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	Negative – (**1 Sample)**
Friable:	Yes
Material:	Thermal System Insulation
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	No

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TSI-01-01**
Location:	Northwest Corner Janitor's Closet
Date Sampled:	04-04-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-02

(MATERIAL HAS BEEN REMOVED)

Description: Tan Hard-Pack Fittings W/White Cloth
Functional Space: Kitchen Storage
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: N/A
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: N/A
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**TSI-02-01**
	Kitchen Storage
Date Sampled:	04-04-1996
Asbestos Content:	**5.0% Total**
Asbestos Type:	**Amosite**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

(Material Has Been Removed)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-03

(STAGE CEILING - FITTINGS REMOVED)

Description: Tan Fitting Material
Functional Space: Music Room (Stage) & Above Ceilings
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 6

**** Bulk Sample Information ****

Sample Number:	**TSI-03-01**
Location:	Damaged Fitting, Hot Water Line, Above Music Room
Date Sampled:	04-04-1996
Asbestos Content:	**3.0% Total** **5.0% Total**
Asbestos Type:	**Chrysotile & Amosite**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	6
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance** **(Stage Ceiling - Fittings Removed)**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: TSI-04

Description: Brown Boiler Block
Functional Space: Boiler Room
Date Inspected: 07-29-2013
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 30 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: N/A
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 09-27-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**08-13-B014**
Location:	Boiler, East End Lining Main Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B015**
Location:	Boiler, North Side Lining Main Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B016**
Location:	Boiler, South Side Lining Main Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	30 Square Feet
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-05

Description: White Boiler Block
Functional Space: Annex Building Boiler Room
Date Inspected: 07-29-2013
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	20 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	N/A
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- Reservoirs Report Dated: 09-27-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**08-13-B017**
Location:	Boiler, South End Lining Annex Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B018**
Location:	Boiler, East Side Lining Annex Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B019**
Location:	Boiler, West Side Lining Annex Building
Date Sampled:	09-17-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	20 Square Feet
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: WES-1

Description: White End Sealant On Piping
Functional Space: Throughout Building
Date Inspected: 2-18-2009
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	Quantity Unknown
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Moderate
Potential For Contact:	Moderate
Influence Of Vibration:	Moderate
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- Reservoirs Report Dated: 07-28-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**08-10-B008**
Location:	Boiler Room Northeast Corner
Date Sampled:	07-20-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B009**
Location:	Boiler Room Center
Date Sampled:	07-20-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B008**
Location:	Boiler Room West End
Date Sampled:	07-20-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-1

Description: Cove Base W/Tan Adhesive
Functional Space: Throughout Building
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 350 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-22-1992
3 Samples Taken --- ATC Report Dated: 04-09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**10-22-07**
Location:	Classroom #1
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80030
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049
Sample Number:	**10-22-08**
Location:	Outside, Principal's Office
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80327
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049
Sample Number:	**10-22-09**
Location:	Classroom #12
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

Sample Number: **BC-01-01**
Location: Northwest Corner
Main Corridor
Date Sampled: 04-04-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-09-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

Sample Number: **BC-02-01**
Location: Southwest Corner
Classroom #10
Date Sampled: 04-04-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-09-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

Sample Number: **BC-02-02**
Location: Northeast Corner
Remedial Reading
Date Sampled: 04-04-1996
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-09-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	350 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-02

Description: Brown Cove Base W/Tan Adhesive
Functional Space: Annex Building
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

-----Physical Assessment----------

Size: 100 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 08-01-2013

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**08-13-B007**
Location:	Classroom #21 East Wall
Date Sampled:	07-29-2013
Asbestos Content:	**5.0% Total (Adhesive)**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B008**
Location:	Classroom #19 South Wall
Date Sampled:	07-29-2013
Asbestos Content:	**3.0% Total (Adhesive)**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B009**
Location:	Classroom #17 East Wall
Date Sampled:	07-29-2013
Asbestos Content:	**5.0% Total (Adhesive)**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

-----Risk Assessment----------

Hazard Rank:	7
Quantity:	100 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

-----Recommended Response Action----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: **WP-01**

Description: White & Gray Hard, Crumbly, Window Glazing
Functional Space: Windows
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

-----Physical Assessment----------

Size:	Where Present Around Windows
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	10%
Accessible:	Moderate
Potential For Contact:	Moderate
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Moderate
Air Flow In Area:	Yes
Manner Of Sampling:	

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**WP-01-01**
Location:	Southeast Window Remedial Reading
Date Sampled:	04-04-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-02**
Location:	Southeast Window Library #1
Date Sampled:	04-04-1996
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**WP-01-03**
Location:	Northwest Window Classroom #13
Date Sampled:	04-04-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

-----Risk Assessment----------

Hazard Rank:	7
Quantity:	Where Present Around Windows
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

-----Recommended Response Action----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: WP-1

Description: Window Putty
Functional Space: Classrooms
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 250 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Surfacing
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-22-1992

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**10-22-04**
Location:	Computer Room, Across Classroom #11
Date Sampled:	10-22-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite & Actinolite**
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80030
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

Sample Number:	**10-22-05**
Location:	Classroom #6
Date Sampled:	10-22-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80327
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

Sample Number:	**10-22-06**
Location:	Classroom #1
Date Sampled:	10-22-1992
Asbestos Content:	**Trace**
Asbestos Type:	**Tremolite & Actinolite**
Analysis Date:	10-22-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-049

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	250 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: WP-02

Description: Gray Window Glazing
Functional Space: Annex Building Windows
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

-----Physical Assessment----------

Size:	Where Present Around Windows
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

1 Sample Taken --- ATC Report Dated: 09-1996
2 Samples Taken --- Reservoirs Report Dated: 08-01-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**WP-02-01**
Location:	Northeast Window Exterior, Annex Building
Date Sampled:	04-29-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**08-13-B010**
Location:	Classroom #19 Center Exterior Window
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B012**
Location:	Classroom #20 Center Exterior Window
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

-----Risk Assessment----------

Hazard Rank:	N/A
Quantity:	Where Present Around Windows
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

-----Recommended Response Action----------

None Required

Approximate Cost: $0

Homogeneous Area ID: WP-03

Description: White Window Glazing
Functional Space: Annex Building Windows
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

-----Physical Assessment----------

Size:	Where Present Around Windows
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Trace**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996
2 Samples Taken --- Reservoirs Report Dated: 08-01-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**WP-03-01**
Location:	Northeast Window Exterior, Annex Building
Date Sampled:	04-29-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**08-13-B011**
Location:	Classroom #21 West Exterior Window
Date Sampled:	07-29-2013
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-13-B013**
Location:	Classroom #19 West Exterior Window
Date Sampled:	07-29-2013
Asbestos Content:	**Trace**
Asbestos Type:	None
Analysis Date:	07-31-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

-----Risk Assessment----------

Hazard Rank:	N/A
Quantity:	Where Present Around Windows
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

-----Recommended Response Action----------

None Required

Approximate Cost: $0

Homogeneous Area ID: VD-01

(VIBRATION DAMPENERS ABATED 2014)

Description: White Cloth Vibration Dampener
Functional Space: Music Room #10
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 2" x 24'
Assumed ACM: No Condition: N/A
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**VD-01-01**
Location:	HVAC Unit Music Room
Date Sampled:	04-29-1996
Asbestos Content:	**65.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-02-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	2" X 24'
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**None Required**

(2-Vibration Dampeners Abated 2014)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CB-1

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description: Chalkboards
Functional Space: Main Building Classrooms
Date Inspected: 04-18-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records office

----- Physical Assessment -----

Size: 2,048 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Bulk Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	2,048 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(No Suspect Material With-In Chalkboards)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CBM-2

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description: Chalkboards W/Brown Mastic
Functional Space: Annex Building Classrooms
Date Inspected: 06-03-2014/06-27-2016
Inspector Name: Rick Seiler/Darren Trujillo
Inspector Accred: 3481/22590
Blueprint: 08.A
Blueprint Location: Maintenance Records office

----- Physical Assessment -----

Size: 320 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 06-11-2014
06-27-2016

AHERA Category: N/A

Hazard Rank: N/A

**** No Bulk Sample Information ****

Sample Number:	**08-14-B013**
Location:	Classroom #18 East Wall
Date Sampled:	06-03-2014
Asbestos Content:	0.0% Total (Brown Mastic Pucks)
Asbestos Type:	None
Analysis Date:	06-11-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B014**
Location:	Classroom #18 East Wall
Date Sampled:	06-03-2014
Asbestos Content:	0.0% Total (Brown Mastic Pucks)
Asbestos Type:	None
Analysis Date:	06-11-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B015**
Location:	Classroom #18 East Wall
Date Sampled:	06-03-2014
Asbestos Content:	0.0% Total (Brown Mastic Pucks)
Asbestos Type:	None
Analysis Date:	06-11-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.

Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: 08-16-B001
Location: Classroom #3
East Wall
Date Sampled: 06-27-2016
Asbestos Content: 0.0% Total (Brown Mastic Pucks)
Asbestos Type: None
Analysis Date: 07-05-2016

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: 08-16-B002
Location: Classroom #6
East Wall
Date Sampled: 06-27-2016
Asbestos Content: 0.0% Total (Brown Mastic Pucks)
Asbestos Type: None
Analysis Date: 07-05-2016

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: 08-16-B003

Location:	Classroom #7 East Wall
Date Sampled:	06-27-2016
Asbestos Content:	0.0% Total (Brown Mastic Pucks)
Asbestos Type:	None
Analysis Date:	07-05-2016
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	320 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(No Suspect Material With-In Chalkboards)

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: CBM-3

(GRAY MASTIC PUCKS REMOVED – CLASSROOMS #17, #18, #19 & #21 – SUMMER OF 2014 – COMPLETE ABATEMENT SERVICES)

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description:	Chalkboards W/Gray Mastic
Functional Space:	Annex Building Classrooms
Date Inspected:	06-03-2014
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	08.A
Blueprint Location:	Maintenance Records office

----- Physical Assessment ----------

Size:	320 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive (Mastic Only)**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 06-11-2014

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** No Bulk Sample Information ****

Sample Number:	**08-14-B016**
Location:	Classroom #18 East Wall
Date Sampled:	06-03-2014
Asbestos Content:	**3.0% Total (Gray Mastic Pucks)**
Asbestos Type:	**Chrysotile**
Analysis Date:	06-11-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B017**
Location:	Classroom #18 East Wall
Date Sampled:	06-03-2014
Asbestos Content:	**3.0% Total (Gray Mastic Pucks)**
Asbestos Type:	**Chrysotile**
Analysis Date:	06-11-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216

Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **08-14-B018**
Location: Classroom #18
East Wall
Date Sampled: 06-03-2014
Asbestos Content: **3.0% Total (Gray Mastic Pucks)**
Asbestos Type: **Chrysotile**
Analysis Date: 06-11-2014

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank: 7
Quantity: 320 Square Feet
Average People/Hr: 30
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **Conduct 6-Month Periodic Surveillance**

(No Suspect Material With-In Chalkboards)

(Gray Mastic Pucks Removed – Classrooms #17, #18, #19 & #21 Summer Of 2014 – Complete Abatement Services)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: CMU-1

(CMU OFFICE WALLS ONLY - ABATED 2020)

Description: Concrete Masonry Unit
Functional Space: Throughout Building
Date Inspected: 10-17-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 150,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low

Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- Reservoirs Report Dated: 07-28-2010

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**08-10-B001**
Location:	Office Storeroom South Wall
Date Sampled:	07-20-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B002**
Location:	Classroom #16 Northeast Corner
Date Sampled:	07-20-2010
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B003**
Location:	PE Office Behind Door
Date Sampled:	07-20-2010
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B004**
Location:	Hallway Access Lift
Date Sampled:	07-20-2010
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B005**
Location:	Kitchen Behind Door
Date Sampled:	07-20-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-10-B006**
Location:	Classroom #8 Southwest Corner
Date Sampled:	07-20-2010
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	07-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986

EPA/NBS Accred Lab: 101533-480

Sample Number: **08-10-B007**
Location: Classroom #3
Southwest Corner
Date Sampled: 07-20-2010
Asbestos Content: **3.0% Total**
Asbestos Type: **Chrysotile**
Analysis Date: 07-28-2010

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank: 7
Quantity: 150,000 Square Feet
Average People/Hr: 30
Population: Students
Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **Conduct 6-Month Periodic Surveillance**

(CMU OFFICE WALLS ONLY – ABATED 2020)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Friable

Approximate Cost: $0

Homogeneous Area ID: BRR-1

Description: Black Rolled Roofing W/Sealant
Functional Space: Roof Top
Date Inspected: 03-12-2014
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 08.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	28,000
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 03-14-2014

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**08-14-B001**
Location:	Roof Top
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B002**
Location:	Roof Top
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**08-14-B003**
Location:	Roof Top
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	28,000
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

5.4 Prioritized Listing Of Homogeneous Materials & Salients

Fairview Elementary

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
CT-1	Hallways & Office	N/A	309,600	$0
CT-2	Gym & Classroom	N/A	324,000	$0
CT-3	Gym & Classrooms	N/A	324,000	$0
CT-5	Annex Building	N/A	60,480	$0
CT-7	Annex Kitchen	N/A	18,000	$0
CTA	Main Corridor	7	32,400	$0
FT-01	Classrooms #2,6,7, 10,11,12,13 &14	7	7,200	$0
FT-02	Classroom #15 & Lobby	N/A	7,200	$0
FT-2	Administrative	N/A	7,200	$0
FT-03	Classroom #3 & Teacher's Lounge	7	7,200	$0
FT-04	Classroom #10	7	7,200	$0
FT-05	Classroom #16	N/A	7,200	$0
FT-5	Corridors	N/A	10,800	$0
FT-7	Gymnasium	N/A	324,000	$0
FT-08	Work Room	N/A	7,200	$0
FT-8	Kitchen	N/A	1,440	$0
FT-09	Library #1	N/A	7,200	$0
FT-10	Classroom’s #7 & #8	N/A	7,200	$0
FT-11	Store Room	N/A	7,200	$0
FT-12	Kitchen & Storage	N/A	7,200	$0
FT-13	Annex (Corridor)	N/A	7,200	$0
FT-14	Annex	N/A	7,200	$0
FT-16	Annex Classrooms	7	7,200	$0
FD-1	Boiler Room	N/A	1,080	$0
FD-1A	Annex Building & Annex Boiler Room	N/A	1,080	$0

FD-2	Throughout Building	N/A	309,600	$0
DWC-6	Annex Boiler Room, Kitchen & Janitor Closet	7	72,000	$0

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
DWWC-8	Kitchen, Restrooms, Janitorial Closet, & Boiler Room	N/A	7,200	$0
TCM-1	West Vestibule	7	32,400	$0
TSI-01	Janitor's Closet	N/A	5,400	$0
TSI-02	Kitchen Storage	N/A	5,400	$0
TSI-03	Music Room (Stage) & Above Ceilings	6	5,400	$0
TSI-04	Main Boiler Room	N/A	180	$0
TSI-05	Annex Boiler Room	N/A	180	$0
WES-1	Throughout Building	N/A	1,080	$0
BC-1	Throughout Building	N/A	32,400	$0
BC-02	Annex Building	7	32,400	$0
WP-01	Windows	7	32,400	$0
WP-1	Classrooms	7	32,400	$0
WP-02	Annex Windows	N/A	32,400	$0
WP-03	Annex Windows	N/A	32,400	$0
VD-01	Music Room #10	N/A	5,400	$0
CB-1	Classrooms	N/A	32,400	$0
CBM-2	Annex Classrooms	N/A	32,400	$0
CBM-3	Annex Classrooms	N/A	32,400	$0
CMU-1	Throughout Building	7	32,400	$0
BRR-1	Roof Top	N/A	180	$0

Total Cost Of Recommended Actions: $0

5.5 Floor Plans

FAIRVIEW
TABLE OF CONTENT FOR DRAWINGS

FILE - 08F1
LAYER
1 - 9 OPEN
10 MASTER

FILE - WALL
LAYER
1 DWWC-8
2 - 9 OPEN
10 MASTER

FILE - CT
LAYER
1 CT-5
2 CT-7
3 CT-2
4 CT-3
5 CT-1
6 DWC-6
7 PC-4
8 OPEN
9 OPEN
10 MASTER

FILE - FT1-9
LAYER
1 FT-1
2 FT-2
3 FT-3
4 FT-4
5 FT-5
6 FT-7
7 FT-8
8 FT-1A
9 OPEN
10 MASTER

FILE - MISC
LAYER
1 FD-1
2 FD-1A
3 TCM-1
4 CB-1
5 BC-1
6 WP-1
7 FD-2
8 FD-2A
9 OPEN
10 MASTER

FILE - FT11-19
LAYER
1 FT-4A
2 FT-5A
3 FT-3X
4 - 9 OPEN
10 MASTER