5.0 AHERA RE-INSPECTION SUMMARIES & RISK ASSESSMENTS

5.1 AHERA Re-Inspection

5.1.1 Re-Inspection Information & Procedures

The undersigned has completed the inspection for this (or these) building(s) and have met the requirements stated in 40 CFR 763.85 (A), (B), (C), (D), and (E), SUBPART E. The building's identification and date of inspection are mentioned throughout this section (5) of the Asbestos Management Plan.

Inspector's Signature _____
Kyle C. Baber Accreditation Number: 0910
Eric J. Havelick Accreditation Number: DR090691-02 AM
Brandon Ramer Accreditation Number: 4766
Rick Seiler Accreditation Number: 3481
Darren Trujillo Accreditation Number: 22590

The inspectors conducted a review of the construction records, including available plans and specifications, in an effort to discover any materials specified as asbestos containing. The construction chronology was researched to define areas containing like materials. Different construction areas, which contain like-appearing materials, would require separate sampling to evaluate asbestos content. Common usage room names and numbers were determined for use in this plan.

Schematic drawings were made of the building, which indicates buildings, additions or construction areas, functional spaces/rooms, homogeneous areas, salient, and sample locations. These drawings are attached to this report in Section 5.5.

Every accessible internal space in the buildings was toured and observed during inspections. The Inspectors attempted to discover and record any material suspected of containing asbestos. All suspected material discovered was tested by physical hand pressure to determine whether or not the material was friable. An assessment of the material's condition and potential for disturbance or damage was made based upon the inspector’s experience and judgment.

Inspection procedures were conducted in accordance with the requirements of the AHERA regulations to the best of the contributing inspector's abilities.

5.1.2 AHERA Re-Inspection Report Summaries

Certified Inspectors performed all inspecting and bulk sampling. The work was not delegated in any way to non-certified personnel.

All bulk samples were tested using polarized light microscopy (PLM), EPA interim method using dispersion staining, to determine the asbestos content.

5.2 Classifying The Condition Of Suspect Material

5.2.1 AHERA Category Physical Assessment

AHERA Category	Definitions
1. - - - - -	Damaged or significantly damaged friable thermal system insulation.
2. - - - - -	Damaged friable surfacing ACM.
3. - - - - -	Significantly damaged friable surfacing ACM.
4. - - - - -	Damaged or significantly damaged friable miscellaneous ACM.
5. - - - - -	ACBM with potential for damage.
6. - - - - -	ACBM with potential for significant damage.
7. - - - - -	Any remaining friable ACBM or friable suspected ACBM.

5.2.2 Suspect Asbestos-Containing Surfacing & Miscellaneous Material

Significantly Damaged

Material with one or more of the following characteristics:

The surface crumbing or blistered over at least one tenth of the area if the damage is evenly distributed, or at least one quarter if the damage is localized.

One tenth (one quarter, if localized) of material hanging from the surface, deteriorated, or showing adhesive failure.

Water stains or gouges, or mars over at least one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Damaged

Material with the following characteristics:

The surface blistered, crumbling, water stained, or gouged, marred or otherwise abraded over less than one tenth of the surface if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the material can be used as confirmatory evidence, ceiling or wall.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.3 Suspect Asbestos-Containing Thermal Insulation

Significantly Damaged

Material with one or more of the following characteristics:

Missing jackets on at least one tenth of the piping or equipment.

Crushed or heavily gouged or punctured insulation on at least one tenth of pipe runs/risers, boiler, tank, duct, etc., if the damage is evenly distributed (one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Damaged

Material with one or more of the following characteristics:

A few water stains or less than one tenth of the insulation with missing jackets.

Crushed insulation or water stains, gouges, punctures, or mars on up to one tenth of the insulation if the damage is evenly distributed (or up to one quarter if the damage is localized).

Accumulation of powder, dust, or debris similar in appearance to the suspect material on surfaces beneath the pipe, boiler, tank, etc. can be used as confirmatory evidence.

Good Condition

Material with no visible damage or deterioration, or showing only very limited damage or deterioration.

5.2.4 Factors Used To Determine The Potential For Disturbance

Potential For Contact With The Material: Accessible -- when referring to ACM means that the material is subject to disturbance by school or building occupants or custodial or maintenance personnel in the course of their normal activities.

High:	Service workers work in the vicinity of the material more than once per week, or
	The material is in a public area (e.g., hallway, corridor, auditorium) and accessible to building occupants.
Moderate:	Service workers work in the vicinity of the material once per month to once per week, or
	The material is in a room or office and accessible to the occupants.
Low:	Service workers work in the vicinity of the material less than once per month, or
	The material is visible but not within reach of building occupants.

Influence Of Vibration: Vibration -- means the periodic motion of friable ACM, which may result in the release of asbestos fibers.

High:	Loud motors or engines present (e.g. some fan rooms), or
	Intrusive noises or easily sensed vibrations e.g., major airports, a major highway).
Moderate:	Motors or engines present, not obtrusive (e.g., ducts vibrating but no fan in the area) or Occasional loud sounds.
Low/None	None of the above.

Potential For Air Erosion: Air Erosion -- means the passage of air over friable ACBM, which may result in the release of asbestos fibers.

High:	High velocity air (e.g., elevator shaft, fan room).
Moderate:	Noticeable movement of air (e.g., air shaft, ventilator air stream).
Low/None	None of the above.

5.2.5 Determination Of Potential For Disturbance

High Disturbance -- ACM which ranks "high" in any one of potential for contact, Influence of vibration, or potential for air erosion.

Examples are (1) acoustical plaster on a low ceiling in a high school band room, (2) thermal system insulation on air ducts connected to ventilation fans and readily accessible to workers conducting maintenance on the ventilation system, and (3) fireproofing on structural members or metal/concrete decks in a return air plenum.


Moderate Disturbance -- ACM which ranks "moderate" in any one potential for contact, Influence of vibration, or potential for air erosion.

Examples are ACM on corridor walls, on a ceiling underneath a gymnasium, or in an elevator shaft.

Low Disturbance -- ACM which ranks "low" in all three of potential for contact, Influence of vibration, or potential for air erosion.

5.2.6 Response Action Category Determination

The following decision tree was used to determine the Response Action Category.....

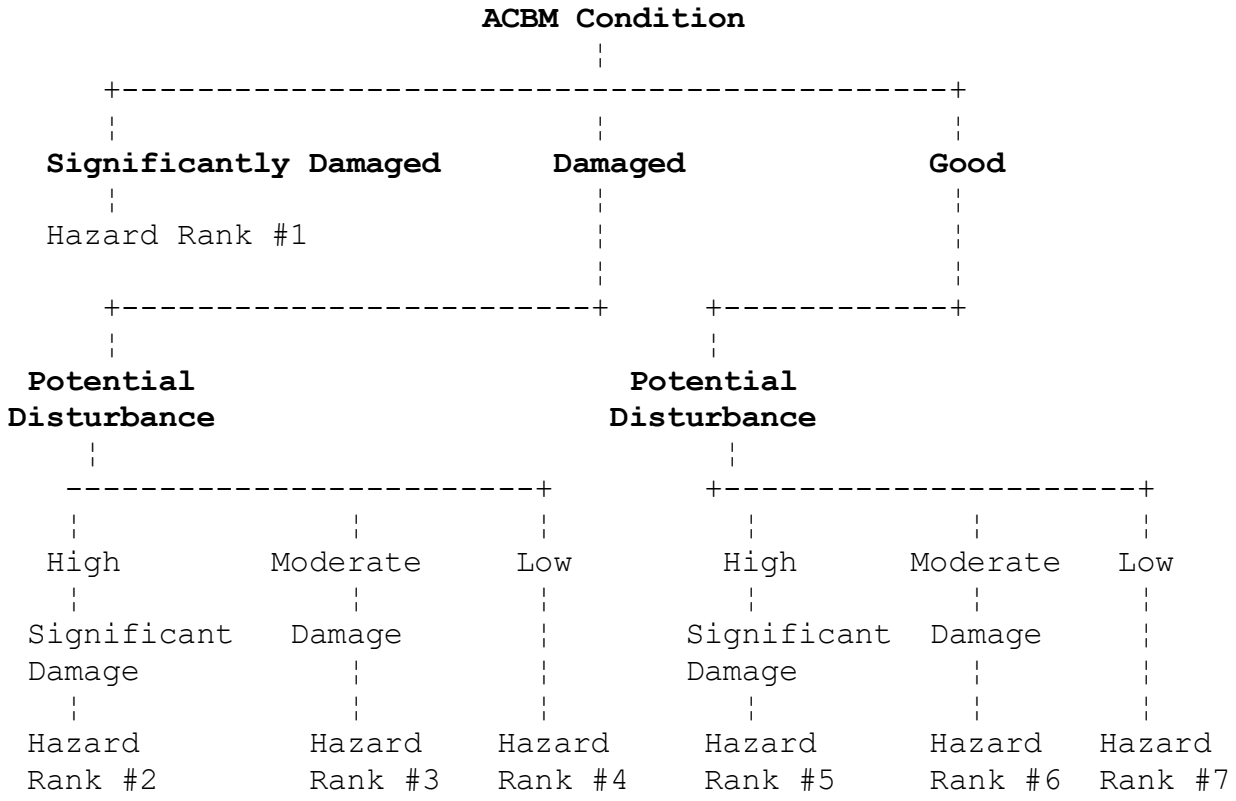

Response Actions Based On Hazard Ranking

Hazard Rank	Response Action Categories	Response Action Required By AHERA
1	Significantly Damaged	Evacuate or isolate the area if needed Remove the ACBM (or encapsulate if sufficient to contain fibers). Repair of thermal system insulation is allowed if feasible and safe. O&M required for all friable ACBM.
2	Damaged + High Potential For Significant Damage	Evacuate or isolate the area if needed. Remove, enclose, encapsulate, or repair to correct damage. Take steps to reduce potential for disturbance. O&M required for all friable ACBM.
3	Damaged + Moderate Potential For Damage	Remove, enclose, encapsulate, or repair to correct damage. O&M required for all friable ACBM.
4	Damaged	Same as Hazard Rank 3.
5	Good + High Potential For Significant Damage	Evacuate or isolate the area if needed. Take steps to reduce potential for disturbance. O&M required for all friable ACBM and TSI.
6 Potential	Good + Moderate For Damage	O&M required for all friable ACBM and TSI.
7	All Remaining	O&M required for all ACBM, but measures need not be as extensive as above.

5.3 ACBM Descriptive Log & Summary Of Areas

The areas are organized by functional space within the building. The Homogeneous Area, Hazard Assessment Rank and Response Action have been identified.

Pages 13 through 19 list the homogeneous areas in the order they appear in this report and as detailed on the blue print for this building. Also shown are the type of material, the description of the area, and the square footage of the area.

Homogeneous Area Acronyms		Autosketch File Name
ACM-	Asbestos Containing Material	Misc.
BC-	Base Cove	Misc.
CB-	Chalk Boards	Misc.
CBP-	Cinder Block Patch	Misc.
CM-	Ceiling Mastic	CT
CORK-	Cork Tile	Misc.
CT-	Ceiling Tile	CT
CTW-	Ceiling Tile Walls	Wall
CMS-	Ceiling Material Sprayed On	CT
CMU-	Concrete Masonry Unit	Misc.
CTDW-	Ceiling Tile Drywall	CT
DWC-	Drywall Ceiling	CT
DW-	Drywall Wall	Wall
DWC-	Drywall Wall & Ceiling	Wall
EG-	Expansion Joints	Misc.
FD-	Fire Doors	Misc.
FT-	Floor Tile	FT
FTM-	Floor Tile Mastic	FT
GVW-	Gray Vinyl Window Replacement	Misc.
LN-	Linoleum	FT
PC-	Plaster Ceiling	CT
PW-	Plaster Wall	Wall
PWC-	Plaster Wall & Ceiling	Wall
STM-	Stair Tread Mastic	Misc.
RS-	Shingle Roof	Misc.
SSM-	Spray-On Surfacing Material	Wall
TM-	Transite Material	Misc.

TSI-	Thermal System Insulation	Misc.
WES-	White End Sealant	Misc.
WP-	Window Putty	Misc.

Changes In Homogeneous Area Titles From 1990 ATC Report:

Homogeneous Area Ceiling Tile CT-1 was Homogeneous Area 1.
Homogeneous Area Ceiling Tile CT-2 was Homogeneous Area 2.
Homogeneous Area Ceiling Tile CT-3 was Homogeneous Area 3.
Homogeneous Area Drywall Wall DWC-4 was Homogeneous Area 4.
Homogeneous Area Ceiling Tile CT-5 was Homogeneous Area 5.
Homogeneous Area Spray-On Surfacing Material SSM-6 was Homogeneous Area 6.
Homogeneous Area Ceiling Tile CT-7 was Homogeneous Area 7.
Created Homogeneous Area FTM-1 Floor Tile Mastic.

Changes In Homogeneous Area Titles From 1994 ATC Report:

Homogeneous Area CSM-6 was Homogeneous Area SSM-6.
Homogeneous Area ACM-1 was Homogeneous Area EG-1.
Homogeneous Area FD-2 was created.

Changes In Homogeneous Area Titles From 1996 ATC Report:

Homogeneous Areas FT-1 through FT-14 has been created.
Homogeneous Area TSI-01 has been created.
Homogeneous Area BC-01 through BC-03 has been created.
Homogeneous Area BC-04 has been created.

Changes In Homogeneous Area Titles From 1997 ATC Inspection:

Homogeneous Area DW-1 has been created.

Changes In Homogeneous Area Titles From 2005 Update:

Homogeneous Area FT-04 incorporated into FT-02.
Homogeneous Area FT-05 incorporated into FT-03.
Homogeneous Area FT-08 incorporated into FT-6.
Homogeneous Area FT-10 & FT-11 incorporated into FT-4.
Homogeneous Area FT-12 incorporated into FT-8.

Homogeneous Area CT-7 incorporated into CT-3.

Changes In Homogeneous Area Titles From 2008 Update:

Homogeneous Area CMU-1 has been created. (Concrete Masonry Unit)
Homogeneous Area WES-1 has been created. (White End Sealant)

Changes In Homogeneous Area Titles From 2012 Update:

Homogeneous Area CB-2 has been created. (Gray Chalkboard Mastic)

Changes In Homogeneous Area Titles From 2013 Update:

Homogeneous Area TSI-02 has been created. (Gray Seam Caulk)
Homogeneous Area TSI-03 has been created. (White Boiler Insulation)

Changes In Homogeneous Area Titles From 2014 Update:

Homogeneous Area DWWC-3 has been created. (Drywall W/Joint Compound)

Changes In Homogeneous Area Titles From 2020 Update:

Homogeneous Area WP - 1 has been created. (Window Putty)

According to the ATC Report, Project Specifications for the summer of 1990 Asbestos Abatement Program, the following Asbestos Containing Material has been removed:

Material	Location	Approx. Quantity
Floor Tile, (Mastic Encapsulated)	Classrooms #2, #3, & #4	2,250 Square Feet

According to the ATC Report, Project Specifications for the summer of 1991 Asbestos Abatement Program, the following Asbestos Containing Material has been removed:

Material	Location	Approx. Quantity
Floor Tile, (Mastic Encapsulated)	Classroom #17	750 Square Feet

According to the ATC Report, Project Specifications for the summer of 1997 Asbestos Abatement Program, the following Asbestos Containing Material has been removed:

Material	Location	Approx. Quantity
Carpet Over Floor Tile & Mastic	Hallway Outside Classrooms #4 & #5	80 Square Feet

According to the Blue Mesa Environmental Report, Project Surveillance & Air Monitoring, Dated June 2007, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Gymnasium, Custodial Closet, Library Storerooms & Main Office Workrooms	4,885 Square Feet

According to the Blue Mesa Environmental Air Monitoring Report, Dated May 2014, the following Asbestos Containing Material was removed under OSHA Asbestos Abatement:

Material	Location	Approx. Quantity
Drywall W/Joint Compound	Library – Soffit At Northwest End	288 Square Feet

According to the Blue Mesa Environmental Report, Project Surveillance & Air Monitoring, Dated February 2020, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	Main Office, Principals office, Custodial Closet, Classroom 18	1,582 Square Feet

According to the Blue Mesa Environmental Report, Project Surveillance & Air Monitoring, Dated February 2021, the following Asbestos Containing Material was removed:

Material	Location	Approx. Quantity
Floor Tile & Mastic	All remaining classrooms and hallways	9,221 Square Feet

The Homogeneous Areas Are In Consecutive Order As In The Following Report.

FT-1 (LOCATED ON PAGE 20)
HOMOGENEOUS AREA – 9" X 9" TAN FLOOR TILE W/BLACK MASTIC
ADMINISTRATIVE AREA
501 SQUARE FEET
ASSUMED-ACM
(FLOOR TILE/MASTIC – OFFICE WORKROOMS – ABATED 2008)
(FLOOR TILE/MASTIC – MAIN & PRINCIPALS OFFICE – ABATED 2020)

FT-02 (LOCATED ON PAGE 22)
HOMOGENEOUS AREA – 9" X 9" TAN FLOOR TILE W/BLACK MASTIC
(EXISTING TILE UNDER CARPET)
MEDIA CENTER
1,200 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC – SOUTH STOREROOMS – ABATED 2008)

FT-2 (LOCATED ON PAGE 24)
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE COVERED BY CARPET
ADMINISTRATIVE AREA
1,027 SQUARE FEET
ASSUMED-ACM

FT-03 (LOCATED ON PAGE 26)
HOMOGENEOUS AREA - TAN 9" x 9" FLOOR TILE
W/WHITE & BROWN STREAKS & BLACK MASTIC (UNDER CARPET)
CLASSROOMS, REMEDIAL READING, & CUSTODIAL CLOSET
7,500 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE - CLASSROOMS #2, #3, #4, & #17 ABATED 1990-1991 BLACK MASTIC ENCAPSULATED)
(FLOOR TILE/MASTIC - CUSTODIAL CLOSET & REMEDIAL READING ABATED 2008)
(FLOOR TILE/MASTIC – CLASSROOM 18 – ABATED 2020)

FT-3 **(LOCATED ON PAGE 31)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
(UNDER CARPET)
CLASSROOM #2
750 SQUARE FEET
TESTED-POSITIVE

FT-4 **(LOCATED ON PAGE 33)**
HOMOGENEOUS AREA - FLOOR TILE COVERED BY CARPET
CLASSROOM #9
600 SQUARE FEET
TESTED-NEGATIVE
(ASSUMED-ACM - 2 SAMPLES TAKEN)

FT-6 **(LOCATED ON PAGE 36)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE COVERED BY CARPET
CORRIDORS
3,546 SQUARE FEET
TESTED-POSITIVE

FT-7 **(LOCATED ON PAGE 38)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
GYMNASIUM
4,035 SQUARE FEET
TESTED-POSITIVE
(FLOOR TILE/MASTIC – ABATED 2008)

FT-8 **(LOCATED ON PAGE 40)**
HOMOGENEOUS AREA – 9" X 9" FLOOR TILE W/BLACK MASTIC
KITCHEN
425 SQUARE FEET
ASSUMED-ACM

FT-09 **(LOCATED ON PAGE 42)**
HOMOGENEOUS AREA - TAN FLOOR TILE W/BLACK MASTIC
(UNDER CARPET)

CLASSROOMS #7 & #8
1,250 SQUARE FEET
TESTED-POSITIVE

FT-9 **(LOCATED ON PAGE 44)**
HOMOGENEOUS AREA – FLOOR TILE COVERED BY CARPET
CLASSROOM #1
600 SQUARE FEET
TESTED-POSITIVE

FT-13 **(LOCATED ON PAGE 46)**
HOMOGENEOUS AREA - TAN FLOOR TILE W/BLACK MASTIC
(UNDER CARPET)
CLASSROOM #11
650 SQUARE FEET
TESTED-POSITIVE

FT-14 **(LOCATED ON PAGE 48)**
HOMOGENEOUS AREA - WHITE 12” x 12” FLOOR TILE
W/BLACK MASTIC
CLASSROOM #15
650 SQUARE FEET
TESTED-POSITIVE

FTM-1 **(LOCATED ON PAGE 51)**
HOMOGENEOUS AREA - FLOOR TILE MASTIC COVERED BY CARPET
CLASSROOMS #2, #3, #4, & #17
3,000 SQUARE FEET
TESTED-POSITIVE

CT-1 **(LOCATED ON PAGE 54)**
HOMOGENEOUS AREA - 2.5' x 7.5' LAYERED TECTUM CEILING
CLASSROOMS, MEDIA CENTER, HALLWAY, & GYMNASIUM
23,700 SQUARE FEET
TESTED-NEGATIVE

CT-2 **(LOCATED ON PAGE 60)**
HOMOGENEOUS AREA - 2' x 4' DOT MATRIX CEILING TILE

MUSIC ROOM, STAGE, PE OFFICE, REMEDIAL READING
& ADMINISTRATIVE OFFICE
2,675 SQUARE FEET
TESTED-NEGATIVE

CT-3 (LOCATED ON PAGE 64)
HOMOGENEOUS AREA - 12" x 12" PERFORATED CEILING TILE W/MASTIC
BAND ROOM
880 SQUARE FEET
TESTED-NEGATIVE

CT-5 (LOCATED ON PAGE 69)
HOMOGENEOUS AREA - 2' x 4' RANDOM PERFORATED CEILING TILE
SOUTH MEDIA CENTER & SOCIAL WORKER ROOM
625 SQUARE FEET
TESTED-NEGATIVE

FD-1 (LOCATED ON PAGE 72)
HOMOGENEOUS AREA - MATERIAL WITH-IN FIRE RATED DOOR
BOILER ROOM
1 DOOR
(**NO SUSPECT MATERIAL WITH-IN DOOR)**

FD-2 (LOCATED ON PAGE 74)
HOMOGENEOUS AREA - EXTERIOR FIRE DOORS
THROUGHOUT BUILDING
12 DOORS
(**NO SUSPECT MATERIAL WITH-IN DOORS)**

DWWC-3 (LOCATED ON PAGE 76)
HOMOGENEOUS AREA – DRYWALL SOFFIT W/JOINT COMPOUND
LIBRARY
850 SQUARE FEET
TESTED-POSITIVE
(DRYWALL SOFFIT – NORTHWEST END – ABATED 2014)

DWC-4 (LOCATED ON PAGE 79)
HOMOGENEOUS AREA - DRYWALL CEILING W/JOINT COMPOUND
OFFICE, KITCHEN, RESTROOMS, HEALTH ROOM, & VESTIBULES
4,000 SQUARE FEET
TESTED-NEGATIVE

SSM-6 (LOCATED ON PAGE 84)
HOMOGENEOUS AREA – DRYWALL CEILING W/POPCORN TEXTURE
CLASSROOM #6
250 SQUARE FEET
TESTED-NEGATIVE

BC-1 (LOCATED ON PAGE 88)
HOMOGENEOUS AREA – COVE BASE WITH ADHESIVE
THROUGHOUT BUILDING
500 SQUARE FEET
TESTED-NEGATIVE

BC-02 (LOCATED ON PAGE 91)
HOMOGENEOUS AREA - ORANGE COVE BASE W/BROWN ADHESIVE
MEDIA CENTER, REMEDIAL READING, & MUSIC ROOM
500 LINEAR FEET
TESTED-TRACE (ADHESIVE)

BC-03 (LOCATED ON PAGE 94)
HOMOGENEOUS AREA - BLACK COVE BASE W/BROWN ADHESIVE
CLASSROOM #5
100 LINEAR FEET
TESTED-NEGATIVE
(ASSUMED-ACM - 2 SAMPLES TAKEN)

BC-04 (LOCATED ON PAGE 97)
HOMOGENEOUS AREA - DARK BROWN COVE BASE W/TAN ADHESIVE
FOYER SOUTH ENTRANCE
32 LINEAR FEET
TESTED-NEGATIVE
(ASSUMED-ACM - 1 SAMPLE TAKEN)

CB-1 **(LOCATED ON PAGE 99)**
HOMOGENEOUS AREA – CHALKBOARDS W/BROWN MASTIC
CLASSROOMS
630 SQUARE FEET
TESTED-NEGATIVE (MASTIC)
(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

CB-2 **(LOCATED ON PAGE 102)**
HOMOGENEOUS AREA – CHALKBOARDS W/GRAY MASTIC
CLASSROOMS
630 SQUARE FEET
TESTED-POSITIVE (MASTIC)
(**NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)**

EG-1 **(LOCATED ON PAGE 105)**
HOMOGENEOUS AREA - HVAC EXPANSION JOINTS
CUSTODIAL CLOSET
2 SQUARE FEET
TESTED-NEGATIVE

TSI-01 **(LOCATED ON PAGE 108)**
HOMOGENEOUS AREA - WHITE POWDERY FITTING MATERIAL
STAFF LOUNGE & CLASSROOMS (BEHIND COUNTERS)
QUANTITY UNKNOWN
TESTED-POSITIVE

TSI-02 **(LOCATED ON PAGE 111)**
HOMOGENEOUS AREA – GRAY BOILER SEAM CAULK
BOILER ROOM
60 LINEAR FEET
TESTED-POSITIVE

TSI-03 **(LOCATED ON PAGE 114)**
HOMOGENEOUS AREA – WHITE/BROWN BOILER INSULATION
BOILER ROOM
QUANTITY UNKNOWN
TESTED-POSITIVE

WES-1 (LOCATED ON PAGE 117)
HOMOGENEOUS AREA – WHITE END SEALANT ON PIPING
THROUGHOUT BUILDING
QUANTITY UNKNOWN
TESTED-NEGATIVE

CMU-1 (LOCATED ON PAGE 120)
HOMOGENEOUS AREA – CONCRETE MASONRY UNIT
THROUGHOUT BUILDING
3,500 SQUARE FEET
TESTED-NEGATIVE

WP-1 (LOCATED ON PAGE 122)
HOMOGENEOUS AREA – WINDOW PUTTY
THROUGHOUT BUILDING
3,500 SQUARE FEET
TESTED-NEGATIVE

Sherrelwood Elementary

Homogeneous Area ID: FT-1

(FLOOR TILE/MASTIC - ABATED 2008)
(FLOOR TILE/MASTIC – MAIN & PRINCIPALS OFFICE – ABATED 2020

Description: 9” X 9” Tan Floor Tile W/Black Mastic
Functional Space: Administrative Area
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 501 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling: None

***** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	501 Square Feet
Average People/Hr:	3
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	200
Person-Hours/Year:	4,800
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2008)
(FLOOR TILE/MASTIC – MAIN & PRINCIPALS OFFICE – ABATED 2020

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-02

(FLOOR TILE/MASTIC - SOUTH STOREROOMS - ABATED 2008)

Description: 9” X 9” Tan Floor Tile W/Black Mastic (Existing Tile Under Carpet)
Functional Space: Media Center
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	1,200 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-02-01**
Location:	Northwest, Center Media Center
Date Sampled:	04-23-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	1,200 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile/Mastic - South Storerooms - Abated 2008)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-2

Description: 9” X 9” Floor Tile Covered By Carpet
Functional Space: Administrative Area
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	1,027 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	None

***** No Sample Information Available *****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	1,027 Square Feet
Average People/Hr:	3
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	200
Person-Hours/Year:	4,800
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-03

(FLOOR TILE - CLASSROOMS #2, #3, #4, & #17 - ABATED 1990-1991)
(BLACK MASTIC REMAINS - ENCAPSULATED)

(FLOOR TILE/MASTIC - CUSTODIAL CLOSET LOCATED BY THE KITCHEN & REMEDIAL READING ROOM - ABATED 2008)

(FLOOR TILE/MASTIC – CLASSROOM 18 – ABATED 2020

Description:	Tan 9” x 9” Floor Tile W/White Brown Streaks & Black Mastic
Functional Space:	Classrooms, Remedial Reading, & Custodial Closet (Under Carpet)
Date Inspected:	05-04-2006
Inspector Name:	Rick Seiler
Inspector Accred:	3481
Blueprint:	13.A
Blueprint Location:	Maintenance Records Office

---- Physical Assessment ----------

Size:	7,500 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 09-1996
4 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-03-01**
Location:	Entry, Corridor Remedial Reading
Date Sampled:	04-23-1996
Asbestos Content:	**5.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-02**
Location:	Closet, Classroom #5
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-03**
Location:	Closet, Classroom #8
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-03-04**
Location:	Northeast Entry All Purpose Room
Date Sampled:	04-23-1996
Asbestos Content:	Not Analyzed Group Method
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-05-01**
Location:	Entry, Remedial Reading Media Center
Date Sampled:	04-23-1996
Asbestos Content:	**15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC. 5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-05-02**
Location:	Entry, Storage South IMC Media Center
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 102031

Sample Number: **FT-06-01**
Location: East Side
Remedial Reading
Date Sampled: 04-23-1996
Asbestos Content: **2.0% Total (Floor Tile)**
10.0% Total (Mastic)
Asbestos Type: **Chrysotile**
Analysis Date: 05-01-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

Sample Number: **FT-07-01**
Location: Center, Remedial Reading
Date Sampled: 04-23-1996
Asbestos Content: **2.0% Total (Floor Tile)**
Asbestos Type: **Chrysotile**
Analysis Date: 05-01-1996

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	7,500 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile - Classrooms #2, #3, #4, & #17 - Abated 1990-1991) (Black Mastic Encapsulated)

(Floor Tile/Mastic - Custodial Closet Located By The Kitchen & Remedial Reading Room - Abated 2008)

(FLOOR TILE/MASTIC – CLASSROOM 18 – ABATED 2020

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-3

Description: 9” x 9” Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Classroom #2
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	750 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	**Positive**
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- DCM Report Dated: 08-13-1990

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

***** Bulk Sample Information *****

Sample Number:	**2RR- A, B, & C**
Location:	Classroom #2
Date Sampled:	08-11-1990
Asbestos Content:	**16.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	08-11-1990
Laboratory Name:	DCM SCIENCE LABORATORY
Address:	200 Union Blvd., Suite 118 Lakewood, CO 80228
Telephone:	(303)-237-0110
EPA/NBS Accred Lab:	305

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	750 Square Feet
Average People/Hr:	50
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	54,000
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-4

(ASSUMED-ACM - 2 SAMPLES TAKEN)

Description: Floor Tile Covered By Carpet
Functional Space: Classroom #9
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 600 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996
1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-10-01**
Location:	Center Kindergarten #9
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-11-01**
Location:	Center Kindergarten #9
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	600 Square Feet
Average People/Hr:	230
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	248,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Assumed-ACM - 2 Samples Taken)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-6

Description: 9” X 9” Floor Tile Covered By Carpet
Functional Space: Corridors
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 3,546 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-08-01**
Location:	Corridor, Outside Activity Room #2
Date Sampled:	04-23-1996
Asbestos Content:	**10.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	3,546 Square Feet
Average People/Hr:	280
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	54,000
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-7

(FLOOR TILE/MASTIC – ABATED 2008)

Description: 9” x 9” Floor Tile W/Black Mastic
Functional Space: Gymnasium
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	4,035 Square Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	4,035 Square Feet
Average People/Hr:	50
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	54,000
Preventive Measures:	**None Required**

(Floor Tile/Mastic - Abated 2008)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FT-8

Description: 9” X 9” Floor Tile W/Black Mastic
Functional Space: Kitchen
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 425 Square Feet
Assumed ACM: Yes Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	425 Square Feet
Average People/Hr:	3
Population:	Food Services Personnel
Average Hours/Day:	4
Average Days/Year:	180
Person-Hours/Year:	2,160
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-09

Description: Tan Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Classrooms #7 & #8
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 1,250 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-09-01**
Location:	Center, Learning Resource Center #7
Date Sampled:	04-23-1996
Asbestos Content:	**8.0% Total (Floor Tile)** **20.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	1,250 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: **FT-9**
Description: Floor Tile Covered By Carpet
Functional Space: Classroom #1
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 600 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Low
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-01-01**
Location:	Center, PC Room #1
Date Sampled:	04-23-1996
Asbestos Content:	**5.0% Total (Floor Tile)**
	20.0% Total (Mastic)
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100
	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	600 Square Feet
Average People/Hr	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-13

Description: Tan Floor Tile W/Black Mastic (Under Carpet)
Functional Space: Classroom #11
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 650 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-13-01**
Location:	South Corner Staff Lounge #11
Date Sampled:	04-23-1996
Asbestos Content:	**8.0% Total (Floor Tile)** **15.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	650 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FT-14

Description: White 12” x 12” Floor Tile W/Black Mastic
Functional Space: Classroom #15
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 650 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**FT-14-01**
Location:	Entry, Southeast Side Classroom #15
Date Sampled:	04-23-1996
Asbestos Content:	**10.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**FT-14-02**
Location:	Entry, Southwest Side Classroom #15
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-01-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	650 Square Feet
Average People/Hr:	5
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	7,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: FTM-1

(FLOOR TILE - CLASSROOMS #2, #3, & #4 - ABATED 1990)

(FLOOR TILE - CLASSROOM #17 - ABATED 1991 - MASTIC ENCAPSULATED)

Description: Floor Tile Mastic Covered By Carpet
Functional Space: Classrooms #2, #3, #4, & #17
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 3,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

2 Samples Taken --- ATC Report Dated: 01-11-1991 & 09-11-1990

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**SE-1-1**
Location:	North Central Carpet Area Near, Classroom #17
Date Sampled:	01-09-1991
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-09-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SE-1-2**
Location:	Southwest Corner Classroom #17
Date Sampled:	01-09-1991
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	01-09-1991
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	3,000 Square Feet
Average People/Hr:	115
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	124,200
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(Floor Tile - Classrooms #2, #3, & #4 - Abated 1990 – Mastic Encapsulated)

(Floor Tile - Classroom 17 - Abated 1991 - Mastic Encapsulated)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: CT-1

Description: 2.5' x 7.5' Layered Tectum Ceiling
Functional Space: Classrooms, Media Center, Hallway, & Gymnasium
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 23,700 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

7 Samples Taken --- ATC Report Dated: 06-05-1990
6 Samples Taken --- Reservoirs Report Dated: 03-14-2014

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SH-1-1**
Location:	Classroom #6 Northeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-2**
Location:	Classroom #4 Northeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-3**
Location:	Classroom #18 East Central
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-4**
Location:	Classroom #14 Northwest Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-5**
Location:	Classroom #16 Northwest Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-6**
Location:	Classroom #17 Southeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-1-7**
Location:	Classroom #10 South Central
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**13-14-B001**
Location:	Boy's Restroom North Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Yellow Foam) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B002**
Location:	Classroom #9 Northwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Yellow Foam) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B003**
Location:	Classroom #4 Southwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Yellow Foam) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B007**
Location:	Classroom #3 Southwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Black Tar) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B008**
Location:	Classroom #3 Southwest Center
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Black Tar) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.

Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B009**
Location:	Classroom #3 Southwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total (Black Tar) 0.0% Total (Black Felt)
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	23,700 Square Feet
Average People/Hr:	208
Population:	Students
Average Hours/Day:	6
Average Days/Year:	108
Person-Hours/Year:	134,784
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-2

Description: 2' x 4' Dot Matrix Ceiling Tile
Functional Space: Music Room, Stage, PE Office, Remedial Reading, & Administrative Office
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 2,675 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- ATC Report Dated: 06-05-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SH-2-1**
Location:	Remedial Reading Northwest Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-2-2**
Location:	Teacher's Room Southeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-2-3**
Location:	Workroom, Southeast Corner, Corridor
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-2-4**
Location:	Office, South Center
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-2-5**
Location:	Office, Near Door Principal Office
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2,675 Square Feet
Average People/Hr:	45
Population:	Administrative
Average Hours/Day:	8
Average Days/Year:	180
Person-Hours/Year:	64,800
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-3

Description: 12" x 12" Perforated Ceiling Tile W/Mastic
Functional Space: Band Room
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 880 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 06-05-1990
3 Samples Taken --- ATC Report Dated: 11-12-1992
2 Samples Taken --- Reservoirs Report Dated: 09-27-2013

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SH-3-1**
Location:	Corridor, Band Room & Boiler Room (Tile & Mastic)
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-3-2**
Location:	Band Room South Central
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-3-3**
Location:	Band Room East Central
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**#1**
Location:	Band Room Replacement Tile
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#2**
Location:	Band Room Replacement Tile
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#3**
Location:	Band Room Replacement Tile
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939

EPA/NBS Accred Lab: 5147-058

Sample Number: **13-13-B007**
Location: Band Room
West End, Center
Date Sampled: 09-16-2013
Asbestos Content: 0.0% Total (Mastic)
Asbestos Type: None
Analysis Date: 09-27-2013

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

Sample Number: **13-13-B008**
Location: Band Room
East End, Center
Date Sampled: 09-16-2013
Asbestos Content: 0.0% Total (Mastic)
Asbestos Type: None
Analysis Date: 09-27-2013

Laboratory Name: RESERVOIRS ENVIRONMENTAL INC.
Address: 5801 Logan Street. Suite 100
Denver, Colorado 80216
Telephone: (303)-964-1986
EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	880 Square Feet
Average People/Hr:	39
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	42,120
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CT-5

Description: 2' x 4' Random Perforated Ceiling Tile
Functional Space: South Media Center & Social Worker Room
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size:	625 Square Feet
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	Negative
Friable:	Yes
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	Low
Potential For Contact:	Low
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes

Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 06-05-1990

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SH-5-1**
Location:	Media Center Stage Northeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-5-2**
Location:	Media Center Stage Northwest Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-5-3**
Location:	Media Center Stage Southeast Corner
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	625 Square Feet
Average People/Hr:	45
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	48,600
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-1

(NO SUSPECT MATERIAL WITH-IN DOOR)

Description: Material With-In Fire Rated Door
Functional Space: Boiler Room
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 1 Door
Assumed ACM: No Condition: Good
Results From Sampled ACM: None
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: No
Manner Of Sampling: None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	1 Door
Average People/Hr:	1
Population:	Maintenance Personnel
Average Hours/Day:	1
Average Days/Year:	180
Person-Hours/Year:	180
Preventive Measures:	**None Required**

(No Suspect Material With-In Door)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: FD-2

(NO SUSPECT MATERIAL WITH-IN DOORS)

Description: Exterior Fire Doors
Function Space: Throughout Building
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size:	12 Doors
Assumed ACM:	No Condition: Good
Results From Sampled ACM:	None
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	Low
Air Flow In Area:	Yes
Manner Of Sampling:	None

**** No Sample Information Available ****

AHERA Category: N/A

Hazard Rank: N/A

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	12 Doors
Average People/Hr:	280
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Years:	54,000
Preventive Measures:	**None Required**

(No Suspect Material With-In Doors)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: DWWC-3

(DRYWALL SOFFIT – NORTHWEST END – ABATED 2014)

Description: Drywall Soffit W/Joint Compound
Functional Space: Library
Date Inspected: 03-12-2014
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 850 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Surfacing Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 03-14-2014

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

***** Bulk Sample Information *****

Sample Number:	**13-14-B010**
Location:	Library Northwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.12% (Composite Sample)**
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B011**
Location:	Classroom #6 West Center
Date Sampled:	03-12-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.15% (Composite Sample)**
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B012**
Location:	Classroom #6 Southwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	**3.0% Total (Joint Compound)** **0.24% (Composite Sample)**
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100

	Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	850 Square Feet
Average People/Hr:	35
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	37,800
Preventive Measures:	**Conduct 6-Month Periodic Surveillance (Drywall Soffit – Northwest End – Abated 2014)**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: DWC-4

Description: Drywall Ceiling W/Joint Compound
Functional Space: Office, Kitchen, Restrooms, Health Room, & Vestibules
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 4,000 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Surfacing Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

8 Samples Taken --- ATC Report Dated: 06-05-1990

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**SH-4-1**
Location:	Classroom #6 North Corner, Wall
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-4-2**
Location:	East Side South Entrance, Ceiling
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-4-3**
Location:	Teacher’s Room Southeast Corner, Wall
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-4-4**
Location:	Workroom, Northwest Corner, Wall
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-4-5**
Location:	Classroom #10 Southeast Corner, Wall
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-4-6**
Location:	East Wall, Corridor Between, Band & Boiler Room
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 West 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209

EPA/NBS Accred Lab: 1081-01

Sample Number: **SH-4-7**
Location: Northwest Boy's Restroom
Center, North Wall
Date Sampled: 05-02-1990
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 05-02-1990

Laboratory Name: ATC ENVIRONMENTAL INC.
Address: 2600 West 29th Ave.
Denver, CO 80211
Telephone: (303)-480-0209
EPA/NBS Accred Lab: 1081-01

Sample Number: **97-DW-1**
Location: Ceiling, South Entrance
Date Sampled: 04-22-1997
Asbestos Content: 0.0% Total
Asbestos Type: None
Analysis Date: 04-22-1997

Laboratory Name: ATC ASSOCIATES INC.
Address: 5031 S. Ulster St. Suite 100
Denver, Colorado 80237
Telephone: (303)-793-9939
EPA/NBS Accred Lab: 102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	40,000 Square Feet
Average People/Hr:	120
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	129,600
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: SSM-6

Description: Drywall Ceiling W/Popcorn Texture
Functional Space: Classroom #6
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 250 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 06-05-1990
3 Samples Taken --- Reservoirs Report Dated: 03-14-2014

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**SH-6-1**
Location:	Classroom #6, Southwest Corner, Sprayed-On Area
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-6-2**
Location:	Classroom #6, West Central, Spray-On Area
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**SH-6-3**
Location:	Classroom #6, North Central, Spray-On Area
Date Sampled:	05-02-1990
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	05-02-1990
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	2600 W. 29th Ave. Denver, CO 80211
Telephone:	(303)-480-0209
EPA/NBS Accred Lab:	1081-01

Sample Number:	**13-14-B004**
Location:	Classroom #6 Northwest Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B005**
Location:	Classroom #6 Southeast Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-14-B006**
Location:	Classroom #6 Southeast Corner
Date Sampled:	03-12-2014
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	03-13-2014
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986

EPA/NBS Accred Lab: 101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	250 Square Feet
Average People/Hr:	35
Population:	Administrative
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	37,800
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-1

Description: Cove Base W/Adhesive
Functional Space: Throughout Building
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

4 Samples Taken --- ATC Report Dated: 10-16-1992

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information *****

Sample Number:	**#4**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#5**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#6**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**BC-01-01**
Location:	Entry, PC Room #1
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	N/A
Quantity:	500 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action ----------

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-02

Description: Orange Cove Base W/Brown Adhesive
Functional Space: Media Center, Remedial Reading, & Music Room
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 500 Linear Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Trace**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**BC-02-01**
Location:	East Entry IMC Media Center
Date Sampled:	04-23-1996
Asbestos Content:	**Trace (Adhesive)**
Asbestos Type:	Trem-Act
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-02-02**
Location:	West Entry Remedial Reading
Date Sampled:	04-23-1996
Asbestos Content:	**Trace (Adhesive)**
Asbestos Type:	Trem-Act
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-02-03**
Location:	East Entry Music Room Landing
Date Sampled:	04-23-1996
Asbestos Content:	**Trace (Adhesive)**
Asbestos Type:	Trem-Act
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	500 Linear Feet
Average people/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: BC-03

(ASSUMED-ACM - 2 SAMPLES TAKEN)

Description: Black Cove Base W/Brown Adhesive
Functional Space: Classroom #5
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	100 Linear Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes
Manner Of Sampling:	

2 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**BC-03-01**
Location:	North Side, Entry Classroom #5
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**BC-03-02**
Location:	Not Listed
Date Sampled:	04-23-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	100 Linear Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance (Assumed-ACM - 2 Samples Taken)**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: BC-04

(ASSUMED ACM - 1 SAMPLE TAKEN)

Description: Dark Brown Base Cove W/Tan Adhesive
Functional Space: Foyer South Entrance
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size:	32 Linear Feet
Assumed ACM:	Yes Condition: Good
Results From Sampled ACM:	Negative
Friable:	No
Material:	Miscellaneous Material
Extent Of Damage:	None
Accessible:	High
Potential For Contact:	High
Influence Of Vibration:	Low
Potential For Air Erosion:	Low
Disturbance Potential:	High
Air Flow In Area:	Yes

Manner Of Sampling:

1 Sample Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

**** Bulk Sample Information ****

Sample Number:	**BC-04-01**
Location:	Demo Area
Date Sampled:	12-13-1996
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	12-18-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment ----------

Hazard Rank:	7
Quantity:	32 Linear Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**
	(Assumed-ACM - 1 Sample Taken)

----- Recommended Response Action ----------

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: CB-1

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS)

Description: Chalkboards W/Brown Mastic
Functional Space: Classrooms
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 630 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 06-01-2012

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information ****

Sample Number:	**13-12-B001**
Location:	Classroom #10
Date Sampled:	04-11-2012
Asbestos Content:	0.0% Total (Mastic)
Asbestos Type:	None
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-12-B002**
Location:	Classroom #10
Date Sampled:	04-11-2012
Asbestos Content:	0.0% Total (Mastic)
Asbestos Type:	None
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-12-B003**
Location:	Classroom #5
Date Sampled:	04-11-2012
Asbestos Content:	0.0% Total (Mastic)
Asbestos Type:	None
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	650 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

(No Suspect Material With-In Chalkboards)

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CB-2

(NO SUSPECT MATERIAL WITH-IN CHALKBOARDS – MASTIC PUCKS POSITIVE)

Description: Chalkboards W/Gray Mastic
Functional Space: Classrooms
Date Inspected: 04-11-2012
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment ----------

Size: 630 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 06-01-2012

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 7

***** Bulk Sample Information ****

Sample Number:	**13-12-B004**
Location:	Classroom #17
Date Sampled:	04-11-2012
Asbestos Content:	**4.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-12-B005**
Location:	Classroom #17
Date Sampled:	04-11-2012
Asbestos Content:	**3.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-12-B006**
Location:	Classroom #17
Date Sampled:	04-11-2012
Asbestos Content:	**3.0% Total (Mastic)**
Asbestos Type:	**Chrysotile**
Analysis Date:	05-31-2012
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	7
Quantity:	650 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

(No Suspect Material With-In Chalkboards – Mastic Pucks Positive)

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: EG-1

Description: HVAC Expansion Joints
Functional Space: Custodial Closet
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

----- Physical Assessment -----

Size: 2 Square Feet
Assumed ACM: No Condition: Damaged
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: 10%
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 10-16-1992

AHERA Category: N/A

Hazard Rank: N/A

***** Bulk Sample Information ****

Sample Number:	**#7**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#8**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

Sample Number:	**#9**
Location:	Custodial Closet
Date Sampled:	10-16-1992
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	10-21-1992
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, CO 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	5147-058

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	2 Square Feet
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: TSI-01

Description: White Powdery Fitting Material
Functional Space: Staff Lounge & Classrooms (Behind Counters)
Date Inspected: 05-04-2006
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- ATC Report Dated: 09-1996

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 6

**** Bulk Sample Information ****

Sample Number:	**TSI-01-01**
Location:	West Corner, Kindergarten #10 Heat Register
Date Sampled:	04-23-1996
Asbestos Content:	**10.0% Total**
Asbestos Type:	**Chrysotile & Amosite**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-01-02**
Location:	North Corner, Staff Lounge Heat Register
Date Sampled:	04-23-1996
Asbestos Content:	**15.0% Total**
Asbestos Type:	**Chrysotile & Amosite**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

Sample Number:	**TSI-01-03**
Location:	North Corner Classroom #12
Date Sampled:	04-23-1996
Asbestos Content:	**10.0% Total**
Asbestos Type:	**Chrysotile & Amosite**
Analysis Date:	04-09-1996
Laboratory Name:	ATC ENVIRONMENTAL INC.
Address:	5031 S. Ulster St. Suite 100 Denver, Colorado 80237
Telephone:	(303)-793-9939
EPA/NBS Accred Lab:	102031

----- Risk Assessment -----

Hazard Rank:	6
Quantity:	Quantity Unknown
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: TSI-02

Description: Gray Boiler Seam Caulk
Functional Space: Boiler Room
Date Inspected: 09-16-2013
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 60 Linear Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: No
Material: Thermal System Insulation
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 09-27-2013

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 6

**** Bulk Sample Information ****

Sample Number:	**13-13-B001**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**2.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-13-B002**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-13-B003**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**3.0% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	6
Quantity:	60 Linear Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: TSI-02

Description: White/Brown Boiler Insulation
Functional Space: Boiler Room
Date Inspected: 09-16-2013
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: **Positive**
Friable: Yes
Material: Thermal System Insulation
Extent Of Damage: None
Accessible: Low
Potential For Contact: Low
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Low
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 09-27-2013

AHERA Category: 5 ACBM With Potential For Damage

Hazard Rank: 6

**** Bulk Sample Information ****

Sample Number:	**13-13-B004**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**100% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-13-B005**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**100% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-13-B006**
Location:	Boiler Room North Side of Boiler
Date Sampled:	09-16-2013
Asbestos Content:	**100% Total**
Asbestos Type:	**Chrysotile**
Analysis Date:	09-27-2013
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	6
Quantity:	60 Linear Feet
Average People/Hr:	5
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	5,400
Preventive Measures:	**Conduct 6-Month Periodic Surveillance**

----- Recommended Response Action -----

Implement Proper O&M Procedures Should The Material Become Damaged

Approximate Cost: $0

Homogeneous Area ID: WES-1

Description: White End Sealant On Piping
Functional Space: Throughout Building
Date Inspected: 10-8-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: Quantity Unknown
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: No
Material: Miscellaneous Material
Extent Of Damage: None
Accessible: Moderate
Potential For Contact: Moderate
Influence Of Vibration: Moderate
Potential For Air Erosion: Low
Disturbance Potential: Moderate
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 08-30-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**13-10-B006**
Location:	Boiler Room Southwest Corner
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B007**
Location:	Boiler Room Southeast Corner
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B008**
Location:	Boiler Room West End
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	Quantity Unknown
Average People/Hr:	1
Population:	Maintenance
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	1,080
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: CMU-1

Description: Concrete Masonry Unit
Functional Space: Throughout Building
Date Inspected: 10-8-2008
Inspector Name: Rick Seiler
Inspector Accred: 3481
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----------

Size: 3,500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

5 Samples Taken --- Reservoirs Report Dated: 08-30-2010

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**13-10-B001**
Location:	Custodial Office East Wall
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B002**
Location:	Kitchen Storage Area
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B003**
Location:	Band Room West Wall
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B004**
Location:	Hallway, Outside Boiler Room
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-10-B005**
Location:	Boys Restroom Outside, Classroom #9
Date Sampled:	08-13-2010
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	08-28-2010
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	3,500 Square Feet
Average People/Hr:	30
Population:	Students

Average Hours/Day: 6
Average Days/Year: 180
Person-Hours/Year: 32,400
Preventive Measures: **None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

Homogeneous Area ID: WP-1

Description: Window Putty
Functional Space: Throughout Building
Date Inspected: 2-15-2020
Inspector Name: Darren Trujillo
Inspector Accred: 22590
Blueprint: 13.A
Blueprint Location: Maintenance Records Office

---- Physical Assessment ----

Size: 3,500 Square Feet
Assumed ACM: No Condition: Good
Results From Sampled ACM: Negative
Friable: Yes
Material: Surfacing Material
Extent Of Damage: None
Accessible: High
Potential For Contact: High
Influence Of Vibration: Low
Potential For Air Erosion: Low
Disturbance Potential: High
Air Flow In Area: Yes
Manner Of Sampling:

3 Samples Taken --- Reservoirs Report Dated: 02-15-2020

AHERA Category: N/A

Hazard Rank: N/A

**** Bulk Sample Information ****

Sample Number:	**13-20-B001**
Location:	Principals Office South Wall
Date Sampled:	02-13-2020
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	02-13-2020
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-20-B002**
Location:	Kitchen Classroom 18
Date Sampled:	02-13-2020
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	02-13-2020
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

Sample Number:	**13-20-B003**
Location:	Band Room Classroom 17
Date Sampled:	02-13-2020
Asbestos Content:	0.0% Total
Asbestos Type:	None
Analysis Date:	02-13-2020
Laboratory Name:	RESERVOIRS ENVIRONMENTAL INC.
Address:	5801 Logan Street. Suite 100 Denver, Colorado 80216
Telephone:	(303)-964-1986
EPA/NBS Accred Lab:	101533-480

----- Risk Assessment -----

Hazard Rank:	N/A
Quantity:	3,500 Square Feet
Average People/Hr:	30
Population:	Students
Average Hours/Day:	6
Average Days/Year:	180
Person-Hours/Year:	32,400
Preventive Measures:	**None Required**

----- Recommended Response Action -----

None Required

Approximate Cost: $0

5.4 Prioritized Listing Of Homogeneous Materials & Salients

Sherrelwood Elementary

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
FT-1	Administrative Area	N/A	4,800	$0
FT-02	Media Center	N/A	7,200	$0
FT-2	Administrative Area	N/A	4,800	$0
FT-03	Classrooms, Remedial Reading, & Cust. Closet	N/A	7,200	$0
FT-3	Classroom #2	N/A	54,000	$0

FT-4	Classrooms	N/A	248,400	$0
FT-6	Corridors	N/A	54,000	$0
FT-7	Gymnasium	N/A	54,000	$0
FT-8	Kitchen	7	2,160	$0
FT-09	Classrooms #7 & #8	N/A	7,200	$0
FT-9	Classroom #1	N/A	32,400	$0
FT-13	Classroom #11	N/A	7,200	$0
FT-14	Classroom #15	N/A	7,200	$0
FTM-1	Classrooms #2, #3, #4, & #17	N/A	124,200	$0
CT-1	Classroom, Media Center, Hallway, & Gymnasium	N/A	134,784	$0
CT-2	Music Room, Stage, PE Office, Remedial Reading, & Administrative Office	N/A	64,800	$0
CT-3	Band Room	N/A	42,120	$0
CT-5	South Media Center & Social Worker Room	N/A	48,600	$0
FD-1	Boiler Room	N/A	180	$0
FD-2	Throughout Building	N/A	54,000	$0
DWWC-3	Library	7	37,800	$0
DWWC-4	Office, Kitchen, Restrooms, Health Room, & Vestibules	N/A	129,600	$0
SSM-6	Classroom #6	N/A	37,800	$0

Area ID	Functional Space	Hazard Rank	People Hrs/Yr	Remedial Action Cost
BC-1	Throughout Building	N/A	32,400	$0
BC-02	Media Center, Remedial Reading, & Music Room	N/A	32,400	$0
BC-03	Classroom #5	N/A	32,400	$0
BC-04	Foyer South Entrance	N/A	32,400	$0
CB-1	Classrooms	N/A	32,400	$0
CB-2	Classrooms	N/A	32,400	$0
EG-1	Custodial Closet	N/A	1,080	$0
TSI-01	Staff Lounge & Classrooms	6	5,400	$0
TSI-02	Boiler Room	6	5,400	$0
TSI-03	Boiler Room	6	5,400	$0

WES-1	Throughout Building	N/A	1,080	$0
CMU-1	Throughout Building	N/A	32,400	$0
WP-1	Throughout Building	N/A	32,400	$0

Total Cost Of Recommended Actions: $0

5.5 Floor Plans

SHERRELWOOD
TABLE OF CONTENTS FOR DRAWINGS

FILE - 13F1

LAYER
1 - 9 OPEN
10 MASTER

FILE - WALL

LAYER
1 - 9 OPEN
10 MASTER

FILE - FT1-9

LAYER
1 FT-1
2 FT-2
3 FTM-1
4 FT-3
5 FT-4
6 FT-6
7 FT-7
8 FT-8
9 FT-9
10 MASTER

FILE - CT

LAYER
1 CT-3
2 CT-7
3 DWWC-4
4 CT-1
5 CT-2
6 CT-5
7 - 9 OPEN
10 MASTER

FILE - MISC

LAYER
1 FD-1
2 CSM-6
3 BC-1
4 CB-1
5 ACM-1
6 FD-2
7 - 9 OPEN
10 MASTER