

부재 AB 배근 검토도


검토용 - 시공 및 최종 설계 승인용 아님

상세: R @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

단면 300 x 600 mm

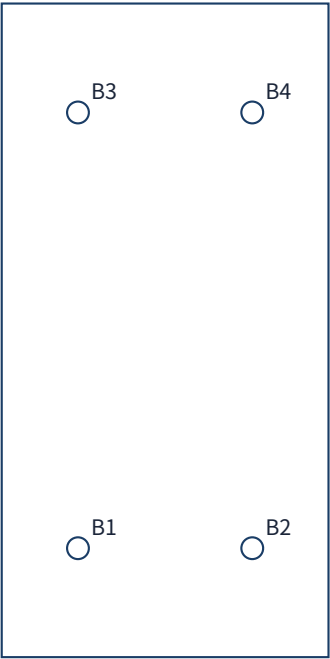

배근 구간 길이 3000 mm



피복 40 mm

철근 일람 - 형상 길이 / 제작 승인 및 정착 검토 별도

- B1 직경 20 1개 본체 3000 mm 절단 길이 미확정
- B2 직경 20 1개 본체 3000 mm 절단 길이 미확정
- B3 직경 20 1개 본체 3000 mm 절단 길이 미확정
- B4 직경 20 1개 본체 3000 mm 절단 길이 미확정

rc-section-strength: DESIGN_STANDARD_SELECTION_REQUIRED
rc-stability: BRACED_COLUMN_CLASSIFICATION_AND_REFERENCE_REQUIRED
rc-shear-y: DESIGN_STANDARD_SELECTION_REQUIRED
rc-shear-z: DESIGN_STANDARD_SELECTION_REQUIRED
rc-spacing: DESIGN_STANDARD_SELECTION_REQUIRED
추가 미완료 항목 6건: 뒤쪽 검사별 계산서 참조


기초 F 하부 배근 검토도

검토용 - 시공 및 최종 설계 승인용 아님



상세: F @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed



평면 2000 x 2000 mm

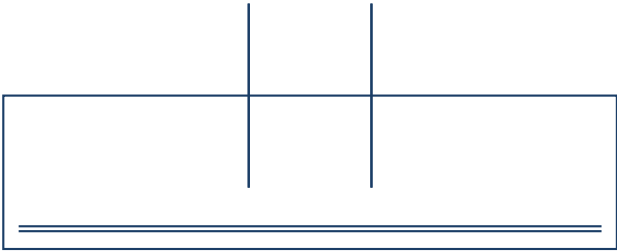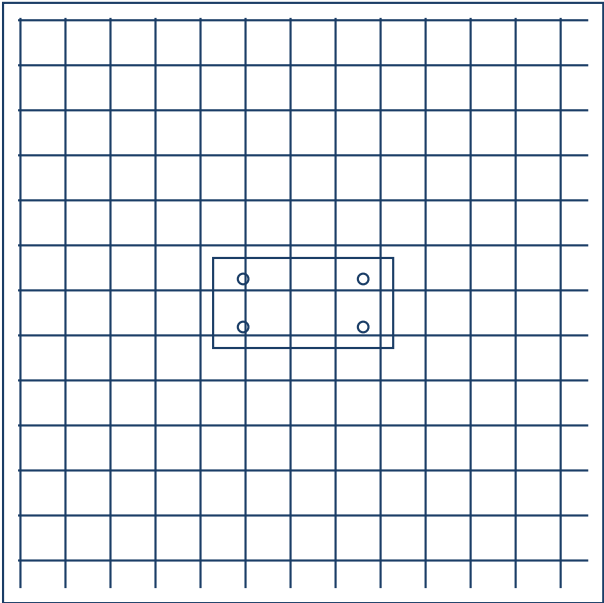

두께 500 / 피복 50 mm
기둥 연속 주근 4개 / 매입 300 mm

반력 자중 범위: superstructure-only

지반 참조: G@1

- foundation-sliding: FRICTION_AND_WEIGHT_ACCOUNTING_REQUIRED
- foundation-punching: PUNCHING_REINFORCEMENT_EXTENSION_INSUFFICIENT
- foundation-spacing: FOOTING_SPACING_INPUT_REQUIRED
- foundation-code-compliance: REQUIRED_KDS_CHECKS_INCOMPLETE

기초 F 상부 배근 검토도


검토용 - 시공 및 최종 설계 승인용 아님

상세: F @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

평면 2000 x 2000 mm

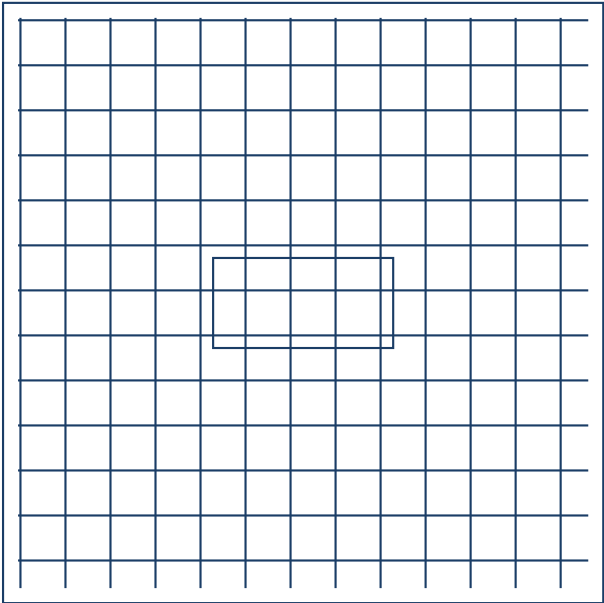

두께 500 / 피복 50 mm
기둥 연속 주근 4개 / 매입 300 mm

반력 자중 범위: superstructure-only

지반 참조: G@1

- foundation-sliding: FRICTION_AND_WEIGHT_ACCOUNTING_REQUIRED
- foundation-punching: PUNCHING_REINFORCEMENT_EXTENSION_INSUFFICIENT
- foundation-spacing: FOOTING_SPACING_INPUT_REQUIRED
- foundation-code-compliance: REQUIRED_KDS_CHECKS_INCOMPLETE

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.1.1, 4.1.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 14 20 10:2021 콘크리트구조 해석과 설계 원칙

조항/식/표: 4.2.3

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142010>

SHA-256: 37b8a499e44e4607bd06ff4a134d97db2aa0b35925ea364dd6f60421eee6b994

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.4.6

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

적용 확인 필요: KDS 14 20 10:2021 콘크리트구조 해석과 설계 원칙

조항/식/표: 4.2.3(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142010>

SHA-256: 37b8a499e44e4607bd06ff4a134d97db2aa0b35925ea364dd6f60421eee6b994

적용 확인 필요: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.2.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

적용 확인 필요: KDS 14 20 01:2022 콘크리트구조 설계(강도설계법) 일반사항

조항/식/표: 3.1.1(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142001>

SHA-256: b51425ceec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780

적용 확인 필요: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.3.1, 4.3.6

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.2, 4.3

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 14 20 30:2021 콘크리트구조 사용성 설계기준

조항/식/표: 4.2.1(3); Eq.4.2-2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142030>

SHA-256: 0f352bbf1f3c9fe93dc5a3c3a12eaa21daae170ef2ad022b3faa295604f7266b

적용 확인 필요: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.4

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.1, 4.5

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.5.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.5.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.5.3

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 01:2022 콘크리트구조 설계(강도설계법) 일반사항

조항/식/표: 3.1.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142001>

SHA-256: b51425cec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 14 20 30:2021 콘크리트구조 사용성 설계기준

조항/식/표: 4.2.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142030>

SHA-256: 0f352bbf1f3c9fe93dc5a3c3a12eaa21daae170ef2ad022b3faa295604f7266b

적용 확인 필요: KDS 14 20 30:2021 콘크리트구조 사용성 설계기준

조항/식/표: 4.1, 4.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142030>

SHA-256: 0f352bbf1f3c9fe93dc5a3c3a12eaa21daae170ef2ad022b3faa295604f7266b

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.2.3(4); Eq.4.2-3; Eq.4.2-4

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 41 20 00:2024 건축물 콘크리트구조 설계기준

조항/식/표: 4

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/412000>

SHA-256: e635ceb4dd9b0b664b7bb37c7a9e1ada660feef9dce7444fc094305f8f7d9a5c

적용 확인 필요: KDS 11 50 05:2025 얇은기초 설계기준(일반설계법)

조항/식/표: 4.1.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/115005>

SHA-256: fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172

적용 확인 필요: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 11 50 05:2025 얇은기초 설계기준(일반설계법)

조항/식/표: 1.9, 4.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/115005>

SHA-256: fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172

적용 확인 필요: KDS 11 50 05:2025 얇은기초 설계기준(일반설계법)

조항/식/표: 1.9(5), 4.1.7(1)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/115005>

SHA-256: fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 11 50 05:2025 얇은기초 설계기준(일반설계법)

조항/식/표: 1.9(4)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/115005>

SHA-256: fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172

적용: KDS 14 20 10:2021 콘크리트구조 해석과 설계 원칙

조항/식/표: 4.2.3(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142010>

SHA-256: 37b8a499e44e4607bd06ffa4a134d97db2aa0b35925ea364dd6f60421eee6b994

적용: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.1.1(3),(8) Table 4.1-2; 4.1.2(3)-(7) Eq.4.1-17

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4.2.1(1); 4.3.3(1); 4.11.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

적용: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4.2.1(1); 4.3.3(1); 4.11.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

적용: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.1(5); 4.2.2.2(1),(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4.11.1; 4.11.2(2), Eq.4.11-1..8

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

적용 확인 필요: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4.11.7(1)-(5); Eq.4.11-14; Eq.4.11-16; Eq.4.11-17; Eq.4.11-18

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.1.2(1),(3),(5); Eq.4.1-2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 22:2022 콘크리트구조 전단 및 비틀림 설계기준

조항/식/표: 4.11

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142022>

SHA-256: 0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e

적용: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.2.2(3)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.6.2(1),(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.2.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.6.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

적용 확인 필요: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.1(5); 4.2.2.2(1),(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 50:2022 콘크리트구조 철근상세 설계기준

조항/식/표: 4.2.2(1),(2)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142050>

SHA-256: 400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용 확인 필요: KDS 14 20 01:2022 콘크리트구조 설계(강도설계법) 일반사항

조항/식/표: 3.1.1(2)④

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142001>

SHA-256: b51425cec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780

적용: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.1(5)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.1(5)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.2.1(3),(4); Eq.4.2-1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.2.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.2.3(1)-(3)

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.1.2(1),(3),(5); Eq.4.1-2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용 확인 필요: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.1

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

KDS 계산 근거 및 적용 범위

검토용 - 시공 및 최종 설계 승인용 아님

상세: code-basis @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

적용: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.7

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용: KDS 14 20 52:2024 콘크리트구조 정착 및 이음 설계기준

조항/식/표: 4.1.3; Eq.4.1-3

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142052>

SHA-256: 2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51

적용: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.3.1, 4.2.3.2

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 70:2021 콘크리트 슬래브와 기초판 설계기준

조항/식/표: 4.2.3

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142070>

SHA-256: eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b

적용 확인 필요: KDS 14 20 20:2022 콘크리트구조 휨 및 압축 설계기준

조항/식/표: 4.7

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/142020>

SHA-256: bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3

적용 확인 필요: KDS 11 50 05:2025 얇은기초 설계기준(일반설계법)

조항/식/표: 4.2.1, 4.2.6

공식 출처: <https://kcsc.re.kr/OpenApi/CodeViewer/KDS/115005>

SHA-256: fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172

해석 원본 및 수렴 근거

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

하중조합: U / 원본: E:2026-09-13T23:58:22.126Z:1

원본.source.analysisRunId: E:2026-09-13T23:58:22.126Z:1

원본.source.combold: U

원본.resultHash: 해시 H1

3eeaec69ace0f8e87a27624b938308f632083188ab0693a0727fcc646771e9e9

실무 검토 집계

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

NG 1 · 미검토 14 · 실패 0 · 미완료 검사 14 (NG와 중복 가능)

프로젝트 적용 범위 및 하중 확인

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

coverage: 공통 자료 D1
coverage.projectProfile: 공통 자료 D2
coverage.projectProfile.qualification: user-declared-scope-only
coverage.projectProfile.codeQualified: 아니오
coverage.projectProfile.loadScopeHash: 해시 H2
fca5bd5fea748c47032811630fdd76b3491f3ff16dd5e4b2a7ad627a32836055
coverage.projectProfile.status: NOT_CHECKED
coverage.projectProfile.issues.0.code: PROJECT_PROFILE_REQUIRED
coverage.basis: all-active-declared-combinations; code-generatio
n-and-load-family-qualification-separate
coverage.expectedIds: ["U"]
coverage.missingIds: []
coverage.evaluatedComboids: ["U"]
coverage.missingEvaluationIds: []
coverage.missingPurposes: ["service"]
coverage.codeQualified: 아니오

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

R@1 / B1 / longitudinal
geometricQuantity: B1 / NOT_CHECKED / 조각 미정개 / 단면적 0.00031415926 535897936 m²
조각 기하 길이 합 미정 m / 체적 미정 m³ / 제작 미승인
사유: LONGITUDINAL_END_LENGTH_REQUIRED
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
부재 ID: AB
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
단면적 근거: geometric-diameter
제품 호칭: 미정
productCatalogId: 미정
unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
제품 자료: 미정
제품 판본: 미정
제품 확인 상태: geometric-diameter
개수: 1
본체 길이 (m): 3
본체 체적 (m³): 0.000942477796076938
형상 길이 (m): 미정
사유: BAR_SHAPE_NOT_DEFINED
제작 승인: 아니오
R@1 / B2 / longitudinal
geometricQuantity: B2 / NOT_CHECKED / 조각 미정개 / 단면적 0.00031415926 535897936 m²
조각 기하 길이 합 미정 m / 체적 미정 m³ / 제작 미승인
사유: LONGITUDINAL_END_LENGTH_REQUIRED
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
부재 ID: AB
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
단면적 근거: geometric-diameter
제품 호칭: 미정
productCatalogId: 미정

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
제품 자료: 미정
제품 판본: 미정
제품 확인 상태: geometric-diameter
개수: 1
본체 길이 (m): 3
본체 체적 (m³): 0.000942477796076938
형상 길이 (m): 미정
사유: BAR_SHAPE_NOT_DEFINED
제작 승인: 아니오
R@1 / B3 / longitudinal
geometricQuantity: B3 / NOT_CHECKED / 조각 미정개 / 단면적 0.00031415926
535897936 m²
조각 기하 길이 합 미정 m / 체적 미정 m³ / 제작 미승인
사유: LONGITUDINAL_END_LENGTH_REQUIRED
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
부재 ID: AB
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
단면적 근거: geometric-diameter
제품 호칭: 미정
productCatalogId: 미정
unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
제품 자료: 미정
제품 판본: 미정
제품 확인 상태: geometric-diameter
개수: 1
본체 길이 (m): 3
본체 체적 (m³): 0.000942477796076938
형상 길이 (m): 미정
사유: BAR_SHAPE_NOT_DEFINED

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

제작 승인: 아니오

R@1 / B4 / longitudinal

geometricQuantity: B4 / NOT_CHECKED / 조각 미정개 / 단면적 0.00031415926
535897936 m²

조각 기하 길이 합 미정 m / 체적 미정 m³ / 제작 미승인

사유: LONGITUDINAL_END_LENGTH_REQUIRED

공칭 질량: 미확정 / 단중 미확정 kg/m

대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도

질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED

가공 공차와 구매 손실은 포함하지 않음

부재 ID: AB

직경 (m): 0.02

단면적 (m²): 0.00031415926535897936

단면적 근거: geometric-diameter

제품 호칭: 미정

productCatalogId: 미정

unitMassKgPerM: 미정

공칭 질량: 미확정 / 단중 미확정 kg/m

대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도

질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED

가공 공차와 구매 손실은 포함하지 않음

pieceMassKg: 미정

totalMassKg: 미정

제품 자료: 미정

제품 판본: 미정

제품 확인 상태: geometric-diameter

개수: 1

본체 길이 (m): 3

본체 체적 (m³): 0.000942477796076938

형상 길이 (m): 미정

사유: BAR_SHAPE_NOT_DEFINED

제작 승인: 아니오

F@1 / F-B / foundation-bar

배근 면: bottom

직경 (m): 0.016

단면적 (m²): 0.00020106192982974675

제품 호칭: 미정

productCatalogId: 미정

unitMassKgPerM: 미정

공칭 질량: 미확정 / 단중 미확정 kg/m

대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도

질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED

가공 공차와 구매 손실은 포함하지 않음

pieceMassKg: 미정

totalMassKg: 미정

개수: 13

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

본체 길이 (m): 1.9
형상 길이 (m): 1.9
제작 승인: 아니오
사유: STRAIGHT_GEOMETRY_ONLY; DEVELOPMENT_REVIEW_SEPARATE
F@1 / F-L / foundation-bar
배근 면: bottom
직경 (m): 0.016
단면적 (m²): 0.00020106192982974675
제품 호칭: 미정
productCatalogId: 미정
unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
개수: 13
본체 길이 (m): 1.9
형상 길이 (m): 1.9
제작 승인: 아니오
사유: STRAIGHT_GEOMETRY_ONLY; DEVELOPMENT_REVIEW_SEPARATE
F@1 / C1 / column-bar-extension
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
질량 집계 범위: below-interface-extension-only
가공 공차와 구매 손실은 포함하지 않음
제품 호칭: 미정
제품 자료: 미정
부재 ID: AB
memberMark: B1
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
개수: 1
본체 길이 (m): 0.3
본체 체적 (m³): 0.00009424777960769381
형상 길이 (m): 미정
continuousAboveLength: 0.3
aboveLengthIncludedInMember: 예
제작 승인: 아니오
사유: CONTINUOUS_BAR_EXTENSION_ONLY; FULL_FABRICATION_LENGTH_REQUIRED_MEMBER_GEOMETRY
F@1 / C2 / column-bar-extension
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbdd69cd0a0421ed

질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
질량 집계 범위: below-interface-extension-only
가공 공차와 구매 손실은 포함하지 않음
제품 호칭: 미정
제품 자료: 미정
부재 ID: AB
memberMark: B2
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
개수: 1
본체 길이 (m): 0.3
본체 체적 (m³): 0.00009424777960769381
형상 길이 (m): 미정
continuousAboveLength: 0.3
aboveLengthIncludedInMember: 예
제작 승인: 아니오
사유: CONTINUOUS_BAR_EXTENSION_ONLY; FULL_FABRICATION_LENGTH_REQUIRE_MEMBER_GEOMETRY
F@1 / C3 / column-bar-extension
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
질량 집계 범위: below-interface-extension-only
가공 공차와 구매 손실은 포함하지 않음
제품 호칭: 미정
제품 자료: 미정
부재 ID: AB
memberMark: B3
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
개수: 1
본체 길이 (m): 0.3
본체 체적 (m³): 0.00009424777960769381
형상 길이 (m): 미정
continuousAboveLength: 0.3
aboveLengthIncludedInMember: 예
제작 승인: 아니오
사유: CONTINUOUS_BAR_EXTENSION_ONLY; FULL_FABRICATION_LENGTH_REQUIRE_MEMBER_GEOMETRY
F@1 / C4 / column-bar-extension
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
질량 집계 범위: below-interface-extension-only
가공 공차와 구매 손실은 포함하지 않음
제품 호칭: 미정

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

제품 자료: 미정
부재 ID: AB
memberMark: B4
직경 (m): 0.02
단면적 (m²): 0.00031415926535897936
개수: 1
본체 길이 (m): 0.3
본체 체적 (m³): 0.00009424777960769381
형상 길이 (m): 미정
continuousAboveLength: 0.3
aboveLengthIncludedInMember: 예
제작 승인: 아니오
사유: CONTINUOUS_BAR_EXTENSION_ONLY; FULL_FABRICATION_LENGTH_REQUIRE_MEMBER_GEOMETRY
F@1 / F-top-B / foundation-bar
배근 면: top
직경 (m): 0.016
단면적 (m²): 0.00020106192982974675
제품 호칭: 미정
productCatalogId: 미정
unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
개수: 13
본체 길이 (m): 1.9
형상 길이 (m): 1.9
제작 승인: 아니오
사유: STRAIGHT_GEOMETRY_ONLY; DEVELOPMENT_REVIEW_SEPARATE
F@1 / F-top-L / foundation-bar
배근 면: top
직경 (m): 0.016
단면적 (m²): 0.00020106192982974675
제품 호칭: 미정
productCatalogId: 미정
unitMassKgPerM: 미정
공칭 질량: 미확정 / 단중 미확정 kg/m
대상 조각 미확정개 / 중심선 길이 합 미확정 m / 제작 승인 별도
질량 미확정 사유: PRODUCT_UNIT_MASS_REQUIRED
가공 공차와 구매 손실은 포함하지 않음
pieceMassKg: 미정
totalMassKg: 미정
개수: 13

철근 전수 일람 및 수량

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

본체 길이 (m): 1.9

형상 길이 (m): 1.9

제작 승인: 아니오

사유: STRAIGHT_GEOMETRY_ONLY; DEVELOPMENT_REVIEW_SEPARATE

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

AB / U / rc-section-strength / NOT_CHECKED

id: 해시 H3

d3e9a36f15376cdf6eced82ba78740a65c3a56bd63617af98d54d99db1a231fe

부재 ID: AB

category: concrete

검정비: 미정

사유: DESIGN_STANDARD_SELECTION_REQUIRED

designTransferAllowed: 아니오

blockerKind: input-required

requiredInputFields: ["strengthStandard"]

supportedStandard: KDS-142020-2022

ruleSelection.0.detailId: R

ruleSelection.0.detailVersion: 1

ruleSelection.0.field: strengthStandard

ruleSelection.0.value: 미정

automaticSelectionAllowed: 아니오

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-section-strength@1 / b8fc7bd6bc119b267b8792aa6be65a2834a

8d2aeacaf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 14 20 20:2022 4.1.1, 4.1.2 [bad8aea615382f08f745aeb79e5

0671f831873428e5c231584b33594928b8cc3] (근거 K1)

KDS: KDS 14 20 10:2021 4.2.3 [37b8a499e44e4607bd06ff4a134d97db2a

a0b35925ea364dd6f60421eee6b994] (근거 K2)

AB / U / rc-stability / NOT_CHECKED

id: 해시 H4

9c172315e92900e7a21885ccd30555ccae26975ec97f48fb397d8ec9db8fb345

부재 ID: AB

category: concrete

검정비: 미정

사유: BRACED_COLUMN_CLASSIFICATION_AND_REFERENCE_REQUIRED

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-local-stability@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8

d2aeacaf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 14 20 20:2022 4.4.6 [bad8aea615382f08f745aeb79e50671f83

1873428e5c231584b33594928b8cc3] (근거 K3)

AB / U / rc-shear-y / NOT_CHECKED

id: 해시 H5

eb0e913f65eed7f9ae840c64d9e6cdfe4d8b7d96058098f85877345a6df62fc4

부재 ID: AB

category: concrete

검정비: 미정

사유: DESIGN_STANDARD_SELECTION_REQUIRED

designTransferAllowed: 아니오

blockerKind: input-required

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

requiredInputFields: ["shearStandard"]
supportedStandard: KDS-142022-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: shearStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-shear@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 22:2022 4 [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] (근거 K4)
KDS: KDS 14 20 10:2021 4.2.3(2) [37b8a499e44e4607bd06ff4a134d97db2aa0b35925ea364dd6f60421eee6b994] (근거 K5)
AB / U / rc-shear-z / NOT_CHECKED
id: 해시 H6
a1b48c20626879410bd6a04dee2cedc62080665dfe2fdac4877eddd015c1ce70
부재 ID: AB
category: concrete
검정비: 미정
사유: DESIGN_STANDARD_SELECTION_REQUIRED
designTransferAllowed: 아니오
blockerKind: input-required
requiredInputFields: ["shearStandard"]
supportedStandard: KDS-142022-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: shearStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-shear@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 22:2022 4 [근거 K4, 22쪽]
KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
AB / U / rc-spacing / NOT_CHECKED
id: 해시 H7
8568c9f7e6f10a9348be6e3d178d1414c20694ece7a618202981d625370516e4
부재 ID: AB
category: concrete
검정비: 미정
사유: DESIGN_STANDARD_SELECTION_REQUIRED
designTransferAllowed: 아니오
blockerKind: input-required

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

requiredInputFields: ["spacingStandard"]
supportedStandard: KDS-142050-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: spacingStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-spacing@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 50:2022 4.2.2 [400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0] (근거 K6)
KDS: KDS 14 20 01:2022 3.1.1(2) [b51425cec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780] (근거 K7)
AB / U / rc-cover / NOT_CHECKED
id: 해시 H8
f79513cca4f978b6831a1dd9bd546fe180218f99dc6ede38a023cbeb037b0693
부재 ID: AB
category: concrete
검정비: 미정
사유: DESIGN_STANDARD_SELECTION_REQUIRED
designTransferAllowed: 아니오
blockerKind: input-required
requiredInputFields: ["coverStandard"]
supportedStandard: KDS-142050-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: coverStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-cover@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 50:2022 4.3.1, 4.3.6 [400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0] (근거 K8)
AB / U / rc-reinforcement-ratio / NOT_CHECKED
id: 해시 H9
1d401bd9f7ec8a0ca5a9ca8af1fc6ead4aabc1c3e0c3dd4d739ab4c46fc42f3a
부재 ID: AB
category: concrete
검정비: 미정
사유: DESIGN_STANDARD_SELECTION_REQUIRED
designTransferAllowed: 아니오
blockerKind: input-required

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

requiredInputFields: ["detailingStandard"]
supportedStandard: KDS-142020-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: detailingStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-minimum-steel@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2
aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 20:2022 4.2, 4.3 [bad8aea615382f08f745aeb79e50671
f831873428e5c231584b33594928b8cc3] (근거 K9)
KDS: KDS 14 20 30:2021 4.2.1(3); Eq.4.2-2 [0f352bbf1f3c9fe93dc5a
3c3a12eaa21daae170ef2ad022b3faa295604f7266b] (근거 K10)
AB / U / rc-confinement / NOT_CHECKED
id: 해시 H10
b94c037189ff52be56f15eb4af7b860a9dab0c934eb36563224d05b1f80f3842
부재 ID: AB
category: concrete
검정비: 미정
사유: DESIGN_STANDARD_SELECTION_REQUIRED
designTransferAllowed: 아니오
blockerKind: input-required
requiredInputFields: ["confinementStandard"]
supportedStandard: KDS-142050-2022
ruleSelection.0.detailId: R
ruleSelection.0.detailVersion: 1
ruleSelection.0.field: confinementStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-confinement@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2ae
acaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 50:2022 4.4 [400eb92f0f6a4e518c42056bbb2fcac39eb0
3f9710d6d91312149d43e3fa01c0] (근거 K11)
AB / U / rc-anchorage / NOT_CHECKED
id: 해시 H11
338b6c70f262a16039b090dc7d51f2cb602d9a6fc84ffedb725848174d151ef2
부재 ID: AB
category: concrete
검정비: 미정
사유: ANCHORAGE_SCOPE_REQUIRED
blockerKind: input-required
requiredInputFields: ["anchorageStandard", "anchorageMode"]

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

inputTargets.0.type: reinforcement-record
inputTargets.0.id: R
inputTargets.0.version: 1
inputTargets.0.memberId: AB
automaticSelectionAllowed: 아니오
detailId: R
detailVersion: 1
bar: 0
incomplete: 예
methodReviewRequired: 예
locationCoverage: 공통 자료 D3
locationCoverage.counts: {"OK":0,"NG":0,"WARN":0,"NOT_CHECKED":4,"N_A":0,"FAILED":0}
locationCoverage.incompleteCount: 4
locationCoverage.total: 4
locationCoverage.complete: 아니오
locationCoverage.missingLocations: 공통 자료 D4
locationCoverage.missingLocations.0.status: NOT_CHECKED
locationCoverage.missingLocations.0.reason: ANCHORAGE_SCOPE_REQUIRED
locationCoverage.missingLocations.0.ratio: 미정
locationCoverage.missingLocations.0.x: 미정
locationCoverage.missingLocations.0.side: 미정
locationCoverage.missingLocations.0.comboid: 미정
locationCoverage.missingLocations.0.detailId: R
locationCoverage.missingLocations.0.detailVersion: 1
locationCoverage.missingLocations.0.bar: 0
locationCoverage.missingLocations.1.status: NOT_CHECKED
locationCoverage.missingLocations.1.reason: ANCHORAGE_SCOPE_REQUIRED
locationCoverage.missingLocations.1.ratio: 미정
locationCoverage.missingLocations.1.x: 미정
locationCoverage.missingLocations.1.side: 미정
locationCoverage.missingLocations.1.comboid: 미정
locationCoverage.missingLocations.1.detailId: R
locationCoverage.missingLocations.1.detailVersion: 1
locationCoverage.missingLocations.1.bar: 1
locationCoverage.missingLocations.2.status: NOT_CHECKED
locationCoverage.missingLocations.2.reason: ANCHORAGE_SCOPE_REQUIRED
locationCoverage.missingLocations.2.ratio: 미정
locationCoverage.missingLocations.2.x: 미정
locationCoverage.missingLocations.2.side: 미정
locationCoverage.missingLocations.2.comboid: 미정
locationCoverage.missingLocations.2.detailId: R
locationCoverage.missingLocations.2.detailVersion: 1

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

locationCoverage.missingLocations.2.bar: 2
locationCoverage.missingLocations.3.status: NOT_CHECKED
locationCoverage.missingLocations.3.reason: ANCHORAGE_SCOPE_REQUIRED
locationCoverage.missingLocations.3.ratio: 미정
locationCoverage.missingLocations.3.x: 미정
locationCoverage.missingLocations.3.side: 미정
locationCoverage.missingLocations.3.combold: 미정
locationCoverage.missingLocations.3.detailId: R
locationCoverage.missingLocations.3.detailVersion: 1
locationCoverage.missingLocations.3.bar: 3
locationCoverage.failedLocations: []
locationCoverage.witnessLimit: 12
locationCoverage.witnessesTruncated: 아니오
calculations: []
incompleteReasons: ["ANCHORAGE_SCOPE_REQUIRED"]
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-anchorage@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 52:2024 4.1, 4.5 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K12)
AB / U / rc-splices / N_A
id: 해시 H12
fe9777eccd16491d11a2fc7a269897a09000e14f8a1018d6900053bc1541225d
부재 ID: AB
category: concrete
검정비: 미정
사유: EXPLICIT_NO_LAP_DECLARATION
applicability.basis: all-member-regions-declare-no-lap; no-splice-records
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-splices@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 52:2024 4.5.1 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K13)
KDS: KDS 14 20 52:2024 4.5.2 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K14)
KDS: KDS 14 20 52:2024 4.5.3 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K15)
KDS: KDS 14 20 50:2022 4.2.2 [근거 K6, 23쪽]
KDS: KDS 14 20 01:2022 3.1.1 [b51425ceec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780] (근거 K16)
AB / U / rc-deflection / N_A
id: 해시 H13

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

afd4027fc468ce7268047a8929a25d53df327c2aa4bae1433a579a5cff0ab030

부재 ID: AB

category: concrete

검정비: 미정

사유: CHECK_REQUIRES_SERVICE_COMBINATION

applicability.expectedPurpose: service

applicability.actualPurpose: strength

applicability.basis: declared-load-combination-purpose; required

-combination-coverage-separate

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-deflection@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aea

caf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 14 20 30:2021 4.2.1 [0f352bbf1f3c9fe93dc5a3c3a12eaa21da

ae170ef2ad022b3faa295604f7266b] (근거 K17)

AB / U / rc-serviceability / N_A

id: 해시 H14

1a836d895b3885087aaf78d5bafa03534b91cd6024b70026baac363843dc5d7f

부재 ID: AB

category: concrete

검정비: 미정

사유: CHECK_REQUIRES_SERVICE_COMBINATION

applicability.expectedPurpose: service

applicability.actualPurpose: strength

applicability.basis: declared-load-combination-purpose; required

-combination-coverage-separate

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-crack-control@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2

aeacaf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 14 20 30:2021 4.1, 4.2 [0f352bbf1f3c9fe93dc5a3c3a12eaa2

1daae170ef2ad022b3faa295604f7266b] (근거 K18)

KDS: KDS 14 20 20:2022 4.2.3(4); Eq.4.2-3; Eq.4.2-4 [bad8aea6153

82f08f745aeb79e50671f831873428e5c231584b33594928b8cc3] (근거 K19)

AB / U / rc-torsion / NOT_CHECKED

id: 해시 H15

3dc58a2ed39df99b61816c3173e3a4ca2fdcb0547301d6c5a67c8995abbbf15e1

부재 ID: AB

category: concrete

검정비: 미정

사유: DESIGN_STANDARD_SELECTION_REQUIRED

designTransferAllowed: 아니오

blockerKind: input-required

requiredInputFields: ["torsionStandard"]

supportedStandard: KDS-142022-2022

ruleSelection.0.detailId: R

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

ruleSelection.0.detailVersion: 1
ruleSelection.0.field: torsionStandard
ruleSelection.0.value: 미정
automaticSelectionAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-torsion-threshold@1 / b8fc7bd6bc119b267b8792aa6be65a2834
a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 14 20 22:2022 4 [근거 K4, 22쪽]
KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
AB / U / rc-code-compliance / NOT_CHECKED
id: 해시 H16
c1322014a967acb45b1347f9f79a15dfc4d62c3466747a396c09b6d2d987c3e4
부재 ID: AB
category: concrete
검정비: 미정
사유: REQUIRED_KDS_CHECKS_INCOMPLETE
requiredCheckIds: 해시 목록 13건 (원래 순서)
requiredCheckIds[1]: 해시 H3 참조 (21쪽)
requiredCheckIds[2]: 해시 H4 참조 (21쪽)
requiredCheckIds[3]: 해시 H5 참조 (21쪽)
requiredCheckIds[4]: 해시 H6 참조 (22쪽)
requiredCheckIds[5]: 해시 H7 참조 (22쪽)
requiredCheckIds[6]: 해시 H8 참조 (23쪽)
requiredCheckIds[7]: 해시 H9 참조 (23쪽)
requiredCheckIds[8]: 해시 H10 참조 (24쪽)
requiredCheckIds[9]: 해시 H11 참조 (24쪽)
requiredCheckIds[10]: 해시 H12 참조 (26쪽)
requiredCheckIds[11]: 해시 H13 참조 (27쪽)
requiredCheckIds[12]: 해시 H14 참조 (27쪽)
requiredCheckIds[13]: 해시 H15 참조 (27쪽)
missingCheckIds: ["rc-section-strength","rc-stability","rc-shear-y","rc-shear-z","rc-spacing","rc-cover","rc-reinforcement-ratio","rc-confinement","rc-anchorage","rc-torsion"]
failedCheckIds: []
qualification: scoped-check-aggregation-not-project-qualification
codeReferences: []
wholeDesignQualified: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
KDS: NOT_ESTABLISHED / scoped-check-aggregation-not-project-qualification
KDS: KDS 41 20 00:2024 4 [e635ceb4dd9b0b664b7bb37c7a9e1ada660fee9dce7444fc094305f8f7d9a5c] [근거 K20]
foundation:A / U / foundation-bearing / N_A
id: 해시 H17

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

b3de6643b22c6cfc2db73932d3b9b3086fc57611e1a9c69f6bdfd021224297b

부재 ID: foundation:A

category: foundation

검정비: 미정

사유: CHECK_REQUIRES_SERVICE_COMBINATION

applicability.expectedPurpose: service

applicability.actualPurpose: strength

applicability.basis: declared-load-combination-purpose; required

-combination-coverage-separate

analysisRunId: E:2026-09-13T23:58:22.126Z:1

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 11 50 05:2025 4.1.2 [fbadf14f98c82adf4ccbb35353ae53ec53

78caf129b6be996d0f115ddfb16172] (근거 K21)

foundation:A / U / foundation-ground-review / N_A

id: 해시 H18

643ba043ddc0071f9406daf9c7b6247076d203a605549b9b5c9d698be7266680

부재 ID: foundation:A

category: foundation

검정비: 미정

사유: CHECK_REQUIRES_SERVICE_COMBINATION

applicability.expectedPurpose: service

applicability.actualPurpose: strength

applicability.basis: declared-load-combination-purpose; required

-combination-coverage-separate

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-ground-evidence@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8

d2aeacaf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 14 20 70:2021 4.2 [eacf28e9e32d5e313c6aac73471e79934c42

cfd63c8a4e00627047efc681fd2b] (근거 K22)

KDS: KDS 11 50 05:2025 1.9, 4.2 [fbadf14f98c82adf4ccbb35353ae53e

c5378caf129b6be996d0f115ddfb16172] (근거 K23)

foundation:A / U / foundation-sliding / NOT_CHECKED

id: 해시 H19

42b360e57f9ef2a706902ac39390d91b82acc59d75f1a1f53cbbf0b049c57942

부재 ID: foundation:A

category: foundation

검정비: 미정

사유: FRICTION_AND_WEIGHT_ACCOUNTING_REQUIRED

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-ground-sliding@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d

2aeacaf3b07daec2f2c11522069

KDS: NOT_ESTABLISHED / missing-or-unqualified-input

KDS: KDS 11 50 05:2025 1.9(5), 4.1.7(1) [fbadf14f98c82adf4ccbb35

353ae53ec5378caf129b6be996d0f115ddfb16172] (근거 K24)

foundation:A / U / foundation-overturning / OK

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

id: 해시 H20

d7a6207434e7f0116b083913f813b7e6c7d18fbb25beb3de193b48428e8ef0ee

부재 ID: foundation:A

category: foundation

검정비: 0

사유: COMPRESSION_RESULTANT_POSITION_ONLY; CODE_STABILITY_FACTORS_PENDING

수요 (단위 항목 참조): 0

내력/허용값 (단위 항목 참조): 1

qualification: provided-input-mechanics

reaction: 공통 자료 D5

reaction.rx: 0

reaction.ry: 0

reaction.rz: 14

reaction.rmx: 0

reaction.rmy: 0

reaction.rmz: 0

reaction.id: A

reaction.nodell: A

reaction.values: [0,0,14,0,0,0]

reaction.force: {"x":0,"y":0,"z":14}

reaction.moment: {"x":0,"y":0,"z":0}

reaction.RMx: 0

reaction.RMy: 0

reaction.RMz: 0

loadLedger: 공통 자료 D6

loadLedger.ok: 예

loadLedger.totalN: 79.90068799999999

loadLedger.columnN: 14

loadLedger.totalMx: 0

loadLedger.totalMy: 0

loadLedger.totalMz: 0

loadLedger.columnBaseMx: 0

loadLedger.columnBaseMy: 0

loadLedger.columnMx: 0

loadLedger.columnMy: 0

loadLedger.columnMz: 0

loadLedger.columnInterfaceHeightAboveBase: 0.5

loadLedger.reactionHeightAboveBase: 0

loadLedger.reactionVerticalReference: height-irrelevant-zero-horizontal-force

loadLedger.heightMoment: {"Mx":0,"My":0}

loadLedger.columnOffsetX: 0

loadLedger.columnOffsetY: 0

loadLedger.reactionMomentReference: column-center

loadLedger.distributedN: 65.90068799999999

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

loadLedger.uniformDownwardPressure: 16.475171999999997
loadLedger.components.0.kind: self-weight
loadLedger.components.0.caseld: D
loadLedger.components.0.unfactoredPressure: 11.76798
loadLedger.components.0.factor: 1.4
loadLedger.components.0.sign: 1
loadLedger.components.0.factoredPressure: 16.475171999999997
loadLedger.gravity: 9.80665
loadLedger.units.force: kN
loadLedger.units.moment: kN.m
loadLedger.units.length: m
loadLedger.units.pressure: kPa
loadLedger.units.density: t/m3
loadLedger.reactionBasis: superstructure-only
loadLedger.distribution: uniform-centered-over-entire-footing
loadLedger.codeReferences: 공통 자료 D7
loadLedger.codeReferences.0: KDS 14 20 70:2021 4.2.1(1),(2); 4.2
.2.1(1) [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047e
fc681fd2b] (근거 K25)
contact: 공통 자료 D8
contact.ok: 예
contact.contact: full
contact.ex: 0
contact.ey: 0
contact.q0: 19.975171999999997
contact.qmax: 19.975171999999997
contact.qmin: 19.975171999999997
contact.area: 4
contact.polygon.0: [-1,-1]
contact.polygon.1: [1,-1]
contact.polygon.2: [1,1]
contact.polygon.3: [-1,1]
contact.pressurePlane: [19.975171999999997,0,0]
detailId: F
detailVersion: 1
analysisRunId: E:2026-09-13T23:58:22.126Z:1
KDS: NOT_ESTABLISHED / provided-input-mechanics
KDS: KDS 11 50 05:2025 1.9(4) [fbadf14f98c82adf4ccbb35353ae53ec5
378caf129b6be996d0f115ddfb16172] (근거 K26)
foundation:A / U / foundation-flexure / OK
id: 해시 H21
aa52d5edde48934755679d062dcde66b0a7ab463e92633ec6acfe5fffb3304578
부재 ID: foundation:A
category: foundation
검정비: 0.010310910367894052
사유: 미정

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

codeReferences: 공통 자료 D9

codeReferences.0: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]

codeReferences.1: KDS 14 20 20:2022 4.1.1(3),(8) Table 4.1-2; 4.

1.2(3)-(7) Eq.4.1-17 [bad8aea615382f08f745aeb79e50671f831873428e

5c231584b33594928b8cc3] (근거 K27)

qualification: clause-scoped-not-whole-design

designTransferAllowed: 아니오

inputSignConvention: rc-section

sectionDemand: {"N":0,"My":0,"Mz":-2.5287500000000023}

equilibriumConvention: rc-section

frameConventionVersion: p25-rc-frame-section-sign-v1

내력/허용값 (단위 항목 참조): 245.24992554236374

phi: 0.85

tensionStrain: 0.030420319157391337

minStrain: 0.004

law: {"alpha":0.85,"beta":0.8,"epsu":0.0033}

nominal: {"N":1.0029778252373944e-7,"My":-2.8005630525740344e-7,

"Mz":-288.5293241674868}

equilibrium: {"N":8.525311514517852e-8,"My":-2.380478594687929e-

7,"Mz":-245.24992554236374}

scope: nonprestressed-rectangular-tied-section-strength-only

수요 (단위 항목 참조): 2.5287500000000023

signedMoment: 2.5287500000000023

axis: L

side: -1

cutCoordinate: -0.15

배근 면: bottom

유효 깊이 (m): 0.426

철근 개수: 13

철근 면적 (m²): 0.0026138050877867083

axisChecks: 공통 자료 D10

axisChecks.0: 공통 자료 D11

axisChecks.0.codeReferences: 공통 자료 D9 참조 (32쪽)

axisChecks.0.qualification: clause-scoped-not-whole-design

axisChecks.0.designTransferAllowed: 아니오

axisChecks.0.inputSignConvention: rc-section

axisChecks.0.sectionDemand: {"N":0,"My":0,"Mz":-1.7149999999999999}

99}

axisChecks.0.equilibriumConvention: rc-section

axisChecks.0.frameConventionVersion: p25-rc-frame-section-sign-v

1

axisChecks.0.status: OK

axisChecks.0.capacity: 245.24992554236374

axisChecks.0.ratio: 0.006992866547083847

axisChecks.0.reason: 미정

axisChecks.0.phi: 0.85

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

```
axisChecks.0.tensionStrain: 0.03166619459825387
axisChecks.0.minStrain: 0.004
axisChecks.0.law: {"alpha":0.85,"beta":0.8,"epscu":0.0033}
axisChecks.0.nominal: {"N":1.0029778252373944e-7,"My":-2.8005630
525740344e-7,"Mz":-288.5293241674868}
axisChecks.0.equilibrium: {"N":8.525311514517852e-8,"My":-2.3804
78594687929e-7,"Mz":-245.24992554236374}
axisChecks.0.scope: nonprestressed-rectangular-tied-section-stre
ngth-only
axisChecks.0.demand: 1.7149999999999999
axisChecks.0.signedMoment: 1.7149999999999999
axisChecks.0.axis: B
axisChecks.0.side: -1
axisChecks.0.cutCoordinate: -0.3
axisChecks.0.face: bottom
axisChecks.0.effectiveDepth: 0.442
axisChecks.0.barCount: 13
axisChecks.0.steelArea: 0.0026138050877867083
axisChecks.1: 공통 자료 D12
axisChecks.1.codeReferences: 공통 자료 D9 참조 (32쪽)
axisChecks.1.qualification: clause-scoped-not-whole-design
axisChecks.1.designTransferAllowed: 아니오
axisChecks.1.inputSignConvention: rc-section
axisChecks.1.sectionDemand: {"N":0,"My":0,"Mz":-1.714999999999999
8}
axisChecks.1.equilibriumConvention: rc-section
axisChecks.1.frameConventionVersion: p25-rc-frame-section-sign-v
1
axisChecks.1.status: OK
axisChecks.1.capacity: 245.24992554236374
axisChecks.1.ratio: 0.00699286654708384
axisChecks.1.reason: 미정
axisChecks.1.phi: 0.85
axisChecks.1.tensionStrain: 0.03166619459825387
axisChecks.1.minStrain: 0.004
axisChecks.1.law: {"alpha":0.85,"beta":0.8,"epscu":0.0033}
axisChecks.1.nominal: {"N":1.0029778252373944e-7,"My":-2.8005630
525740344e-7,"Mz":-288.5293241674868}
axisChecks.1.equilibrium: {"N":8.525311514517852e-8,"My":-2.3804
78594687929e-7,"Mz":-245.24992554236374}
axisChecks.1.scope: nonprestressed-rectangular-tied-section-stre
ngth-only
axisChecks.1.demand: 1.7149999999999998
axisChecks.1.signedMoment: 1.7149999999999998
axisChecks.1.axis: B
axisChecks.1.side: 1
```

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

axisChecks.1.cutCoordinate: 0.3
axisChecks.1.face: bottom
axisChecks.1.effectiveDepth: 0.442
axisChecks.1.barCount: 13
axisChecks.1.steelArea: 0.0026138050877867083
axisChecks.2: 공통 자료 D13
axisChecks.2.codeReferences: 공통 자료 D9 참조 (32쪽)
axisChecks.2.qualification: clause-scoped-not-whole-design
axisChecks.2.designTransferAllowed: 아니오
axisChecks.2.inputSignConvention: rc-section
axisChecks.2.sectionDemand: {"N":0,"My":0,"Mz":-2.5287500000000023}
axisChecks.2.equilibriumConvention: rc-section
axisChecks.2.frameConventionVersion: p25-rc-frame-section-sign-v1
axisChecks.2.status: OK
axisChecks.2.capacity: 245.24992554236374
axisChecks.2.ratio: 0.010310910367894052
axisChecks.2.reason: 미정
axisChecks.2.phi: 0.85
axisChecks.2.tensionStrain: 0.030420319157391337
axisChecks.2.minStrain: 0.004
axisChecks.2.law: {"alpha":0.85,"beta":0.8,"epscu":0.0033}
axisChecks.2.nominal: {"N":1.0029778252373944e-7,"My":-2.8005630525740344e-7,"Mz":-288.5293241674868}
axisChecks.2.equilibrium: {"N":8.525311514517852e-8,"My":-2.380478594687929e-7,"Mz":-245.24992554236374}
axisChecks.2.scope: nonprestressed-rectangular-tied-section-strength-only
axisChecks.2.demand: 2.5287500000000023
axisChecks.2.signedMoment: 2.5287500000000023
axisChecks.2.axis: L
axisChecks.2.side: -1
axisChecks.2.cutCoordinate: -0.15
axisChecks.2.face: bottom
axisChecks.2.effectiveDepth: 0.426
axisChecks.2.barCount: 13
axisChecks.2.steelArea: 0.0026138050877867083
axisChecks.3: 공통 자료 D14
axisChecks.3.codeReferences: 공통 자료 D9 참조 (32쪽)
axisChecks.3.qualification: clause-scoped-not-whole-design
axisChecks.3.designTransferAllowed: 아니오
axisChecks.3.inputSignConvention: rc-section
axisChecks.3.sectionDemand: {"N":0,"My":0,"Mz":-2.5287499999999987}
axisChecks.3.equilibriumConvention: rc-section

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

axisChecks.3.frameConventionVersion: p25-rc-frame-section-sign-v
1
axisChecks.3.status: OK
axisChecks.3.capacity: 245.24992554236374
axisChecks.3.ratio: 0.010310910367894036
axisChecks.3.reason: 미정
axisChecks.3.phi: 0.85
axisChecks.3.tensionStrain: 0.030420319157391337
axisChecks.3.minStrain: 0.004
axisChecks.3.law: {"alpha":0.85,"beta":0.8,"epscu":0.0033}
axisChecks.3.nominal: {"N":1.0029778252373944e-7,"My":-2.8005630
525740344e-7,"Mz":-288.5293241674868}
axisChecks.3.equilibrium: {"N":8.525311514517852e-8,"My":-2.3804
78594687929e-7,"Mz":-245.24992554236374}
axisChecks.3.scope: nonprestressed-rectangular-tied-section-stre
ngth-only
axisChecks.3.demand: 2.52874999999999987
axisChecks.3.signedMoment: 2.52874999999999987
axisChecks.3.axis: L
axisChecks.3.side: 1
axisChecks.3.cutCoordinate: 0.15
axisChecks.3.face: bottom
axisChecks.3.effectiveDepth: 0.426
axisChecks.3.barCount: 13
axisChecks.3.steelArea: 0.0026138050877867083
loadLedger: 공통 자료 D6 참조 (30쪽)
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-footing-sections@1 / b8fc7bd6bc119b267b8792aa6be65a2834a
8d2aeacaf3b07daec2f2c11522069
KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design
KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
KDS: KDS 14 20 20:2022 4.1.1(3),(8) Table 4.1-2; 4.1.2(3)-(7) Eq
.4.1-17 [근거 K27, 32쪽]
foundation:A / U / foundation-one-way-shear / OK
id: 해시 H22
d583ffe045f60b44ab02099d1ae2e12df868f6de1c488b2eae56fff93105aff4
부재 ID: foundation:A
category: foundation
검정비: 0.005688642845524617
사유: 미정
수요 (단위 항목 참조): 2.96799999999999946
내력/허용값 (단위 항목 참조): 521.7413152128169
Vc: 695.6550869504225
phi: 0.75
axis: L
side: -1

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

cutCoordinate: -0.576

배근 면: bottom

유효 깊이 (m): 0.426

codeReferences: 공통 자료 D15

codeReferences.0: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]

codeReferences.1: KDS 14 20 22:2022 4.2.1(1); 4.3.3(1); 4.11.1 [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] (근거 K28)

codeReferences.2: KDS 14 20 70:2021 4.2.1(5); 4.2.2.2(1),(2) [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b] (근거 K29)

qualification: clause-scoped-not-whole-design

minimumShearReinforcementException: KDS 14 20 22 4.3.3(1) footing

gs

axisChecks: 공통 자료 D16

axisChecks.0: 공통 자료 D17

axisChecks.0.status: OK

axisChecks.0.ratio: 0.003336182862342698

axisChecks.0.demand: 1.8059999999999992

axisChecks.0.capacity: 541.3372331550823

axisChecks.0.Vc: 721.7829775401098

axisChecks.0.phi: 0.75

axisChecks.0.axis: B

axisChecks.0.side: -1

axisChecks.0.cutCoordinate: -0.742

axisChecks.0.face: bottom

axisChecks.0.effectiveDepth: 0.442

axisChecks.0.codeReferences: 공통 자료 D15 참조 (36쪽)

axisChecks.0.qualification: clause-scoped-not-whole-design

axisChecks.0.minimumShearReinforcementException: KDS 14 20 22 4.3.3(1) footings

axisChecks.1: 공통 자료 D18

axisChecks.1.status: OK

axisChecks.1.ratio: 0.003336182862342698

axisChecks.1.demand: 1.8059999999999992

axisChecks.1.capacity: 541.3372331550823

axisChecks.1.Vc: 721.7829775401098

axisChecks.1.phi: 0.75

axisChecks.1.axis: B

axisChecks.1.side: 1

axisChecks.1.cutCoordinate: 0.742

axisChecks.1.face: bottom

axisChecks.1.effectiveDepth: 0.442

axisChecks.1.codeReferences: 공통 자료 D15 참조 (36쪽)

axisChecks.1.qualification: clause-scoped-not-whole-design

axisChecks.1.minimumShearReinforcementException: KDS 14 20 22 4.

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

3.3(1) footings

axisChecks.2: 공통 자료 D19

axisChecks.2.status: OK

axisChecks.2.ratio: 0.005688642845524617

axisChecks.2.demand: 2.9679999999999946

axisChecks.2.capacity: 521.7413152128169

axisChecks.2.Vc: 695.6550869504225

axisChecks.2.phi: 0.75

axisChecks.2.axis: L

axisChecks.2.side: -1

axisChecks.2.cutCoordinate: -0.576

axisChecks.2.face: bottom

axisChecks.2.effectiveDepth: 0.426

axisChecks.2.codeReferences: 공통 자료 D15 참조 (36쪽)

axisChecks.2.qualification: clause-scoped-not-whole-design

axisChecks.2.minimumShearReinforcementException: KDS 14 20 22 4.

3.3(1) footings

axisChecks.3: 공통 자료 D20

axisChecks.3.status: OK

axisChecks.3.ratio: 0.005688642845524617

axisChecks.3.demand: 2.9679999999999946

axisChecks.3.capacity: 521.7413152128169

axisChecks.3.Vc: 695.6550869504225

axisChecks.3.phi: 0.75

axisChecks.3.axis: L

axisChecks.3.side: 1

axisChecks.3.cutCoordinate: 0.576

axisChecks.3.face: bottom

axisChecks.3.effectiveDepth: 0.426

axisChecks.3.codeReferences: 공통 자료 D15 참조 (36쪽)

axisChecks.3.qualification: clause-scoped-not-whole-design

axisChecks.3.minimumShearReinforcementException: KDS 14 20 22 4.

3.3(1) footings

loadLedger: 공통 자료 D6 참조 (30쪽)

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-footing-sections@1 / b8fc7bd6bc119b267b8792aa6be65a2834a

8d2aeacaf3b07daec2f2c11522069

KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design

KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]

KDS: KDS 14 20 22:2022 4.2.1(1); 4.3.3(1); 4.11.1 [근거 K28, 36쪽]

KDS: KDS 14 20 70:2021 4.2.1(5); 4.2.2.2(1),(2) [근거 K29, 36쪽]

foundation:A / U / foundation-punching / NG

id: 해시 H23

f207322968cece397dc7ec3b49589b40e4c4fe45600eb68bc547438410fd7971

부재 ID: foundation:A

category: foundation

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

검정비: 1.8475750577367207

사유: PUNCHING_REINFORCEMENT_EXTENSION_INSUFFICIENT

codeReferences: 공통 자료 D21

codeReferences.0: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]

codeReferences.1: KDS 14 20 22:2022 4.11.1; 4.11.2(2), Eq.4.11-1

..8 [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] (근거 K30)

codeReferences.2: KDS 14 20 22:2022 4.11.7(1)-(5); Eq.4.11-14; E

q.4.11-16; Eq.4.11-17; Eq.4.11-18 [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] (근거 K31)

codeReferences.3: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K32)

codeReferences.4: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]

qualification: conservative-perimeter-method-independent-review-pending

designTransferAllowed: 아니오

내력/허용값 (단위 항목 참조): 1040.2324271429356

nominalCapacity: 1386.9765695239143

phi: 0.75

unit: kPa

factors: {"ks":0.9118174122106574,"kbo":1.25,"fte":0.9797958971132712,"fcc":16,"cotPsi":4.1629234461559,"cu":129.481260517686,"aIphaS":1,"effectiveRho":0.005}

requirements: ["reinforcement-extension-h-plus-development-length","combined-moment-transfer-4.11.7"]

input.fck: 24

input.d: 434

input.b0: 3535.9999999999995

input.rho: 0.0031079413187695727

input.lambda: 1

input.columnPosition: interior

shearRatio: 0.00710592464344272

extensionRatio: 1.8475750577367207

ratioBasis: maximum-shear-and-required-extension

governingCriterion: reinforcement-extension

수요 (단위 항목 참조): 7.39181323894322

demandBasis: combined-perimeter-stress

verticalDemand: 11.343653999999999

verticalShearCapacity: 1596.3656482718006

nominalVerticalShearCapacity: 2128.4875310290677

methodReviewRequired: 예

extensions: 공통 자료 D22

extensions.0: 공통 자료 D23

extensions.0.axis: B

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

extensions.0.available: 0.433
extensions.0.sideChecks.0: {"side":-1,"available":0.433}
extensions.0.sideChecks.1: {"side":1,"available":0.433}
extensions.0.required: 0.8
extensions.0.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
extensions.0.ratio: 1.8475750577367207
extensions.0.status: NG
extensions.1: 공통 자료 D24
extensions.1.axis: L
extensions.1.available: 0.583
extensions.1.sideChecks.0: {"side":-1,"available":0.583}
extensions.1.sideChecks.1: {"side":1,"available":0.583}
extensions.1.required: 0.8
extensions.1.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
extensions.1.ratio: 1.37221269296741
extensions.1.status: NG
transfer: 공통 자료 D25
transfer.status: OK
transfer.ratio: 0.00710592464344272
transfer.demandStress: 7.39181323894322
transfer.capacity: 1040.2324271429356
transfer.directStress: 7.391813238943219
transfer.momentStress: 1.1453632375820482e-15
transfer.interaction: 1.1089448092602944e-18
transfer.area: 1.534624
transfer.lx: 0.14948898649066666
transfer.ly: 0.25025805769066667
transfer.momentCapacityX: 420.70380539211385
transfer.momentCapacityY: 499.95490510570386
transfer.V: 11.343653999999999
transfer.Mx: 0
transfer.My: 5.544223968811934e-16
transfer.flexuralTransferCredit: 0
transfer.scope: conservative-uniform-stress-bound-on-interior-perimeter; shear-only linear distribution and biaxial interaction
transfer.units.stress: kPa
transfer.units.area: m2
transfer.units.inertia: m4
transfer.units.moment: kN.m
transfer.actions: 공통 자료 D26
transfer.actions.V: 11.343653999999999
transfer.actions.Mx: 0
transfer.actions.My: 5.544223968811934e-16
transfer.actions.soilForce: 15.160276640431997

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

transfer.actions.soilFirstX: 5.544223968811934e-16
transfer.actions.soilFirstY: 0
transfer.actions.columnOffsetX: 0
transfer.actions.columnOffsetY: 0
transfer.actions.momentReference: column-plan-center-at-footing-base
transfer.actions.distributedDownwardForce: 12.503930640431998
transfer.actions.units.force: kN
transfer.actions.units.moment: kN.m
transfer.nominalStress: 1.3869765695239145
transfer.method: conservative-perimeter-shear
transfer.independentMethodReview: pending
soilReactionReductionApplied: 예
scope: interior-column-solid-footing-without-openings; no flexural transfer credit
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-footing-punching@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / conservative-perimeter-method-independent-review-pending
KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
KDS: KDS 14 20 22:2022 4.11.1; 4.11.2(2), Eq.4.11-1..8 [근거 K30, 38쪽]
KDS: KDS 14 20 22:2022 4.11.7(1)-(5); Eq.4.11-14; Eq.4.11-16; Eq.4.11-17; Eq.4.11-18 [근거 K31, 38쪽]
KDS: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
KDS: KDS 14 20 22:2022 4.11 [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] [근거 K33]
foundation:A / U / foundation-reinforcement / OK
id: 해시 H24
cf7856a8ca2bc9db2e9193f7c5ff4db891bf14380d0bcac31d3366515b79c558
부재 ID: foundation:A
category: foundation
검정비: 0.7651679956341121
사유: 미정
codeReferences: 공통 자료 D27
codeReferences.0: KDS 14 20 20:2022 4.2.2(3) [bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3] (근거 K34)
codeReferences.1: KDS 14 20 50:2022 4.6.2(1),(2) [400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0] (근거 K35)
qualification: clause-scoped-not-whole-design
designTransferAllowed: 아니오
단면적 (m²): 0.0026138050877867083
requiredArea: 0.002
minimumRatio: 0.002
간격 (m): 0.150000000000000013

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

maximumSpacing: 0.45
criteria: 공통 자료 D28
criteria.0: 공통 자료 D29
criteria.0.id: minimum-area
criteria.0.provided: 0.0026138050877867083
criteria.0.limit: 0.002
criteria.0.relation: >=
criteria.0.unit: m2
criteria.0.ratio: 0.7651679956341121
criteria.0.reason: FOOTING_MINIMUM_STEEL_AREA_INSUFFICIENT
criteria.0.codeReferences: 공통 자료 D27 참조 (40쪽)
criteria.0.status: OK
criteria.1: 공통 자료 D30
criteria.1.id: maximum-spacing
criteria.1.provided: 0.150000000000000013
criteria.1.limit: 0.45
criteria.1.relation: <=
criteria.1.unit: m
criteria.1.ratio: 0.33333333333333365
criteria.1.reason: FOOTING_MAXIMUM_REINFORCEMENT_SPACING_EXCEED
D
criteria.1.codeReferences: 공통 자료 D31
criteria.1.codeReferences.0: KDS 14 20 20:2022 4.2.2(3) [근거 K34,
40쪽]
criteria.1.status: OK
failedCriteria: []
governingCriterion: minimum-area
areaBasis: 공통 자료 D32
areaBasis.width: 2
areaBasis.thickness: 0.5
areaBasis.uncappedRequiredArea: 0.002
areaBasis.maximumRequiredArea: 0.0036
areaBasis.capPerUnitWidth: 0.0018
areaBasis.capApplied: 아니오
areaBasis.units.width: m
areaBasis.units.thickness: m
areaBasis.units.uncappedRequiredArea: m2
areaBasis.units.maximumRequiredArea: m2
areaBasis.units.capPerUnitWidth: m2/m
units.area: m2
units.spacing: m
scope: uniform-thickness-footing-minimum-area-and-spacing; sever
e-restraint reinforcement and development separate
axis: B
배근 면: bottom
axisChecks: 공통 자료 D33

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

axisChecks.0: 공통 자료 D34

axisChecks.0.codeReferences: 공통 자료 D27 참조 (40쪽)

axisChecks.0.qualification: clause-scoped-not-whole-design

axisChecks.0.designTransferAllowed: 아니오

axisChecks.0.status: OK

axisChecks.0.reason: 미정

axisChecks.0.ratio: 0.7651679956341121

axisChecks.0.area: 0.0026138050877867083

axisChecks.0.requiredArea: 0.002

axisChecks.0.minimumRatio: 0.002

axisChecks.0.spacing: 0.150000000000000013

axisChecks.0.maximumSpacing: 0.45

axisChecks.0.criteria: 공통 자료 D28 참조 (41쪽)

axisChecks.0.failedCriteria: []

axisChecks.0.governingCriterion: minimum-area

axisChecks.0.areaBasis: 공통 자료 D32 참조 (41쪽)

axisChecks.0.units.area: m2

axisChecks.0.units.spacing: m

axisChecks.0.scope: uniform-thickness-footing-minimum-area-and-s

pacing; severe-restraint reinforcement and development separate

axisChecks.0.axis: B

axisChecks.0.face: bottom

axisChecks.1: 공통 자료 D35

axisChecks.1.codeReferences: 공통 자료 D27 참조 (40쪽)

axisChecks.1.qualification: clause-scoped-not-whole-design

axisChecks.1.designTransferAllowed: 아니오

axisChecks.1.status: OK

axisChecks.1.reason: 미정

axisChecks.1.ratio: 0.7651679956341121

axisChecks.1.area: 0.0026138050877867083

axisChecks.1.requiredArea: 0.002

axisChecks.1.minimumRatio: 0.002

axisChecks.1.spacing: 0.150000000000000013

axisChecks.1.maximumSpacing: 0.45

axisChecks.1.criteria: 공통 자료 D28 참조 (41쪽)

axisChecks.1.failedCriteria: []

axisChecks.1.governingCriterion: minimum-area

axisChecks.1.areaBasis: 공통 자료 D32 참조 (41쪽)

axisChecks.1.units.area: m2

axisChecks.1.units.spacing: m

axisChecks.1.scope: uniform-thickness-footing-minimum-area-and-s

pacing; severe-restraint reinforcement and development separate

axisChecks.1.axis: L

axisChecks.1.face: bottom

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-footing-sections@1 / b8fc7bd6bc119b267b8792aa6be65a2834a

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

8d2aeacaf3b07daec2f2c11522069

KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design

KDS: KDS 14 20 20:2022 4.2.2(3) [근거 K34, 40쪽]

KDS: KDS 14 20 50:2022 4.6.2(1),(2) [근거 K35, 40쪽]

foundation:A / U / foundation-spacing / NOT_CHECKED

id: 해시 H25

c55631599f42244be7bffe9c83f9b8c0912a921bb6d95ee106b634bc3f2b8500

부재 ID: foundation:A

category: foundation

검정비: 미정

사유: FOOTING_SPACING_INPUT_REQUIRED

incomplete: 예

requiredInputFields: ["aggregateMaxSize"]

blockerKind: input-required

axisChecks: 공통 자료 D36

axisChecks.0: 공통 자료 D37

axisChecks.0.axis: B

axisChecks.0.face: bottom

axisChecks.0.status: NOT_CHECKED

axisChecks.0.ratio: 미정

axisChecks.0.clearSpacing: 0.13399999999999999

axisChecks.0.requiredClearSpacing: 0.025

axisChecks.0.aggregateVerified: 아니오

axisChecks.0.reason: FOOTING_AGGREGATE_SIZE_REQUIRED

axisChecks.1: 공통 자료 D38

axisChecks.1.axis: L

axisChecks.1.face: bottom

axisChecks.1.status: NOT_CHECKED

axisChecks.1.ratio: 미정

axisChecks.1.clearSpacing: 0.13399999999999999

axisChecks.1.requiredClearSpacing: 0.025

axisChecks.1.aggregateVerified: 아니오

axisChecks.1.reason: FOOTING_AGGREGATE_SIZE_REQUIRED

axisChecks.2: 공통 자료 D39

axisChecks.2.axis: B

axisChecks.2.face: top

axisChecks.2.status: NOT_CHECKED

axisChecks.2.ratio: 미정

axisChecks.2.clearSpacing: 0.13399999999999999

axisChecks.2.requiredClearSpacing: 0.025

axisChecks.2.aggregateVerified: 아니오

axisChecks.2.reason: FOOTING_AGGREGATE_SIZE_REQUIRED

axisChecks.3: 공통 자료 D40

axisChecks.3.axis: L

axisChecks.3.face: top

axisChecks.3.status: NOT_CHECKED

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

axisChecks.3.ratio: 미정
axisChecks.3.clearSpacing: 0.13399999999999999
axisChecks.3.requiredClearSpacing: 0.025
axisChecks.3.aggregateVerified: 아니오
axisChecks.3.reason: FOOTING_AGGREGATE_SIZE_REQUIRED
codeReferences: 공통 자료 D41
codeReferences.0: KDS 14 20 50:2022 4.2.2(1),(2) [400eb92f0f6a4e518c42056bbb2fcac39eb03f9710d6d91312149d43e3fa01c0] (근거 K36)
codeReferences.1: KDS 14 20 01:2022 3.1.1(2)④ [b51425cec82aef79227f184a5eb567a41c9511348020c42c3a0ec941ea947780] (근거 K37)
aggregateBasis.document: KDS 14 20 01
aggregateBasis.clause: 3.1.1(2)④
aggregateBasis.editionStatus: PUBLIC_CAPTURE_EDITION_REVIEW_REQUIRED
qualification: clause-scoped-not-whole-design
designTransferAllowed: 아니오
units.length: m
scope: within each parallel single-bar footing layer; crossing layers, bundles, laps and placement tolerances separate
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-footing-spacing@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / clause-scoped-not-whole-design
KDS: KDS 14 20 50:2022 4.2.2(1),(2) [근거 K36, 44쪽]
KDS: KDS 14 20 01:2022 3.1.1(2)④ [근거 K37, 44쪽]
KDS: KDS 14 20 50:2022 4.2.2 [근거 K6, 23쪽]
foundation:A / U / foundation-depth / OK
id: 해시 H26
e3d02d00b19797914237a88ae13aa680f996e0ea7691e499d50b1e6f9e58a668
부재 ID: foundation:A
category: foundation
검정비: 0.352112676056338
사유: 미정
codeReferences: 공통 자료 D42
codeReferences.0: KDS 14 20 70:2021 4.2.1(5) [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b] (근거 K38)
qualification: clause-scoped-not-whole-design
designTransferAllowed: 아니오
scope: isolated footing; bottom B below bottom L, existing layer convention
axis: L
배근 면: bottom
limit: 0.15
unit: m
relation: >=
provided: 0.426

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

incomplete: 아니오

axisChecks: 공통 자료 D43

axisChecks.0: 공통 자료 D44

axisChecks.0.axis: B

axisChecks.0.face: bottom

axisChecks.0.limit: 0.15

axisChecks.0.unit: m

axisChecks.0.relation: >=

axisChecks.0.codeReferences: 공통 자료 D42 참조 (44쪽)

axisChecks.0.provided: 0.442

axisChecks.0.ratio: 0.33936651583710403

axisChecks.0.status: OK

axisChecks.0.reason: 미정

axisChecks.1: 공통 자료 D45

axisChecks.1.axis: L

axisChecks.1.face: bottom

axisChecks.1.limit: 0.15

axisChecks.1.unit: m

axisChecks.1.relation: >=

axisChecks.1.codeReferences: 공통 자료 D42 참조 (44쪽)

axisChecks.1.provided: 0.426

axisChecks.1.ratio: 0.352112676056338

axisChecks.1.status: OK

axisChecks.1.reason: 미정

thickness: 0.5

analysisRunId: E:2026-09-13T23:58:22.126Z:1

규칙: p25-footing-depth@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2

aeacaf3b07daec2f2c11522069

KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design

KDS: KDS 14 20 70:2021 4.2.1(5) [근거 K38, 44쪽]

foundation:A / U / foundation-distribution / OK

id: 해시 H27

4eace1d12eeca5a3f6596b86ae84d3d05a0dd91d7de098104eb08999388ce4d0

부재 ID: foundation:A

category: foundation

검정비: 0

사유: UNIFORM_FULL_WIDTH

axis: B

배근 면: bottom

checks: 공통 자료 D46

checks.0.axis: B

checks.0.face: bottom

checks.0.status: OK

checks.0.ratio: 0

checks.0.reason: UNIFORM_FULL_WIDTH

checks.1.axis: L

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

checks.1.face: bottom
checks.1.status: OK
checks.1.ratio: 0
checks.1.reason: UNIFORM_FULL_WIDTH
checks.2.axis: B
checks.2.face: top
checks.2.status: OK
checks.2.ratio: 0
checks.2.reason: UNIFORM_FULL_WIDTH
checks.3.axis: L
checks.3.face: top
checks.3.status: OK
checks.3.ratio: 0
checks.3.reason: UNIFORM_FULL_WIDTH
codeReferences: 공통 자료 D47
codeReferences.0: KDS 14 20 70:2021 4.2.2.1(3),(4); Eq.4.2-1 [ea
cf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b]
(근거 K39)
qualification: clause-scoped-not-whole-design
scope: column-centered-band-or-uniform-footing-bars
designTransferAllowed: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-footing-sections@1 / b8fc7bd6bc119b267b8792aa6be65a2834a
8d2aeacaf3b07daec2f2c11522069
KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design
KDS: KDS 14 20 70:2021 4.2.2.1(3),(4); Eq.4.2-1 [근거 K39, 46쪽]
foundation:A / U / foundation-anchorage / OK
id: 해시 H28
dbf16043158925fbf807d067f95336599fa20ceeee9fc808f6ec3264b54b6753
부재 ID: foundation:A
category: foundation
검정비: 0.4615384615384616
사유: 미정
axis: B
배근 면: bottom
available: 0.6499999999999999
required: 0.3
sideChecks.0: {"side":-1,"available":0.6499999999999999,"required":0.3}
sideChecks.1: {"side":1,"available":0.6499999999999999,"required":0.3}
source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38
쪽]
criticalSection: column-face
topCastFactor: 1
checks: 공통 자료 D48

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

checks.0: 공통 자료 D49
checks.0.axis: B
checks.0.face: bottom
checks.0.available: 0.6499999999999999
checks.0.required: 0.3
checks.0.ratio: 0.4615384615384616
checks.0.status: OK
checks.0.sideChecks.0: {"side":-1,"available":0.6499999999999999,"required":0.3}
checks.0.sideChecks.1: {"side":1,"available":0.6499999999999999,"required":0.3}
checks.0.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
checks.0.criticalSection: column-face
checks.0.topCastFactor: 1
checks.1: 공통 자료 D50
checks.1.axis: L
checks.1.face: bottom
checks.1.available: 0.7999999999999999
checks.1.required: 0.3
checks.1.ratio: 0.37500000000000006
checks.1.status: OK
checks.1.sideChecks.0: {"side":-1,"available":0.7999999999999999,"required":0.3}
checks.1.sideChecks.1: {"side":1,"available":0.7999999999999999,"required":0.3}
checks.1.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
checks.1.criticalSection: column-face
checks.1.topCastFactor: 1
checks.2: 공통 자료 D51
checks.2.axis: B
checks.2.face: top
checks.2.available: 0.6499999999999999
checks.2.required: 0.3
checks.2.ratio: 0.4615384615384616
checks.2.status: OK
checks.2.sideChecks.0: {"side":-1,"available":0.6499999999999999,"required":0.3}
checks.2.sideChecks.1: {"side":1,"available":0.6499999999999999,"required":0.3}
checks.2.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
checks.2.criticalSection: column-face
checks.2.topCastFactor: 1.3
checks.3: 공통 자료 D52

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

checks.3.axis: L
checks.3.face: top
checks.3.available: 0.7999999999999999
checks.3.required: 0.3
checks.3.ratio: 0.37500000000000006
checks.3.status: OK
checks.3.sideChecks.0: {"side":-1,"available":0.7999999999999999,"required":0.3}
checks.3.sideChecks.1: {"side":1,"available":0.7999999999999999,"required":0.3}
checks.3.source: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
checks.3.criticalSection: column-face
checks.3.topCastFactor: 1.3
qualification: clause-scoped-not-whole-design
codeReferences: 공통 자료 D53
codeReferences.0: KDS 14 20 70:2021 4.2.2.3(1)-(3) [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b] (근거 K40)
codeReferences.1: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
codeReferences.2: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
codeReferences.3: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
codeReferences.4: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
scope: uniform-full-span-straight-footing-bars; column-dowel-for-ce-transfer separate
units.available: m
units.required: m
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-footing-anchorage@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design
KDS: KDS 14 20 70:2021 4.2.2.3(1)-(3) [근거 K40, 48쪽]
KDS: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
KDS: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
KDS: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
KDS: KDS 14 20 52:2024 4.1.2(1),(3),(5); Eq.4.1-2 [근거 K32, 38쪽]
foundation:A / U / foundation-column-transfer / OK
id: 해시 H29
6897b3121bb8cf728ae7ad0caa15f06cf047886d7242d4b600b1e7c6e9e9f2f1
부재 ID: foundation:A
category: foundation
검정비: 0.7994862354917319
사유: 미정

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

codeReferences: 공통 자료 D54
codeReferences.0: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
codeReferences.1: KDS 14 20 20:2022 4.7 [bad8aea615382f08f745aeb79e50671f831873428e5c231584b33594928b8cc3] (근거 K41)
codeReferences.2: KDS 14 20 52:2024 4.1.3; Eq.4.1-3 [2d24b7179850d4e1b1cac817ad7e6d890995f6f85d3ba9c0600d4343719f2d51] (근거 K42)
codeReferences.3: KDS 14 20 70:2021 4.2.3.1, 4.2.3.2 [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b] (근거 K43)
qualification: clause-scoped-not-whole-design
designTransferAllowed: 아니오
interfaceShear: 미정
steelAllocation: 공통 자료 D55
steelAllocation.codeReferences: 공통 자료 D56
steelAllocation.codeReferences.0: KDS 14 20 10:2021 4.2.3(2) tension-controlled axial tension [37b8a499e44e4607bd06ff4a134d97db2aa0b35925ea364dd6f60421eee6b994] (근거 K44)
steelAllocation.codeReferences.1: KDS 14 20 22:2022 4.6.2(6) [0a185decea2f04610b0af803443c5e72fec857f5055f8eb2b7a9c3d0e28d888e] (근거 K45)
steelAllocation.codeReferences.2: KDS 14 20 70:2021 4.2.3.1(3)②; 4.2.3.2(2) [eacf28e9e32d5e313c6aac73471e79934c42cfd63c8a4e00627047efc681fd2b] (근거 K46)
steelAllocation.qualification: clause-scoped-not-whole-design
steelAllocation.designTransferAllowed: 아니오
steelAllocation.status: OK
steelAllocation.reason: 미정
steelAllocation.ratio: 0
steelAllocation.demand: 0
steelAllocation.capacity: 0.0012566370614359175
steelAllocation.unit: m2
steelAllocation.tensionDemand: 0
steelAllocation.tensionPhi: 0.85
steelAllocation.tensionRequiredArea: 0
steelAllocation.shearRequiredArea: 0
steelAllocation.totalRequiredArea: 0
steelAllocation.providedArea: 0.0012566370614359175
steelAllocation.remainingAreaAfterTension: 0.0012566370614359175
steelAllocation.method: additive-required-steel-areas
steelAllocation.permanentCompressionCredit: 0
governingCriterion: development-below
수요 (단위 항목 참조): 0.23984587064751955
내력/허용값 (단위 항목 참조): 0.3
unit: m
criteria: 공통 자료 D57
criteria.0.id: concrete-bearing
criteria.0.demand: 14

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

criteria.0.capacity: 2386.8
criteria.0.unit: kN
criteria.0.ratio: 0.005865594100888218
criteria.0.status: OK
criteria.1.id: minimum-continuous-bars
criteria.1.demand: 0.0009
criteria.1.capacity: 0.0012566370614359175
criteria.1.unit: m2
criteria.1.ratio: 0.7161972439135289
criteria.1.status: OK
criteria.2.id: development-below
criteria.2.demand: 0.23984587064751955
criteria.2.capacity: 0.3
criteria.2.unit: m
criteria.2.ratio: 0.7994862354917319
criteria.2.status: OK
criteria.3.id: development-above
criteria.3.demand: 0.23984587064751955
criteria.3.capacity: 0.3
criteria.3.unit: m
criteria.3.ratio: 0.7994862354917319
criteria.3.status: OK
criteria.4.id: embedment-envelope
criteria.4.demand: 0.3
criteria.4.capacity: 0.44
criteria.4.unit: m
criteria.4.ratio: 0.6818181818181818
criteria.4.status: OK
criteria.5.id: column-region-envelope
criteria.5.demand: 0.3
criteria.5.capacity: 3
criteria.5.unit: m
criteria.5.ratio: 0.09999999999999999
criteria.5.status: OK
columnAxialDemand: 14
columnCompressionDemand: 14
columnTensionDemand: 0
bearingCapacity: 2386.8
minimumArea: 0.0009
providedArea: 0.0012566370614359175
requiredBelow: 0.23984587064751955
requiredAbove: 0.23984587064751955
providedBelow: 0.3
providedAbove: 0.3
availableBelow: 0.44
development: 공통 자료 D58

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

development.0: 공통 자료 D59
development.0.diameter: 0.02
development.0.below: 공통 자료 D60
development.0.below.status: CALCULATED
development.0.below.rawMm: 239.84587064751955
development.0.below.requiredMm: 239.84587064751955
development.0.below.unit: mm
development.0.below.source: KDS 14 20 52:2024 4.1.3; Eq.4.1-3 [근거 K42, 49쪽]
development.0.below.designTransferAllowed: 아니오
development.0.below.reductionApplied: 아니오
development.0.above: 공통 자료 D60 참조 (51쪽)
development.0.mode: compression
development.1: 공통 자료 D59 참조 (51쪽)
development.2: 공통 자료 D59 참조 (51쪽)
development.3: 공통 자료 D59 참조 (51쪽)
columnMemberId: AB
columnDetailId: R
columnDetailVersion: 1
momentReference: column-interface-at-footing-top
columnInterfaceHeightAboveBase: 0.5
scope: pure compression, unreduced bearing, minimum continuous bearing and development; no moment/shear/laps
bearingEnhancementApplied: 아니오
excessBearingSteelCredit: 아니오
units.force: kN
units.area: m2
units.length: m
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-column-footing-transfer@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: CLAUSE_APPLIED / clause-scoped-not-whole-design
KDS: KDS 14 20 10:2021 4.2.3(2) [근거 K5, 22쪽]
KDS: KDS 14 20 20:2022 4.7 [근거 K41, 49쪽]
KDS: KDS 14 20 52:2024 4.1.3; Eq.4.1-3 [근거 K42, 49쪽]
KDS: KDS 14 20 70:2021 4.2.3.1, 4.2.3.2 [근거 K43, 49쪽]
foundation:A / U / foundation-settlement / N_A
id: 해시 H30
880b15de3411364f9cf6991d5222a8a252e2877c875007ad76cc84cb7d08715a
부재 ID: foundation:A
category: foundation
검정비: 미정
사유: CHECK_REQUIRES_SERVICE_COMBINATION
applicability.expectedPurpose: service
applicability.actualPurpose: strength
applicability.basis: declared-load-combination-purpose; required

검사별 계산 및 미완료 사유

검토용 - 시공 및 최종 설계 승인용 아님

상세: recorded-data @1

입력: 53be07a5469b651697d1873c2773ad82

평가: evaluation-4f73ce7b0c453de6fb23836bd67821b88bcbcd69cd0a0421ed

-combination-coverage-separate
analysisRunId: E:2026-09-13T23:58:22.126Z:1
규칙: p25-ground-settlement@1 / b8fc7bd6bc119b267b8792aa6be65a2834a8d2aeacaf3b07daec2f2c11522069
KDS: NOT_ESTABLISHED / missing-or-unqualified-input
KDS: KDS 11 50 05:2025 4.2.1, 4.2.6 [fbadf14f98c82adf4ccbb35353ae53ec5378caf129b6be996d0f115ddfb16172] (근거 K47)
foundation:A / U / foundation-code-compliance / NOT_CHECKED
id: 해시 H31
39175396550093c553ec56bb2dabf11d77d4f87750e0e96df4b9c64665aac873
부재 ID: foundation:A
category: foundation
검정비: 미정
사유: REQUIRED_KDS_CHECKS_INCOMPLETE
requiredCheckIds: 해시 목록 14건 (원래 순서)
requiredCheckIds[1]: 해시 H17 참조 (29쪽)
requiredCheckIds[2]: 해시 H18 참조 (29쪽)
requiredCheckIds[3]: 해시 H19 참조 (29쪽)
requiredCheckIds[4]: 해시 H20 참조 (30쪽)
requiredCheckIds[5]: 해시 H21 참조 (31쪽)
requiredCheckIds[6]: 해시 H22 참조 (35쪽)
requiredCheckIds[7]: 해시 H23 참조 (37쪽)
requiredCheckIds[8]: 해시 H24 참조 (40쪽)
requiredCheckIds[9]: 해시 H25 참조 (43쪽)
requiredCheckIds[10]: 해시 H26 참조 (44쪽)
requiredCheckIds[11]: 해시 H27 참조 (45쪽)
requiredCheckIds[12]: 해시 H28 참조 (46쪽)
requiredCheckIds[13]: 해시 H29 참조 (48쪽)
requiredCheckIds[14]: 해시 H30 참조 (51쪽)
missingCheckIds: ["foundation-sliding","foundation-overturning",
"foundation-punching","foundation-spacing"]
failedCheckIds: ["foundation-punching"]
qualification: scoped-check-aggregation-not-project-qualification
codeReferences: []
wholeDesignQualified: 아니오
analysisRunId: E:2026-09-13T23:58:22.126Z:1
KDS: NOT_ESTABLISHED / scoped-check-aggregation-not-project-qualification
KDS: KDS 14 20 70:2021 4.2 [근거 K22, 29쪽]
KDS: KDS 41 20 00:2024 4 [근거 K20, 28쪽]