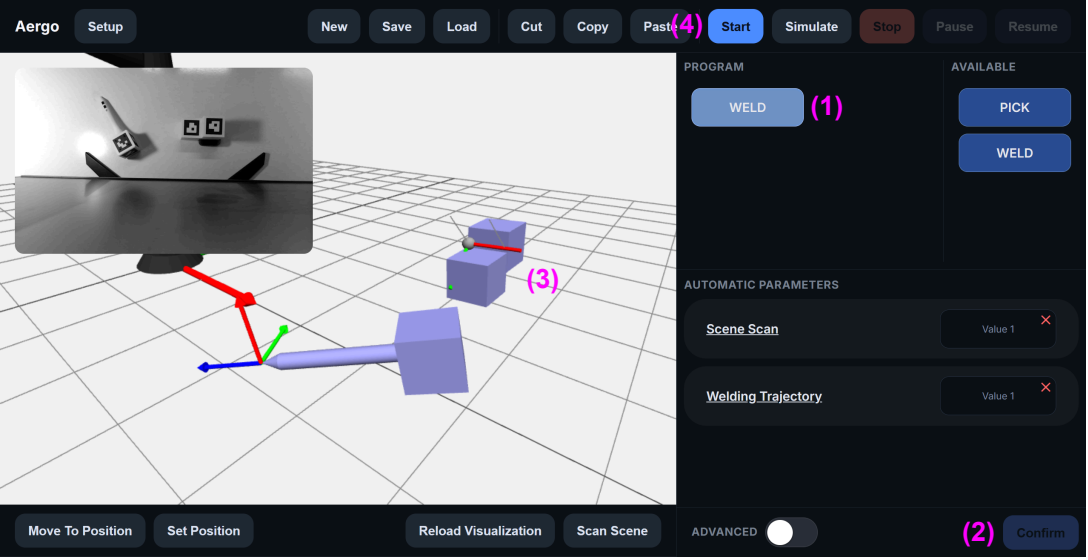
Aergo
Setup
New
Save
Load
Cut
Copy
Past
(4)
Start
Simulate
Stop
Pause
Resume
PROGRAM
WELD
(1)
AVAILABLE
PICK
WELD
(3)
AUTOMATIC PARAMETERS
Scene Scan
Value 1
Welding Trajectory
Value 1
Move To Position
Set Position
Reload Visualization
Scan Scene
ADVANCED
(2)
Confirm